

PROBLEM SUMMARY

Sample Rating Trend

ISO




TAN TAN

Component **Hydraulic System**

NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

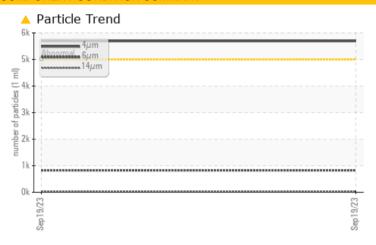

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION						
Particles >4µm	ASTM D7647	>5000	△ 5693						
Oil Cleanliness	ISO 4406 (c)	>19/17/14	20/17/12						

Customer Id: TESAUSTLC Sample No.: TLC05964601 Lab Number: 05964601 Test Package: PLANT

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sa

Sample Rating Trend

ISO

TAN TAN

Component

Hydraulic System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		<u>.</u>				
				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		TLC05964601		
Sample Date		Client Info		19 Sep 2023		
Machine Age	hrs	Client Info		0		
	hrs	Client Info		0		
Oil Age Oil Changed	1115	Client Info		N/A		
		Ciletit IIIIO		ATTENTION		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	0		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		7		
Calcium	ppm	ASTM D5185m		56		
Phosphorus	ppm	ASTM D5185m		126		
Zinc	ppm	ASTM D5185m		107		
Sulfur	ppm	ASTM D5185m		482		
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm		>20	0		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	△ 5693		
Particles >6µm		ASTM D7647	>1300	826		
Particles >14µm		ASTM D7647	>160	35		
Particles >21µm		ASTM D7647		8		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<u>^</u> 20/17/12		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D8045

0.21



OIL ANALYSIS REPORT

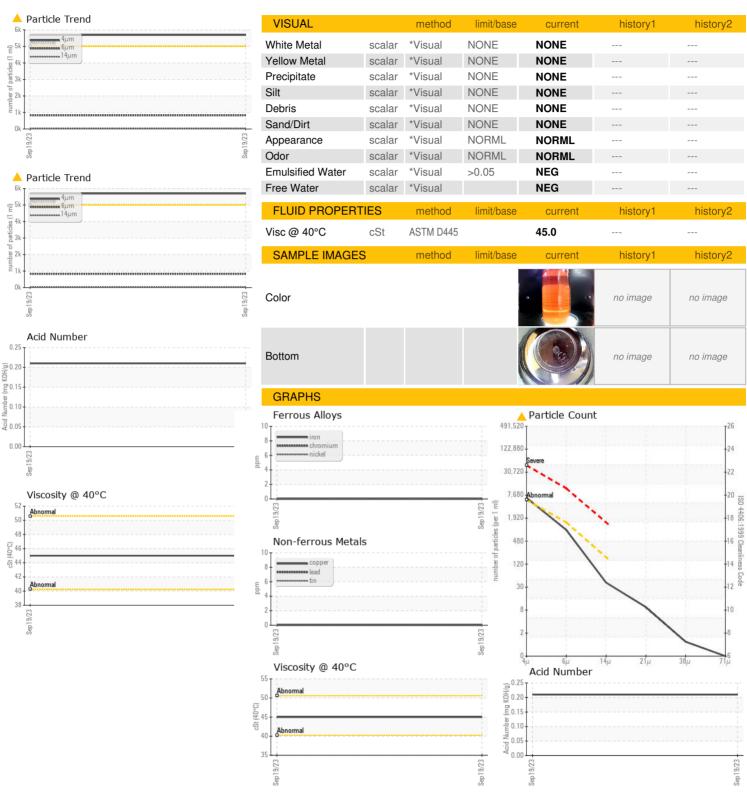





Laboratory Sample No. Lab Number Unique Number

: TLC05964601 : 05964601 : 10671152 Test Package : PLANT

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 29 Sep 2023 Diagnosed Diagnostician

: 02 Oct 2023 : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

TESLA 1 Tesla Road, BIW E58 Austin, TX

US 78725 Contact: Dave Mitchell davmitchell@tesla.com T: (260)226-1968 F: