


PROBLEM SUMMARY

Sample Rating Trend ISO

Machine Id 4104922 (S/N 1064) Component

Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

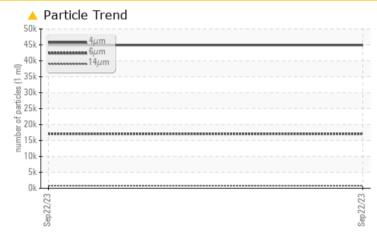

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL					
Particles >6µm	ASTM D7647 >13	00 🔺 17091					
Particles >14µm	ASTM D7647 >80	▲ 823					
Particles >21µm	ASTM D7647 >20	<mark>▲ 129</mark>					
Particles >38µm	ASTM D7647 >4	▲ 5					
Oil Cleanliness	ISO 4406 (c) >/1	17/13 🔺 23/21/17					

Customer Id: STOYON Sample No.: KC05966354 Lab Number: 05966354 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Don Baldridge +1 <u>don.b505@comcast.net</u>

To change component or sample information: Customer Service +1 1-800-237-1369 <u>customerservice@wearcheck.com</u> There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



ISO

Machine Id 4104922 (S/N 1064) Component

Compressor Fluid KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC05966354		
Sample Date		Client Info		22 Sep 2023		
Machine Age	hrs	Client Info		14788		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	6		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	210	0		
Cadmium	ppm	ASTM D5185m		0		
	ррш			-		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	2		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	43		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		2		
Zinc	ppm	ASTM D5185m		28		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		17		
Potassium	ppm	ASTM D5185m	>20	3		
Water	%	ASTM D6304	>0.05	0.013		
ppm Water	ppm	ASTM D6304	>500	136.1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		44923		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	4 5		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	A 23/21/17		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2




OIL ANALYSIS REPORT

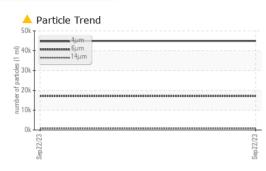

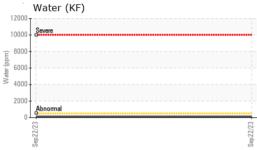

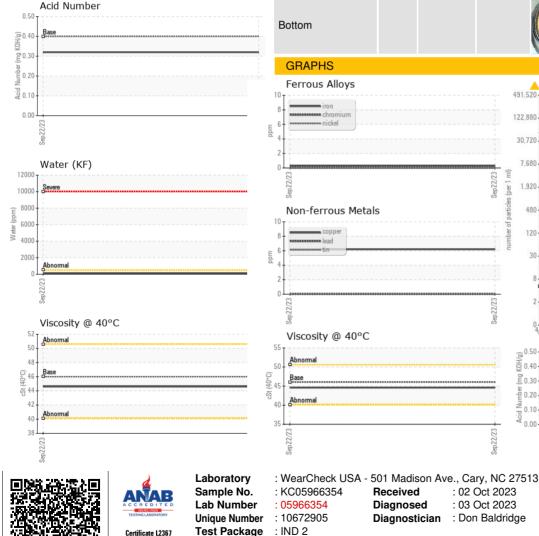

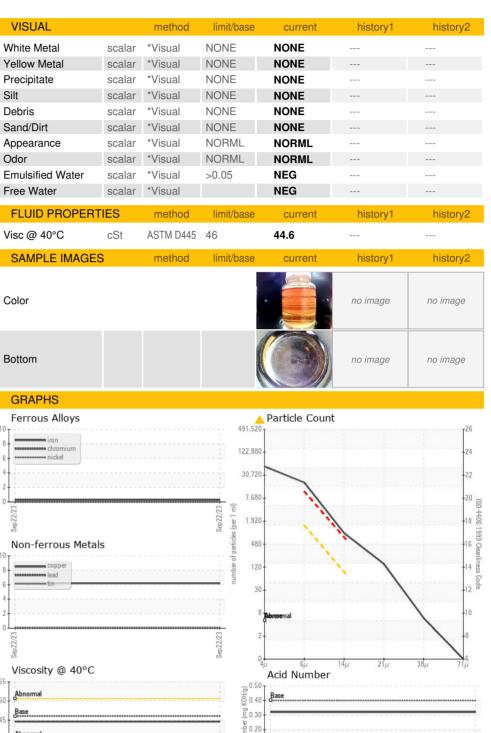

0.10

0.00

Acid

Sep22/23

: 02 Oct 2023

: 03 Oct 2023

: Don Baldridge

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Received

Diagnosed

Diagnostician

Abnorma

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Sep22/23

STONE SOLUTIONS

Contact: Service Manager

208 MCLEAN AVE

YONKERS, NY

US 10705

Certificate L2367