



PROBLEM SUMMARY

UNKNOWN SULLAIR 201709200005 - VISTECH MFG SOLUTIONS

Compressor

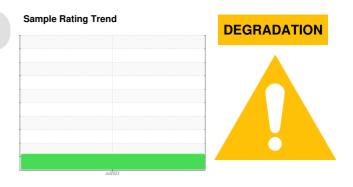

COMPONENT CONDITION SUMMARY

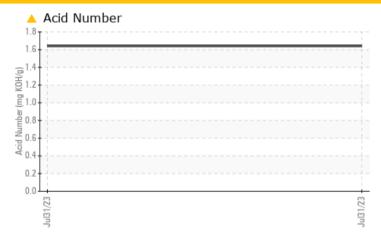

RECOMMENDATION

The oil is near the end of it's useful service life, recommend schedule an oil change. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ATTENTION					
Acid Number (AN)	mg KOH/g	ASTM D8045	<u> </u>					

Customer Id: UCAIRSID Sample No.: UCH05966434 Lab Number: 05966434 Test Package: IND 2 To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description				
Service/change Fluid			?	The oil is near the end of it's useful service life, recommend schedule an oil change.				

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

UNKNOWN SULLAIR 201709200005 - VISTECH MFG SOLUTIONS

Compressor



Sample Rating Trend



DIAGNOSIS

Recommendation

The oil is near the end of it's useful service life. recommend schedule an oil change. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is at the top-end of the recommended

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH05966434		
Sample Date		Client Info		31 Jul 2023		
Machine Age	hrs	Client Info		40768		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		132		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m		13		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		84		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6		
Sodium	ppm	ASTM D5185m		19		
Potassium	ppm	ASTM D5185m	>20	3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		▲ 1.64		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
= 00 (0) D (



OIL ANALYSIS REPORT

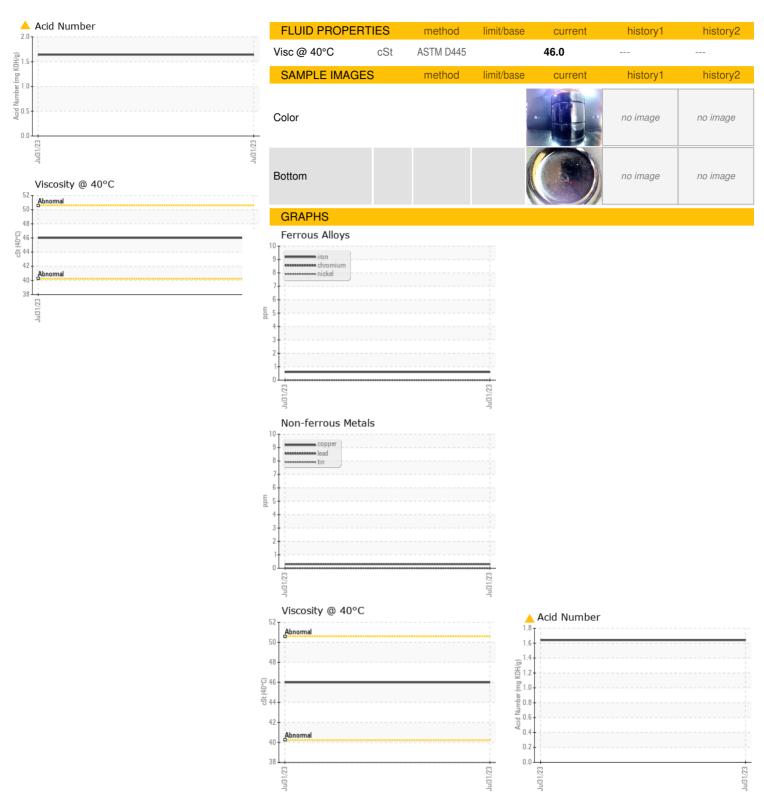





Laboratory Sample No. Lab Number

: 05966434 Unique Number : 10672985 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH05966434 Received : 02 Oct 2023 : 04 Oct 2023

Diagnosed Diagnostician : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AIR HANDLING EQUIPMENT INC

1389 RIVERSIDE DR SIDNEY, OH US 45365

Contact: CRISTI CURL cristi@ahequip.net

F: (937)492-3147

Contact/Location: CRISTI CURL - UCAIRSID