

# **PROBLEM SUMMARY**

Machine Id 1056828 (S/N 1024)


Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

# Sample Rating Trend ISO

## **COMPONENT CONDITION SUMMARY**

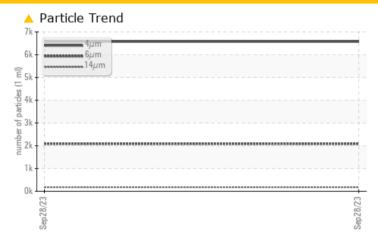

## RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status			ABNORMAL							
Particles >6µm	ASTM D7647	>1300	<b>2088</b>							
Particles >14μm	ASTM D7647	>80	<b>180</b>							
Particles >21µm	ASTM D7647	>20	<b>44</b>							
Oil Cleanliness	ISO 4406 (c)	>/17/13	<b>20/18/15</b>							

Customer Id: MORSIL Sample No.: KCPA002884 Lab Number: 05969664 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## RECOMMENDED ACTIONS

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**



# 1056828 (S/N 1024)

Component

Compressor

KAESER SIGMA (OEM) FG-460 (--- GAL)

## **DIAGNOSIS**

## Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

## Wear


All component wear rates are normal.

## Contamination

There is a high amount of particulates present in the oil.

## **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

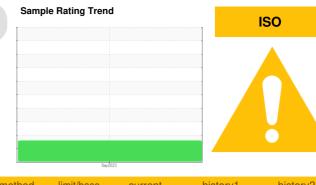

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA002884		
Sample Date		Client Info		28 Sep 2023		
Machine Age	hrs	Client Info		36884		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m	500	462		
Zinc	ppm	ASTM D5185m		1		
Sulfur	ppm	ASTM D5185m		665		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.002		
ppm Water	ppm	ASTM D6304	>500	15.3		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6575		
Particles >6µm		ASTM D7647	>1300	<b>^</b> 2088		
Particles >14µm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u>44</u>		
Particles >38µm		ASTM D7647	>4	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/15		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.5	0.24		



# **OIL ANALYSIS REPORT**

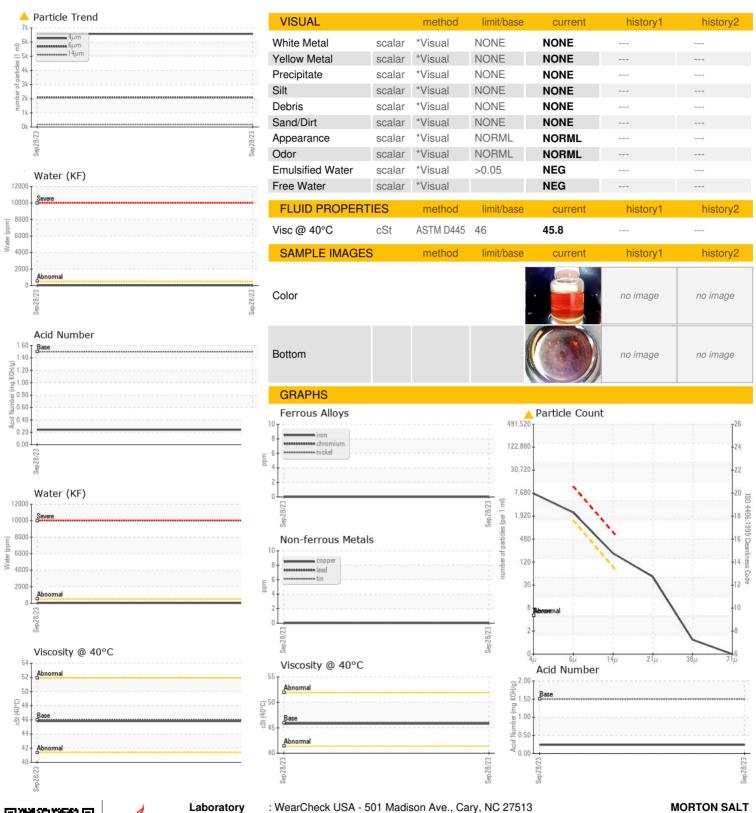



Laboratory Sample No. Lab Number **Unique Number** 

: KCPA002884 : 05969664

Received : 10676215

Diagnosed Test Package : IND 2 ( Additional Tests: KF, PrtCount )

: 04 Oct 2023 : 09 Oct 2023 Diagnostician : Angela Borella

45 RIBAUD AVE SILVER SPRINGS, NY US 14550 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: