


OIL ANALYSIS REPORT

Building 12 **Roll Crusher 2**

Soutwest Bearing

MOBIL MOBILGEAR 600 XP ISO 68 (3 GAL)

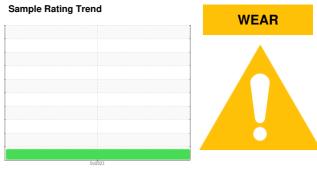

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The iron level is abnormal. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	ΛΑΤΙΩΝΙ	method	limit/base	current	history1	history2
	ALION		IIIIIIIIIIIII			
Sample Number		Client Info		WC0853783		
Sample Date		Client Info		08 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		286		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	▲ 36		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		2		
Aluminum	ppm	ASTM D5185m	>20	2		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	<1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		24		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		252		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		6589		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	11		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.73		



OIL ANALYSIS REPORT

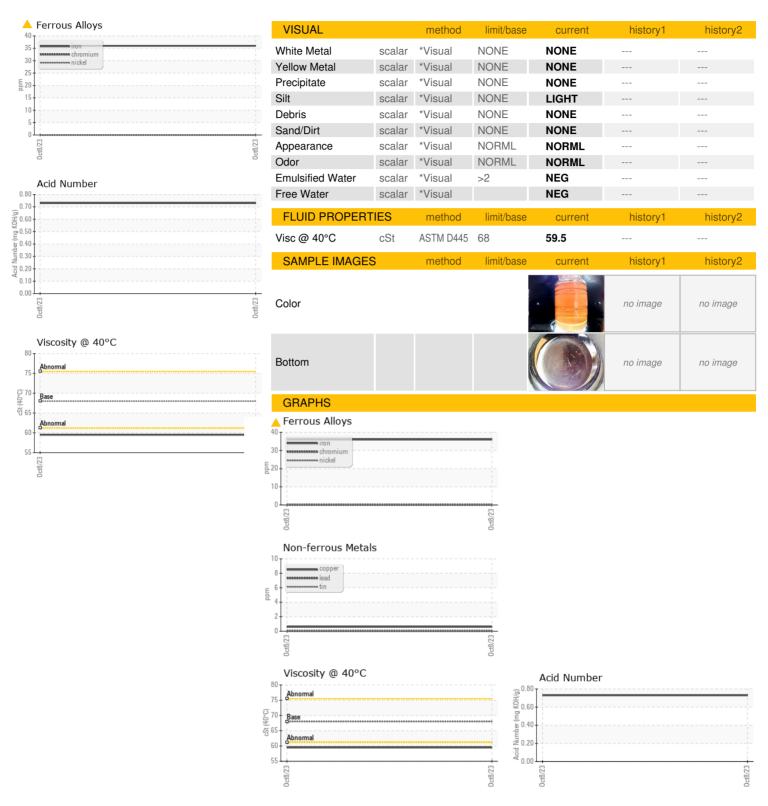





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: 05981286 : 10698581 Test Package : IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0853783 : 17 Oct 2023 Recieved Diagnosed : 19 Oct 2023

Diagnostician

: Don Baldridge

4191 NC 87 S MONCURE, NC US 27559

Contact: CHARLES JARRELL

cjarrell@mmm.com

T:

3M - PITTSBORO

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: