

PROBLEM SUMMARY

Sample Rating Trend


ISO

T-2 SILO (SOUTH PLANT)

Component **Gearbox**

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY

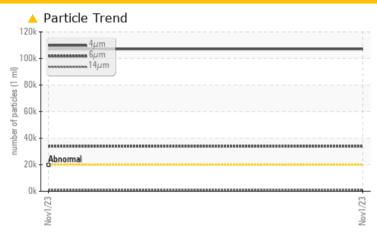

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

PROBLEMATIC TES	T RESULTS			
Sample Status			ABNORMAL	
Particles >4µm	ASTM D7647	>20000	107123	
Particles >6µm	ASTM D7647	>5000	33834	
Particles >14µm	ASTM D7647	>640	983	
Oil Cleanliness	ISO 4406 (c)	>21/19/16	24/22/17	

Customer Id: TYSSAI Sample No.: USP0003055 Lab Number: 05996718 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component if applicable.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

T-2 SILO (SOUTH PLANT)

Component

Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

Recommendation

DIAGNOSIS

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
		Client Info		USP0003055		
Sample Number		Client Info		01 Nov 2023		
Sample Date Machine Age	hrs	Client Info		01 NOV 2023		
Oil Age	hrs	Client Info		0		
Oil Changed	1113	Client Info		N/A		
Sample Status		Oliciit iiilo		ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	6		
Chromium	ppm	ASTM D5185m	>15	<1		
Nickel	ppm	ASTM D5185m	>15	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>200	<1		
Tin	ppm	ASTM D5185m	>25	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		10		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		10		
Phosphorus	ppm	ASTM D5185m		513		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		6491		
CONTAMINANTS	,	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
Water	%	ASTM D6304	>0.2	0.005		
ppm Water	ppm	ASTM D6304	>2000	58.6		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>20000	<u> </u>		
Particles >6µm		ASTM D7647	>5000	<u></u> 33834		
Particles >14μm		ASTM D7647	>640	983		
Particles >21μm		ASTM D7647	>160	128		
Particles >38μm		ASTM D7647	>40	1		
Particles >71μm		ASTM D7647	>10	0		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<u> </u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	та КОЦ/а	VCTM DOUVE		0.50		


0.58

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

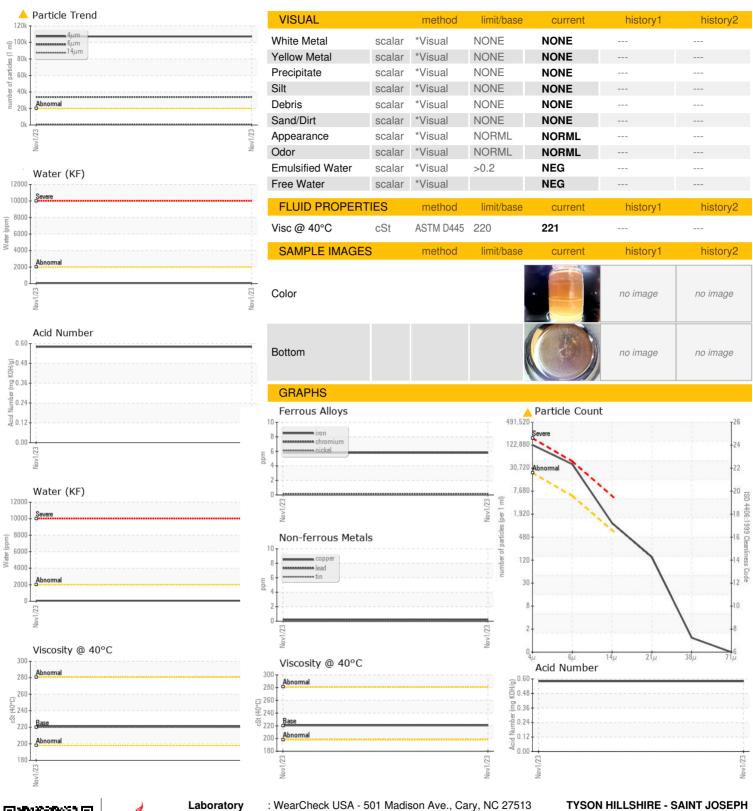



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: USP0003055 : 05996718 : 10725078 Test Package : IND 2

Received : 02 Nov 2023 Diagnosed : 06 Nov 2023 Diagnostician : Doug Bogart

5807 MITCHELL AVE SAINT JOSEPH, MO US 64507

Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)