

PROBLEM SUMMARY

Sample Rating Trend


ISO

T-2 VAC MILL (SOUTH PLANT)

Agitator Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

COMPONENT CONDITION SUMMARY

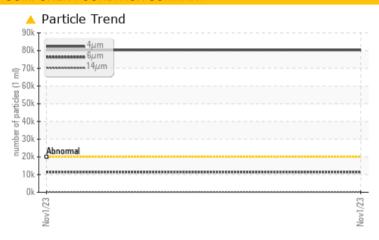

RECOMMENDATION

Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status			ABNORMAL				
Particles >4µm	ASTM D7647	>20000	<u>A</u> 80311				
Particles >6µm	ASTM D7647	>5000	<u> </u>				
Oil Cleanliness	ISO 4406 (c)	>21/19/16	4 24/21/15				

Customer Id: TYSSAI Sample No.: USP0003044 Lab Number: 05996732 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

T-2 VAC MILL (SOUTH PLANT)

Agitator Gearbox

JAX MAGNA-PLATE 220 FG (--- GAL)

Recommendation

DIAGNOSIS

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Nov2023			
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
		Client Info		USP0003044		
Sample Number Sample Date		Client Info		01 Nov 2023		
Machine Age	hrs	Client Info		01 1404 2023		
Oil Age	hrs	Client Info		0		
Oil Changed	1113	Client Info		N/A		
Sample Status		Olletti IIIIO		ABNORMAL		
			11 11 11	-		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>150	12		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	<1		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		4		
Barium	ppm	ASTM D5185m		<1		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		2		
Phosphorus	ppm	ASTM D5185m		519		
Zinc	ppm	ASTM D5185m		1		
Sulfur	ppm	ASTM D5185m		3150		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.1	0.003		
ppm Water	ppm	ASTM D6304	>1000	38.7		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>20000	<u> </u>		
Particles >6µm		ASTM D7647	>5000	<u> </u>		
Particles >14μm		ASTM D7647	>640	173		
Particles >21µm		ASTM D7647	>160	22		
Particles >38µm		ASTM D7647	>40	1		
Particles >71µm		ASTM D7647	>10	0		
Oil Cleanliness		ISO 4406 (c)	>21/19/16	<u>4</u> 24/21/15		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
						,


0.65

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

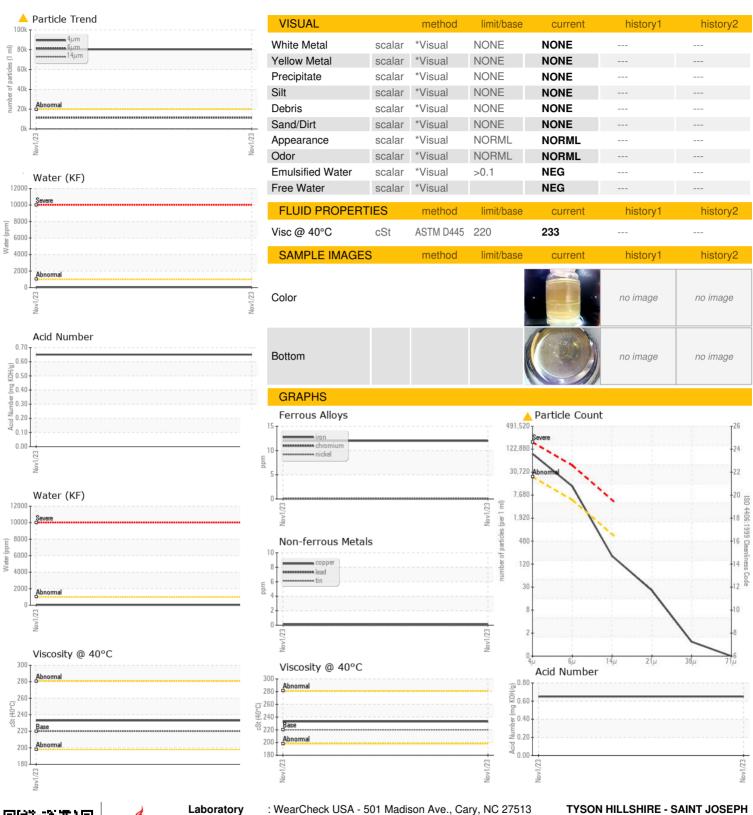



Certificate L2367

Laboratory Sample No. Lab Number Unique Number

Test Package

: 05996732

: USP0003044 : 10725092 : IND 2

Received : 02 Nov 2023

Diagnosed : 06 Nov 2023 : Doug Bogart Diagnostician

TYSON HILLSHIRE - SAINT JOSEPH

5807 MITCHELL AVE SAINT JOSEPH, MO US 64507

Contact:

T: F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)