

PROBLEM SUMMARY

RV

Sample Rating Trend

SEDIMENT



BUSCH CV 4.1 (S/N C2791)

Vacuum Pump

USPI VAC 100 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Silt	scalar	*Visual	NONE	▲ MODER			

Customer Id: CAVHER Sample No.: USPM31173 Lab Number: 05999045 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

SEDIMENT



BUSCH CV 4.1 (S/N C2791)

Component

Vacuum Pump

USPI VAC 100 (--- GAL)

Fluid

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Dct2023		
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USPM31173		
Sample Date		Client Info		26 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	13		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	0		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	0	0		
Calcium	ppm	ASTM D5185m	0	2		
Phosphorus	ppm	ASTM D5185m	1800	173		
Zinc	ppm	ASTM D5185m	0	28		
Sulfur	ppm	ASTM D5185m	0	14		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	6		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>.1	0.003		
ppm Water	ppm	ASTM D6304	>1000	36.8		
FLUID DEGRADAT	TION	method	limit/base	current	history1	history2


0.20

mg KOH/g ASTM D8045 0.05

Acid Number (AN)



OIL ANALYSIS REPORT

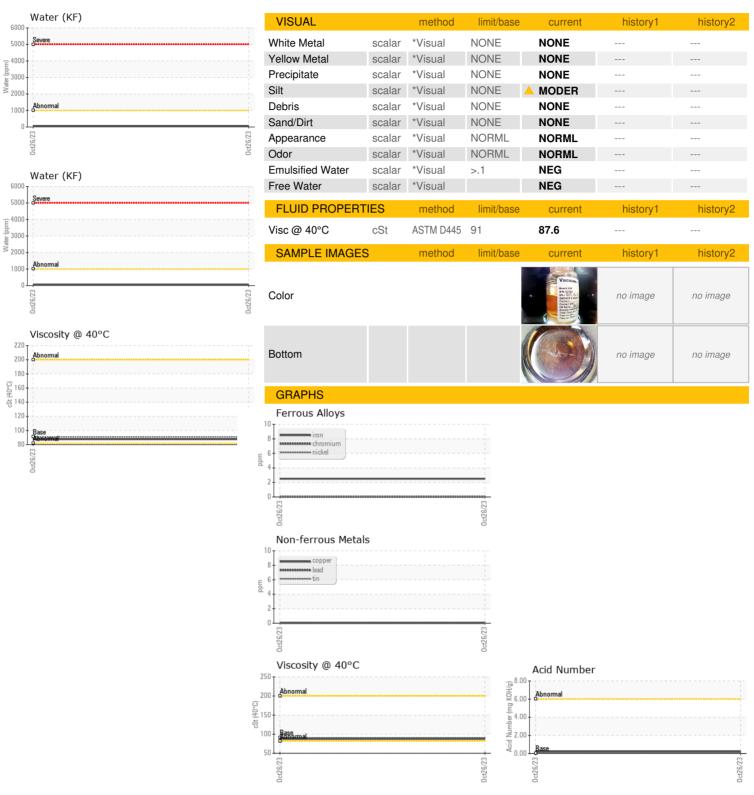





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : USPM31173 : 05999045 : 10727405

Received Diagnosed Diagnostician

: 06 Nov 2023 : 07 Nov 2023 : Doug Bogart **CAVINESS BEEF PACKERS LTD**

Contact/Location: HARRY RADLOFF - CAVHER

PO BOX 790 HEREFORD, TX US 79045

T: (806)357-2443

Contact: HARRY RADLOFF

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (806)357-2468