

PROBLEM SUMMARY

Sample Rating Trend

WATER


5147798 (S/N 1252)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

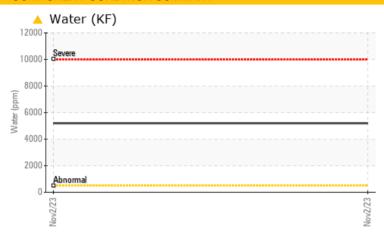

RECOMMENDATION

There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS											
Sample Status				ABNORMAL							
Water	%	ASTM D6304	>0.05	△ 0.520							
ppm Water	ppm	ASTM D6304	>500	5200							
Emulsified Water	scalar	*Visual	>0.05	0.2%							

Customer Id: INTLANSC Sample No.: KCPA004683 Lab Number: 06001042 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Acid Number (AN)


mg KOH/g ASTM D8045 1.0

5147798 (S/N 1252)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

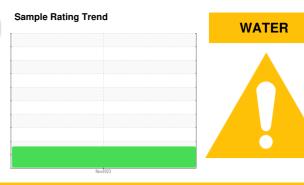

DIAGNOSIS

Recommendation

There is too much water present in this sample to perform a particle count. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA004683		
Sample Date		Client Info		02 Nov 2023		
Machine Age	hrs	Client Info		6063		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	13		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	41		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	17		
Sulfur	ppm	ASTM D5185m	23500	18122		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
01!		ASTM D5185m		9		
Sodium	ppm	ASTIVI DOTOSITI		-		
Potassium	ppm	ASTM D5185m	>20	1		
			>20 >0.05	1 <u>^</u> 0.520		
Potassium	ppm	ASTM D5185m		-		
Potassium Water	ppm % ppm	ASTM D5185m ASTM D6304	>0.05	△ 0.520		

0.36



OIL ANALYSIS REPORT







Laboratory Sample No. Lab Number Unique Number

: KCPA004683 : 06001042 : 10729402

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 07 Nov 2023 Diagnosed

: 09 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

INTERNATIONAL MACHINERY SALES

1320 CAMP CREEK RD LANCASTER, SC US 29720

Contact: Service Manager

T:

Contact/Location: Service Manager - INTLANSC

F: