

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



NISSAN 24865-03

Component

Transmission (Auto)

ATF (--- GAL)

		100	
	Δ(-)Γ	NOS	18
יום	τ	τ	\mathbf{r}

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.


				Nov2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WCM2005008		
Sample Date		Client Info		13 Nov 2023		
Machine Age	mls	Client Info		0		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>160	74		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m	>5	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>5	0		
Aluminum	ppm	ASTM D5185m	>50	28		
Lead	ppm	ASTM D5185m	>50	0		
Copper	ppm	ASTM D5185m	>225	10		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		67		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		19		
Calcium	ppm	ASTM D5185m		264		
Phosphorus	ppm	ASTM D5185m		263		
Zinc	ppm	ASTM D5185m		40		
Sulfur	ppm	ASTM D5185m		1253		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	10		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

Acid Number (AN) mg KOH/g ASTM D8045

0.68



OIL ANALYSIS REPORT

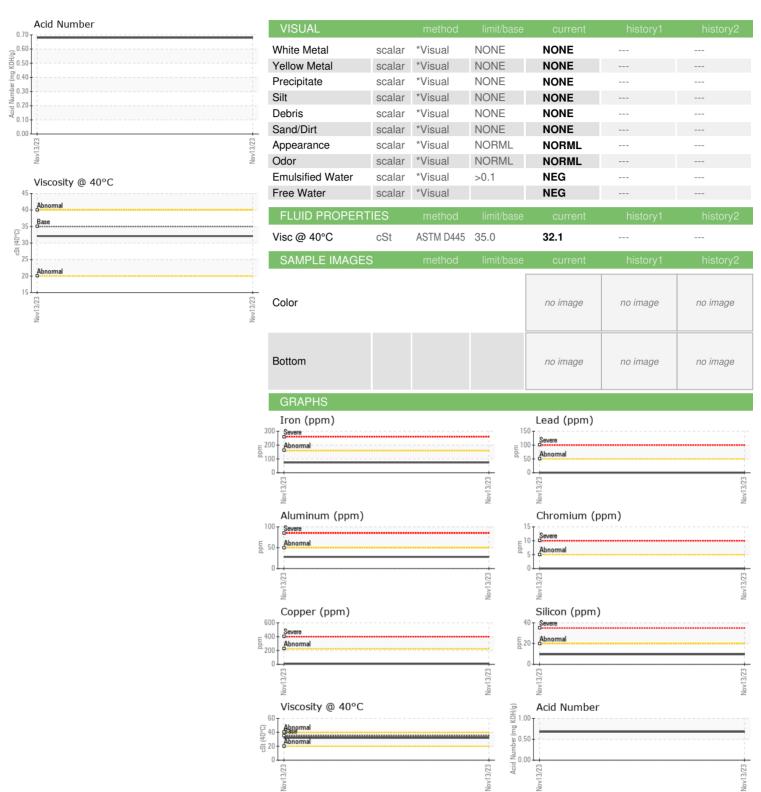





Certificate L2367

Report Id: SOUCRE [WUSCAR] 06007117 (Generated: 11/20/2023 15:58:58) Rev: 1

Laboratory Sample No. Lab Number **Unique Number**

: WCM2005008 : 06007117 : 10740879 Test Package : MOB 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 14 Nov 2023 Diagnosed

: 20 Nov 2023 Diagnostician : Doug Bogart SOUTHERN AUTOMOTIVE CONSULTING

P.O. BOX 730 CREEDMOOR, NC

US 27522

Contact: ANDREW MORTON andymorton711@yahoo.com

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T:

F: