


## **PROBLEM SUMMARY**


# DALE A HELLER [DALE A HELLER] 012 624201-12

Component
Auxiliary Steering

**CHEVRON RANDO HDZ 68 (--- GAL)** 

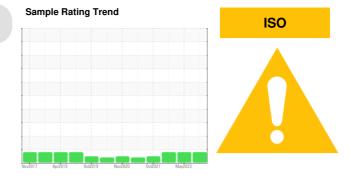

## **COMPONENT CONDITION SUMMARY**

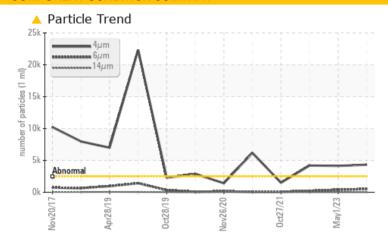

## RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TE	ST RESULTS				
Sample Status			ATTENTION	ATTENTION	ATTENTION
Particles >4µm	ASTM D7647	>2500	<b>4317</b>	<u>4138</u>	<u>4194</u>
Oil Cleanliness	ISO 4406 (c)	>18/16/13	<b>19/16/12</b>	19/16/11	19/15/11

Customer Id: INGPAD Sample No.: MW0058464 Lab Number: 06007620 Test Package: MAR 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS

## 01 May 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the fluid. The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.



#### 27 Apr 2022 Diag: Don Baldridge

150



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the fluid. The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.



### 27 Oct 2021 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The amount and size of particulates present in the system are acceptable. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.






## **OIL ANALYSIS REPORT**

## DALE A HELLER [DALE A HELLER] 012 624201-12

**Auxiliary Steering** 

**CHEVRON RANDO HDZ 68 (--- GAL)** 

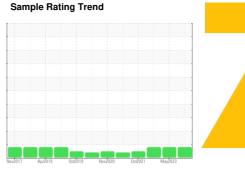



## **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the fluid.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

		Nov2017	Apr2019 Oct2019	Nov2020 Oct2021 M	ay2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		MW0058464	MW0049444	MW0034389
Sample Date		Client Info		01 Nov 2023	01 May 2023	27 Apr 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	Not Changd	N/A
Sample Status				ATTENTION	ATTENTION	ATTENTION
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1	2	2
Chromium	ppm	ASTM D5185m	>15	0	<1	0
Nickel	ppm	ASTM D5185m	>5	0	<1	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	<1
Aluminum	ppm	ASTM D5185m	>5	0	0	0
Lead	ppm	ASTM D5185m	>10	0	1	1
Copper	ppm	ASTM D5185m	>50	19	20	21
Tin	ppm	ASTM D5185m	>5	0	<1	<1
Antimony	ppm	ASTM D5185m				
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	<1
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	<1
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	0	0	<1	0
Calcium	ppm	ASTM D5185m	75	42	48	54
Phosphorus	ppm	ASTM D5185m	275	341	359	417
Zinc	ppm	ASTM D5185m	350	405	455	450
Sulfur	ppm	ASTM D5185m	550	968	1010	968
CONTAMINANTS	}	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	0	<1	<1
Sodium	ppm	ASTM D5185m		<1	0	<1
Potassium	ppm	ASTM D5185m	>20	0	<1	0
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>2500	<b>4317</b>	<u>4138</u>	<u></u> 4194
Particles >6µm		ASTM D7647	>640	513	397	217
Particles >14µm		ASTM D7647	>80	23	20	20
Particles >21µm		ASTM D7647	>20	5	7	6
Particles >38µm		ASTM D7647	>4	0	1	0
Particles >71μm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>18/16/13	<b>19/16/12</b>	<b>1</b> 9/16/11	▲ 19/15/11
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.28	0.35	0.35



## **OIL ANALYSIS REPORT**

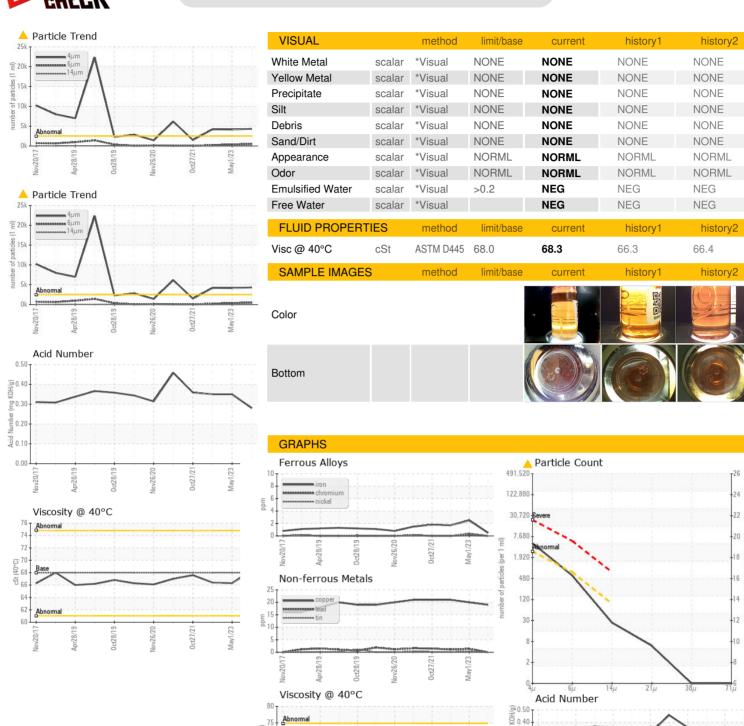





Laboratory Sample No. Lab Number **Unique Number** 

: 06007620 : 10741382

Š 65

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : MW0058464 : 14 Nov 2023 Diagnosed : 16 Nov 2023

: Don Baldridge Diagnostician Test Package : MAR 2 ( Additional Tests: PrtCount )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

900 S 3RD ST PADUCAH, KY

US 42003 Contact: JUSTIN WHEELER

**INGRAM BARGE** 

0ct27/21

justin.wheeler@ingrambarge.com

T: F: (615)695-3697

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

₤0.30 흗 0.20

₹ 0.10 0.00 G

May1/23 -

0ct27/21

0ct28/19