

### **PROBLEM SUMMARY**

Sample Rating Trend


ISO

# Machine Id KAESER SK 20 5845352 (S/N 1016)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

### **COMPONENT CONDITION SUMMARY**

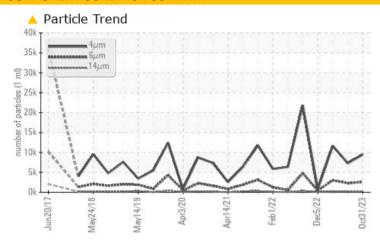

### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL	ABNORMAL	ABNORMAL				
Particles >6µm	ASTM D7647	>1300	<u>2591</u>	<u>^</u> 2283	<u>^</u> 2995				
Particles >14μm	ASTM D7647	>80	<b>234</b>	<u>^</u> 219	<u>223</u>				
Particles >21µm	ASTM D7647	>20	<b>△</b> 63	<b>△</b> 73	<u>^</u> 62				
Oil Cleanliness	ISO 4406 (c)	>/17/13	<b>20/19/15</b>	20/18/15	<u>\</u> 21/19/15				

Customer Id: AKIWIN Sample No.: KC06007754 Lab Number: 06007754 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

### HISTORICAL DIAGNOSIS

### 17 Jul 2023 Diag: Don Baldridge

WATER



The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. There is a high amount of particulates present in the oil. There is a light concentration of water present in the oil. The AN level is acceptable for this fluid.



### 17 Mar 2023 Diag: Don Baldridge

ISO



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of particulates present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



### 05 Dec 2022 Diag: Jonathan Hester

WAIER




The filter change at the time of sampling has been noted. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. Free water present. There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





### **OIL ANALYSIS REPORT**

Sample Rating Trend

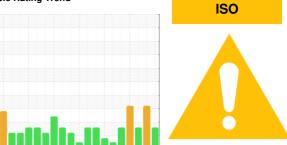

## KAESER SK 20 5845352 (S/N 1016)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

**DIAGNOSIS** 

### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		un2017 May	2018 May2019 Apr20	20 Apr2021 Feb2022 Dec20	0ct202	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC06007754	KC05909485	KC05813935
Sample Date		Client Info		31 Oct 2023	17 Jul 2023	17 Mar 2023
Machine Age	hrs	Client Info		45196	0	40898
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	0
Titanium	ppm	ASTM D5185m	>3	<1	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm		>50	5	19	8
Tin	ppm	ASTM D5185m	>10	0	0	0
Vanadium	ppm	ASTM D5185m		<1	<1	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	<1
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	90	0	2	18
Calcium	ppm	ASTM D5185m	2	0	0	2
Phosphorus	ppm	ASTM D5185m		0	2	4
Zinc	ppm	ASTM D5185m		0	2	19
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	<1
Sodium	ppm	ASTM D5185m		14	<1	4
Potassium	ppm	ASTM D5185m	>20	0	2	<1
Water	%	ASTM D6304	>0.05	0.012	<b>△</b> 0.145	0.008
ppm Water	ppm	ASTM D6304	>500	128.3	<u>▲</u> 1457.8	86.4
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		9469	7293	11669
Particles >6µm		ASTM D7647	>1300	<u>2591</u>	<u>^</u> 2283	<u>^</u> 2995
Particles >14μm		ASTM D7647	>80	<b>234</b>	<u>^</u> 219	<u>223</u>
Particles >21μm		ASTM D7647	>20	<b>△</b> 63	<u>▲</u> 73	<u>▲</u> 62
Particles >38μm		ASTM D7647	>4	1	4	2
Particles >71μm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/19/15	<b>2</b> 0/18/15	<u>\$\rightarrow\$ 21/19/15</u>
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.24	0.23	0.27



### **OIL ANALYSIS REPORT**



Certificate L2367

Test Package

: IND 2

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact:

T: F: