

PROBLEM SUMMARY

Sample Rating Trend

ISO

Machine Id


KAESER SK15 6874571 (S/N 1170)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

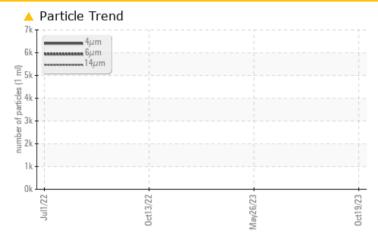

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION	ABNORMAL	SEVERE				
Particles >6µm	ASTM D7647	>1300	1692						
Particles >14µm	ASTM D7647	>80	134						
Particles >21µm	ASTM D7647	>20	△ 35						
Oil Cleanliness	ISO 4406 (c)	>/17/13	20/18/14						

Customer Id: BRILYO Sample No.: KC111317 Lab Number: 06010776 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

26 May 2023 Diag: Don Baldridge

VIS DEBRIS



No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The water content is negligible. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



WATER



13 Oct 2022 Diag: Jonathan Hester

The filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of particles present in this sample. We advise that you stop the unit and follow the water drain-off procedure for this component. We recommend an early resample in 500 hours to monitor this condition. All component wear rates are normal. Appearance is hazy. Excessive free water present. There is a light concentration of water present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



VIS DERRIS





Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is

acceptable for this fluid. The condition of the oil is suitable for further service.



0 0

01 Jul 2022 Diag: Angela Borella




OIL ANALYSIS REPORT

ISO

KAESER SK15 6874571 (S/N 1170)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

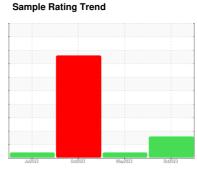



DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Jul202	2 Oct2022	May2023 0	ct2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC111317	KC111621	KC105784
Sample Date		Client Info		19 Oct 2023	26 May 2023	13 Oct 2022
Machine Age	hrs	Client Info		14480	10977	5870
Oil Age	hrs	Client Info		3503	0	2235
Oil Changed		Client Info		Not Changd	N/A	Not Changd
Sample Status				ATTENTION	ABNORMAL	SEVERE
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	<1	8
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m	>3	0	0	<1
Titanium	ppm	ASTM D5185m	>3	0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	<1
Lead	ppm	ASTM D5185m	>10	0	0	0
Copper	ppm	ASTM D5185m	>50	12	21	12
Tin	ppm	ASTM D5185m	>10	0	0	<1
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m	90	0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	<1
Magnesium	ppm	ASTM D5185m	90	0	0	28
Calcium	ppm	ASTM D5185m	2	0	0	0
Phosphorus	ppm	ASTM D5185m		0	12	23
Zinc	ppm	ASTM D5185m		7	31	29
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	<1	2
Sodium	ppm	ASTM D5185m		<1	2	3
Potassium	ppm	ASTM D5185m	>20	0	1	1
Water	%	ASTM D6304	>0.05	0.004	0.006	△ 0.259
ppm Water	ppm	ASTM D6304	>500	40.4	61.0	△ 2590
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		6424		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	△ 35		
Particles >38μm		ASTM D7647	>4	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>^</u> 20/18/14		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.28	0.33	0.36



OIL ANALYSIS REPORT

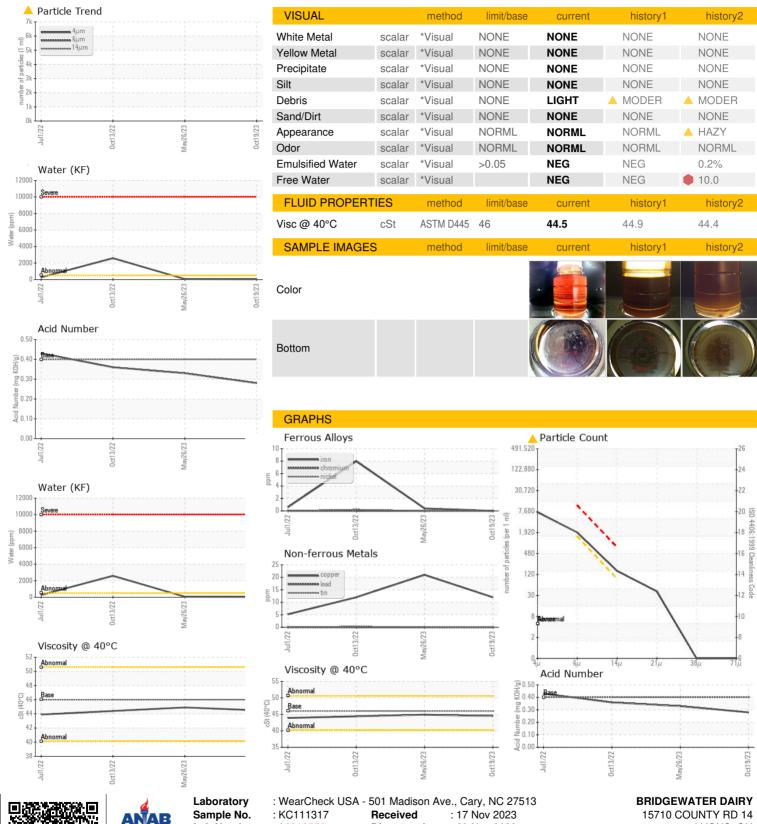





Certificate L2367

Lab Number **Unique Number**

: 06010776

: 10749920 Test Package : IND 2

Diagnosed : 20 Nov 2023

Diagnostician : Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LYONS, OH US 43533

Contact: Service Manager

T: F: