

PROBLEM SUMMARY

Sample Rating Trend

ISO

Machine Id


KAESER SK 19 1369819 (S/N 1022)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

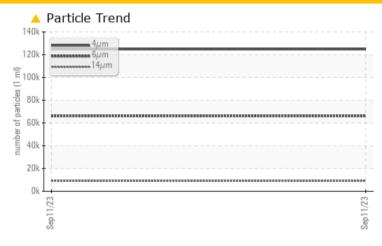

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	<u> </u>						
Particles >14μm	ASTM D7647	>80	9025						
Particles >21µm	ASTM D7647	>20	1974						
Particles >38µm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>17/13	23/20						

Customer Id: WIRROC Sample No.: KCPA005827 Lab Number: 06010820 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend ISO

KAESER SK 19 1369819 (S/N 1022)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
	IATION		IIIIIIIIIIIIIII		HISTORY	HISTOLYZ
Sample Number		Client Info		KCPA005827		
Sample Date		Client Info		11 Sep 2023		
Machine Age	hrs	Client Info		57257		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	6		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	40		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	15		
Sulfur	ppm	ASTM D5185m	23500	19657		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		10		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.018		
ppm Water	ppm	ASTM D6304	>500	184.8		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		124792		
Particles >6µm		ASTM D7647	>1300	<u>^</u> 66119		
Particles >14µm		ASTM D7647	>80	4 9025		
Particles >21µm		ASTM D7647	>20	1974		
Particles >38µm		ASTM D7647	>4	<u>▲</u> 31		
Particles >71µm		ASTM D7647	>3	2		
Oil Cleanliness		ISO 4406 (c)	>17/13	23/20		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.35		
` '						

Contact/Location: ? ? - WIRROC



OIL ANALYSIS REPORT





Sample No. Lab Number **Unique Number**

: KCPA005827 : 06010820

Received Diagnosed : 10749964

Diagnostician : Don Baldridge Test Package : IND 2 (Additional Tests: KF, PrtCount)

: 17 Nov 2023 : 20 Nov 2023

2781 BOND ST ROCHESTER HILLS, MI US 48309 Contact:

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: