


PROBLEM SUMMARY

KAESER NOT GIVEN KCPA005263 (S/N NO INFO GIVEN)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

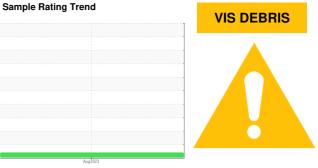

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC 1	EST RE	SULTS			
Sample Status				ABNORMAL	
Debris	scalar	*Visual	NONE	▲ MODER	

Customer Id: ADTCAN Sample No.: KCPA005263 Lab Number: 06010851 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMEND	ED ACTIONS			
Action	Status	Date	Done By	Description
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.
HISTORICAL [DIAGNOSIS			



OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS



اما ممناممالا

KAESER NOT GIVEN KCPA005263 (S/N NO INFO GIVEN)

Component

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA005263		
Sample Date		Client Info		23 Aug 2023		
Machine Age	hrs	Client Info		460321		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	20		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	0		
Calcium	ppm	ASTM D5185m	2	0		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		27		
Sulfur	ppm	ASTM D5185m		14752		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.009		
ppm Water	ppm	ASTM D6304	>500	98.8		


0.39

Acid Number (AN)

mg KOH/g ASTM D8045 0.4



OIL ANALYSIS REPORT

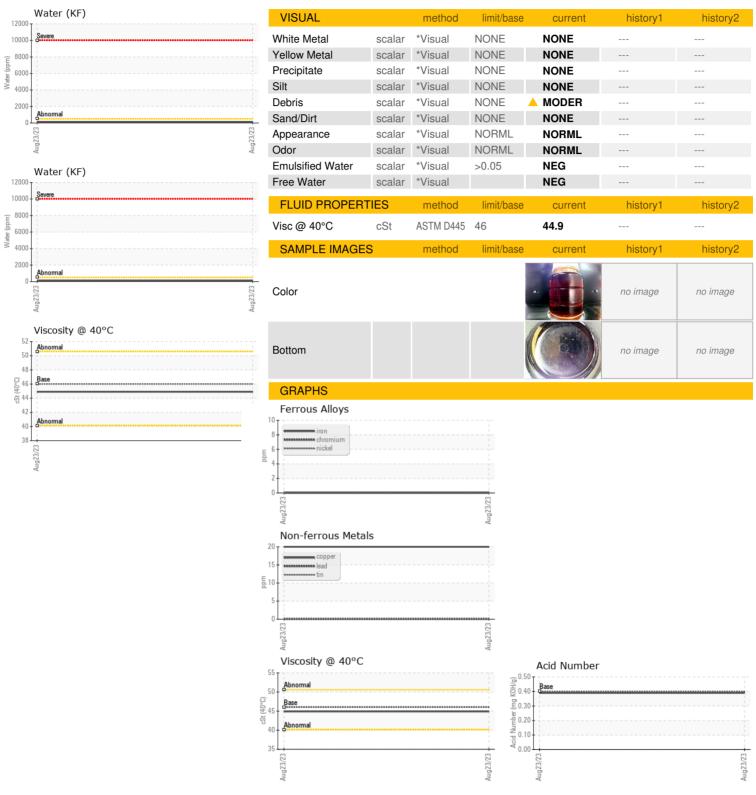



Laboratory Sample No. Lab Number **Unique Number**

: 06010851

: 10749995

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 17 Nov 2023 : KCPA005263 Diagnosed : 20 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AD TRANSPORT 5601 BELLEVILLE RD

CANTON, MI US 48188

Contact:

T: F: