

PROBLEM SUMMARY


Sample Rating Trend



FRICK 16 (S/N REF1240)

Refrigeration Compressor

USPI ALT-68 SC (--- GAL)

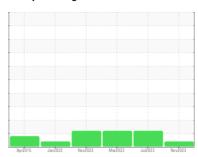



COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS						
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL		
Debris	scalar	*Visual	NONE	▲ MODER	NONE	LIGHT		

Customer Id: CARBEAIL Sample No.: USP0003657 Lab Number: 06010926 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

16 Jul 2023 Diag: Doug Bogart





Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



22 Mar 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor.All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



20 Nov 2022 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

VIS DEBRIS

FRICK 16 (S/N REF1240)

Refrigeration Compressor

USPI ALT-68 SC (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


		Apr2015	Jan 2022 Nov2022	Mar2023 Jul2023	Nov2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USP0003657	USP255354	USP249463
Sample Date		Client Info		18 Nov 2023	16 Jul 2023	22 Mar 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	0	0	1
Chromium	ppm	ASTM D5185m	>2	0	<1	0
Nickel	ppm	ASTM D5185m		0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>3	0	0	<1
Lead	ppm	ASTM D5185m	>2	0	0	0
Copper	ppm	ASTM D5185m	>8	0	0	0
Tin	ppm	ASTM D5185m	>4	<1	0	0
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		<1	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		0	0	0
Calcium	ppm	ASTM D5185m		0	0	0
Phosphorus	ppm	ASTM D5185m		1	0	0
Zinc	ppm	ASTM D5185m		0	0	0
Sulfur	ppm	ASTM D5185m	50	3	0	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1	<1	0
Sodium	ppm	ASTM D5185m		0	0	0
Potassium	ppm	ASTM D5185m	>20	0	0	0
Water	%	ASTM D6304	>0.01	0.005	0.002	0.005
ppm Water	ppm	ASTM D6304	>100	55.8	19.0	53.8
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647	>10000		▲ 33642	<u>^</u> 75899
Particles >6µm		ASTM D7647	>2500		△ 9076	<u>12101</u>
Particles >14μm		ASTM D7647	>320		156	167
Particles >21µm		ASTM D7647	>80		19	30
Particles >38µm		ASTM D7647	>20		0	2
Particles >71µm		ASTM D7647	>4		0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15		<u>22/20/14</u>	<u>△</u> 23/21/15
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974	0.005	0.016	0.014	0.016



OIL ANALYSIS REPORT



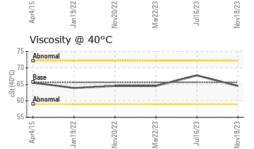

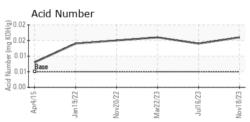





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : USP0003657 : 06010926

: 10750070

Received : 17 Nov 2023 Diagnosed : 20 Nov 2023 Diagnostician : Doug Bogart **CARGILL MEAT SOLUTIONS** 8295 ARENZVILLE RD

BEARDSTOWN, IL US 62618

Contact:

: IND 2 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: ? ? - CARBEAIL