

PROBLEM SUMMARY


Machine Id KAESER 100891.1 (S/N 1336)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

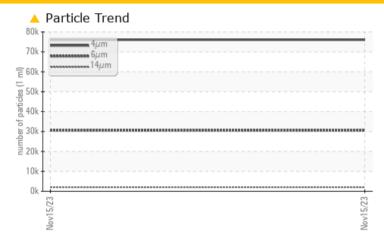

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ABNORMAL						
Particles >6µm	ASTM D7647	>1300	△ 30567						
Particles >14µm	ASTM D7647	>80	2053						
Particles >21µm	ASTM D7647	>20	494						
Particles >38μm	ASTM D7647	>4	<u> </u>						
Oil Cleanliness	ISO 4406 (c)	>/17/13	<u> 23/22/18</u>						

Customer Id: AZAWAK Sample No.: KCPA011929 Lab Number: 06013327 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

KAESER 100891.1 (S/N 1336)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

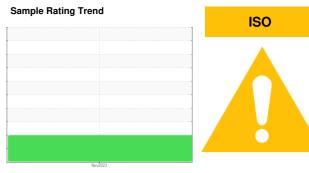

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA011929		
Sample Date		Client Info		15 Nov 2023		
Machine Age	hrs	Client Info		9049		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	11		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES	'''	method	limit/base	current	history1	history2
					,	ĺ
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	400	0		
Magnesium	ppm	ASTM D5185m	100	<1		
Calcium	ppm	ASTM D5185m	0	1		
Phosphorus	ppm	ASTM D5185m	0	233		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	5577		
CONTAMINANTS	8	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.015		
ppm Water	ppm	ASTM D6304	>500	151.1		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4μm		ASTM D7647		76065		
Particles >6μm		ASTM D7647	>1300	△ 30567		
Particles >14μm		ASTM D7647	>80	2053		
Particles >21μm		ASTM D7647	>20	494		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	1		
Oil Cleanliness		ISO 4406 (c)	>/17/13	23/22/18		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.26		



OIL ANALYSIS REPORT

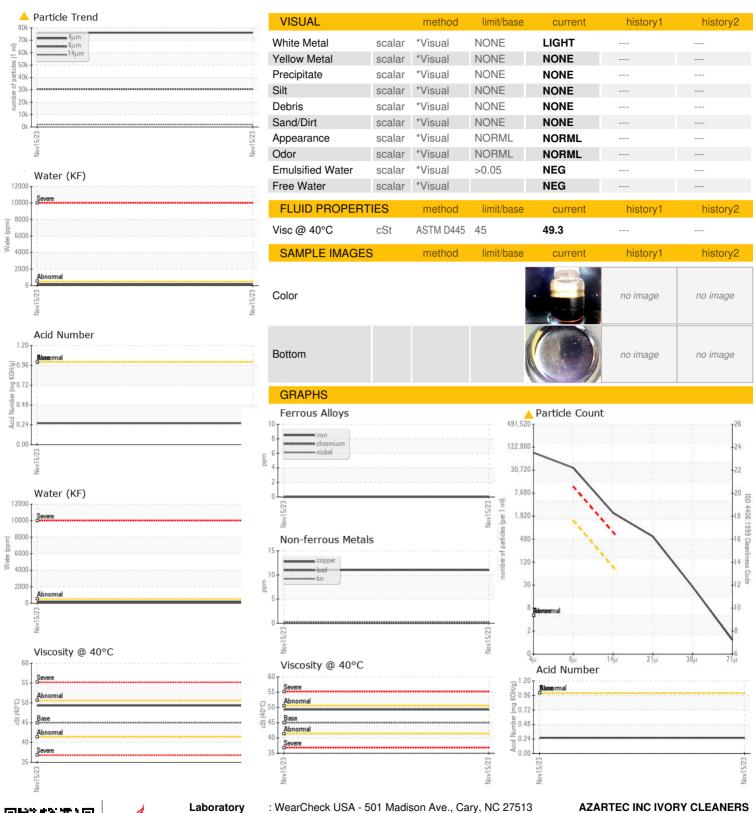





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KCPA011929 : 06013327 : 10752471

Received Diagnosed

: 20 Nov 2023 : 22 Nov 2023 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

109 CAPCOM AVE SUITE 1 WAKE FOREST, NC

US 27587

Contact: Service Manager

T:

F: