

PROBLEM SUMMARY

Sample Rating Trend


ISO

Machine Id KAESER 2987546 (S/N 1505)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

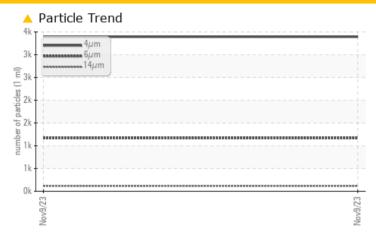

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status			ATTENTION						
Particles >14µm	ASTM D7647	>80	<u> </u>						
Particles >21µm	ASTM D7647	>20	29						
Oil Cleanliness	ISO 4406 (c)	>/17/13	19/17/14						

Customer Id: NASCLI Sample No.: KC125953 Lab Number: 06015097 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

KAESER 2987546 (S/N 1505)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

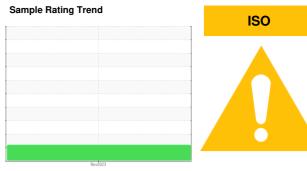

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of particulates present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KC125953		
Sample Date		Client Info		09 Nov 2023		
Machine Age	hrs	Client Info		7907		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	11		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	90	2		
Calcium	ppm	ASTM D5185m	2	4		
Phosphorus	ppm	ASTM D5185m		0		
Zinc	ppm	ASTM D5185m		0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		37		
Potassium	ppm	ASTM D5185m	>20	8		
Water	%	ASTM D6304	>0.05	0.025		
ppm Water	ppm	ASTM D6304	>500	257		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		3393		
Particles >6µm		ASTM D7647	>1300	1168		
Particles >14μm		ASTM D7647	>80	<u> </u>		
Particles >21µm		ASTM D7647	>20	<u>^</u> 29		
Particles >38μm		ASTM D7647	>4	1		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u> </u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.33		



OIL ANALYSIS REPORT

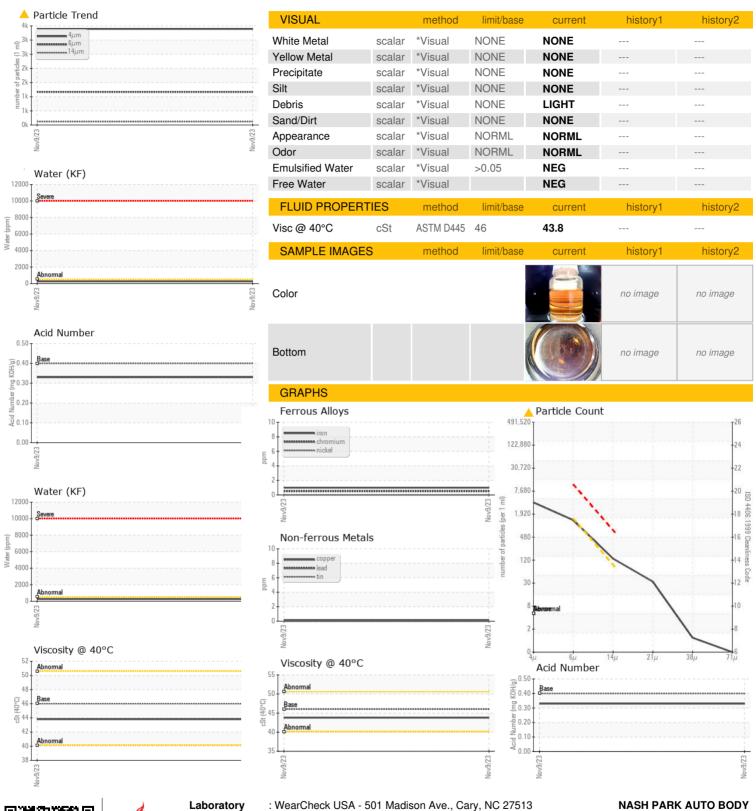





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: KC125953 : 06015097 : 10754241 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : 22 Nov 2023 Received Diagnosed : 26 Nov 2023 Diagnostician

: Don Baldridge

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

630 LEXINGTON AVE CLIFTON, NJ US 07011

Contact: Service Manager

T:

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: