

# **PROBLEM SUMMARY**

Sample Rating Trend


ISO

# 7890775 (S/N 1619)

Component Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

## **COMPONENT CONDITION SUMMARY**

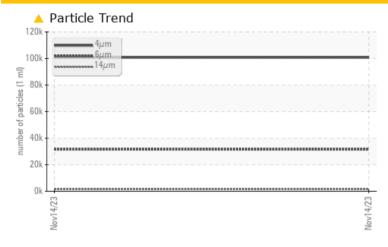

#### RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status		ABNORMAL							
Particles >6µm	ASTM D7647 >	1300 <b>A 31601</b>							
Particles >14μm	ASTM D7647 >	80 <b>A 1502</b>							
Particles >21μm	ASTM D7647 >	<b>20 △ 252</b>							
Particles >38μm	ASTM D7647 >	4 🔺 5							
Oil Cleanliness	ISO 4406 (c) >	/17/13 <b>4 24/22/18</b>							

Customer Id: AIRSANCA Sample No.: KCPA007109 Lab Number: 06016430 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

# RECOMMENDED ACTIONS

There are no recommended actions for this sample.

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

Sample Rating Trend

ISO

7890775 (S/N 1619)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

## **DIAGNOSIS**

#### Recommendation

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Nov2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		KCPA007109		
Sample Date		Client Info		14 Nov 2023		
Machine Age	hrs	Client Info		7279		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	<1		
Titanium	ppm	ASTM D5185m	>3	<1		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	23		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m	710	0		
Cadmium	ppm	ASTM D5185m		<1		
	ρρ		11 11 11			111
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	2		
Calcium	ppm	ASTM D5185m	0	<1		
Phosphorus	ppm	ASTM D5185m	0	0		
Zinc	ppm	ASTM D5185m	0	2		
Sulfur	ppm	ASTM D5185m	23500	20561		
CONTAMINANTS	1	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.05	0.013		
ppm Water	ppm	ASTM D6304	>500	134		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647		100735		
Particles >6µm		ASTM D7647	>1300	<b>A</b> 31601		
Particles >14µm		ASTM D7647	>80	<b>1502</b>		
Particles >21µm		ASTM D7647	>20	<u>^</u> 252		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u>4</u> 24/22/18		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
A : 1 A 1 (AA1)	1/011/	ACTM DODAE		0.41		


Acid Number (AN)

mg KOH/g ASTM D8045 1.0

0.41



# **OIL ANALYSIS REPORT**

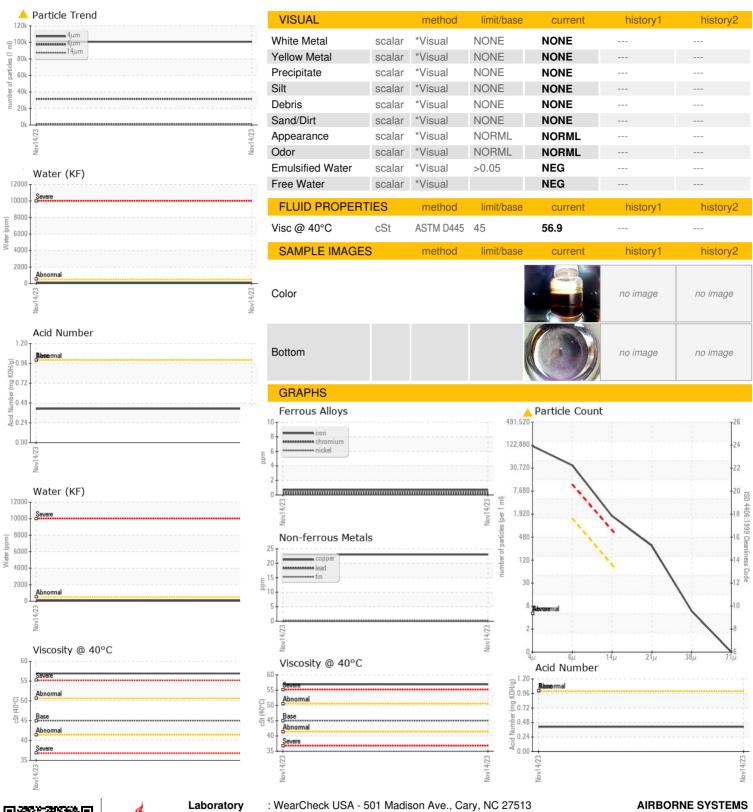



Certificate L2367

Sample No. Lab Number **Unique Number** 

: KCPA007109 : 06016430

: 10755574

Received

: 24 Nov 2023 Diagnosed

: 27 Nov 2023 Diagnostician : Doug Bogart

Test Package : IND 2 ( Additional Tests: KF, PrtCount ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

3100 W SEGERSTROM AVE

SANTA ANA, CA US 92704

Contact: Service Manager