

## **PROBLEM SUMMARY**

Sample Rating Trend




TOLE\_U5 TOLE\_U5\_M5

Non-Drive End Bearing

Fluid

**ROYAL PURPLE SYNFILM GT 32 (4 QTS)** 

#### **COMPONENT CONDITION SUMMARY**

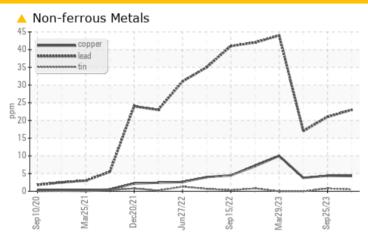

#### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL	ABNORMAL	NORMAL			
Lead	ppm	ASTM D5185m	>20	<u>^</u> 23	<u>^</u> 21	17		

Customer Id: ENEORE2 Sample No.: RP0025471 Lab Number: 06016490 Test Package: PLANT

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

#### **RECOMMENDED ACTIONS**

There are no recommended actions for this sample.

#### HISTORICAL DIAGNOSIS

#### 25 Sep 2023 Diag: Don Baldridge

WEAR



No corrective action is recommended at this time. Resample at the next service interval to monitor. The lead level is abnormal. All other component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 06 Jun 2023 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



#### 29 Mar 2023 Diag: Jonathan Hester

WEAR



No corrective action is recommended at this time. Resample at the next service interval to monitor. The lead level is abnormal. All other component wear rates are normal. The water content is negligible. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





## **OIL ANALYSIS REPORT**

#### Sample Rating Trend



history2

# TOLE\_U5 TOLE\_U5\_M5

Non-Drive End Bearing

ROYAL PURPLE SYNFILM GT 32 (4 QTS)

## Non-Drive End Bearing

### Recommendation

**DIAGNOSIS** 

No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### Wear

The lead level is abnormal. All other component wear rates are normal.

#### Contamination

The water content is negligible. There is no indication of any contamination in the oil.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				-1
	1			
				_
	Sep.2020	Mar2021 Dec2021 J	un2022 Sep2022 Mar2023	Sep 2023
SAMPLE INFORMATION	method	limit/base	current	hist
Sample Number	Client Info		RP0025471	RP0026
sample Mumber	Client inio		NF002347 I	NF0020
Sample Date	Client Info		16 Nov 2023	3 25 Sep 2


Sample Number		Client Info		RP0025471	RP0026201	RP0025429
Sample Date		Client Info		16 Nov 2023	25 Sep 2023	06 Jun 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	0	0	0
Chromium	ppm	ASTM D5185m	>20	0	0	0
Nickel	ppm	ASTM D5185m	>20	<1	<1	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m		0	<1	0
Aluminum	ppm	ASTM D5185m	>20	<1	<1	<1
Lead	ppm	ASTM D5185m	>20	<u> </u>	<u>^</u> 21	17
Copper	ppm	ASTM D5185m	>20	4	4	4
Tin	ppm	ASTM D5185m	>20	<1	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m		70	65	70
Calcium	ppm	ASTM D5185m		2	3	<1
Phosphorus	ppm	ASTM D5185m		4	3	7
Zinc	ppm	ASTM D5185m		0	8	0
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	1	<1	<1
Sodium	ppm	ASTM D5185m		2	3	2
Potassium	ppm	ASTM D5185m	>20	<1	<1	0
Water	%	ASTM D6304	>2	0.023	0.033	0.010
ppm Water	ppm	ASTM D6304		233	337.3	104.9
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.391	0.43	0.717
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>2	NEG	NEG	NEG

IbmittecBy: NATHANECOLMES

NEG



## **OIL ANALYSIS REPORT**

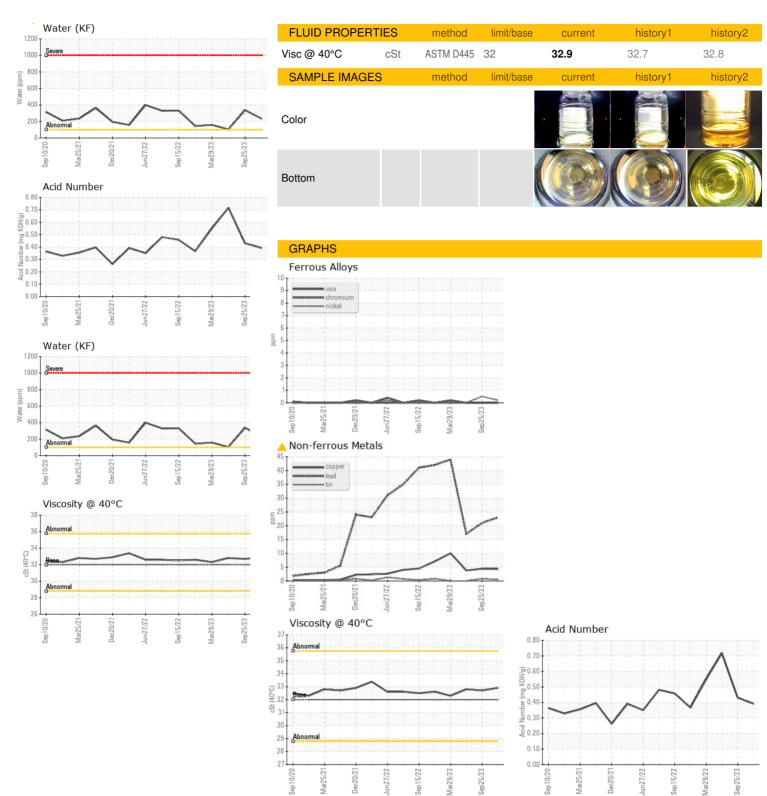





Laboratory Sample No. Lab Number **Unique Number** Test Package : PLANT

: RP0025471 : 06016490 : 10755634

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Nov 2023

: 28 Nov 2023 Diagnosed : Jonathan Hester Diagnostician

**ENERGY TRANSFER - TOLEDO** 

2549 BROWN ROAD OREGON, OH US 43616

Contact: DARREN GRANT

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (419)389-7403 F: