

PROBLEM SUMMARY

Sample Rating Trend

a/2017 Jan/2018 Oct/2018 Aun/2019 Jun/2020 Eus/2021 Mos/2021 haz-2022

SEDIMENT

GARDNER DENVER 4 SLA (S/N 5038557)

Component

Air Compressor

USPI MAX FG AIR 46 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC T	EST RE	SULTS				
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
Silt	scalar	*\/ieal	NONE	▲ MODER	▲ MODER	▲ MODER

Customer Id: IBPEMP01 Sample No.: USPM31927 Lab Number: 06026470 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter			?	We recommend you service the filters on this component.
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

02 Aug 2023 Diag: Doug Bogart

SEDIMENT



We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. There is a moderate amount of visible silt present in the sample. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



15 Mar 2023 Diag: Doug Bogart

SEDIMENT



We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. There is a moderate amount of visible silt present in the sample. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

09 Sep 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



Machine Id

GARDNER DENVER 4 SLA (S/N 5038557)

Component

Air Compressor

USPI MAX FG AIR 46 (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		USPM31927	USPM29095	USPM25257
Sample Date		Client Info		05 Dec 2023	02 Aug 2023	15 Mar 2023
Machine Age	hrs	Client Info		03 Dec 2023	02 Aug 2023	0
Oil Age		Client Info		0	0	0
-	hrs	Client Info		N/A	N/A	N/A
Oil Changed		Cilent Inio		ABNORMAL		
Sample Status					ABNORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>4	0	0	0
Nickel	ppm	ASTM D5185m	>4	0	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>10	0	0	0
Lead	ppm	ASTM D5185m	>20	0	0	0
Copper	ppm	ASTM D5185m	>40	4	0	0
Tin	ppm		>5	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m	0	0	0	0
Manganese	ppm	ASTM D5185m		<1	0	0
Magnesium	ppm	ASTM D5185m	0	<1	<1	0
Calcium	ppm	ASTM D5185m	0	0	0	0
Phosphorus	ppm	ASTM D5185m	0	<1	13	<1
Zinc	ppm	ASTM D5185m	0	0	0	0
Sulfur	ppm	ASTM D5185m	0	0	0	0
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	<1
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	2	0	<1
Water	%	ASTM D6304	>0.6	0.009	0.007	0.005
ppm Water	ppm	ASTM D6304	>6000	93	72.8	59.8
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000			
Particles >6µm		ASTM D7647	>2500			
Particles >14µm		ASTM D7647	>320			
Particles >21µm		ASTM D7647	>80			
Particles >38µm		ASTM D7647	>20			
Particles >71µm		ASTM D7647	>4			
Oil Cleanliness		ISO 4406 (c)	>20/18/15			
	TION	. ,		o	histomet	histor O
FLUID DEGRADA		method	limit/base		history1	history2
Acid Number (ANI)	ma KOUla	VCTM DOUVE	0.16	0.44	0.24	0.01

Acid Number (AN)

mg KOH/g ASTM D8045 0.16


0.34


0.41

0.21




OIL ANALYSIS REPORT

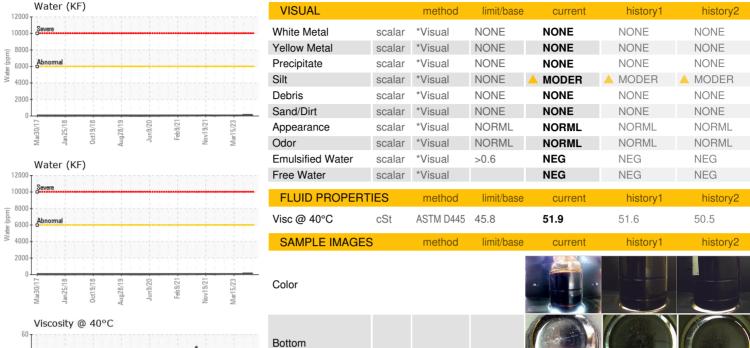


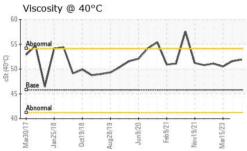


GRAPHS

Ferrous Alloys Non-ferrous Metals

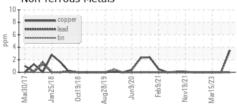

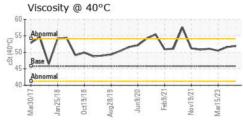

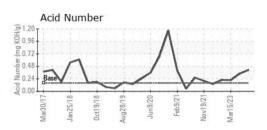





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number** Test Package

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : USPM31927 : 06026470

: 10776261 : IND 2

: 06 Dec 2023 Received : 07 Dec 2023 Diagnosed Diagnostician : Doug Bogart TYSON-Emporia-USP 2101 West Sixth

Emporia, KS US 66801

T: (620)343-3640

Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (620)340-1253