




# PROBLEM SUMMARY

## Sample Rating Trend

ISO




Machine Id  
**VILTER TYSEMP B-17 VILTER (S/N 55BC03MB)**  
 Component  
**Refrigeration Compressor**  
 Fluid  
**USPI 1009-68 SC (--- GAL)**

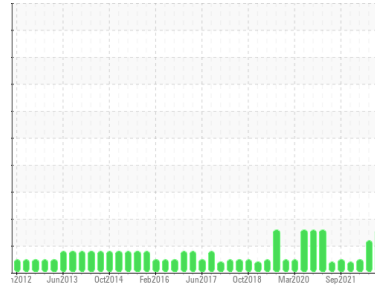

## COMPONENT CONDITION SUMMARY

### ▲ Particle Trend

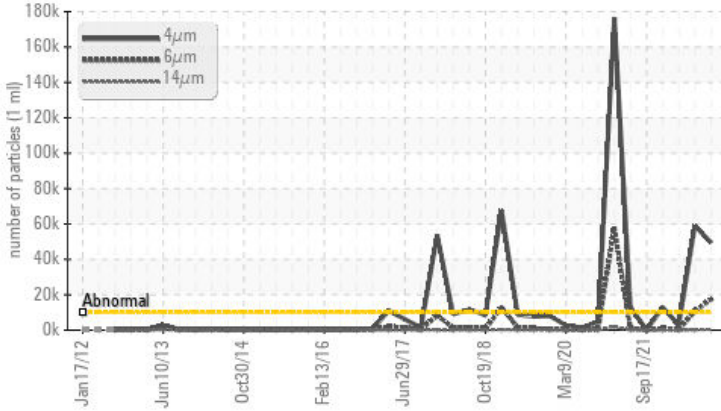

## RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status			ABNORMAL	ABNORMAL	NORMAL
Particles >4µm	ASTM D7647	>10000	▲ 49447	▲ 59027	2893
Particles >6µm	ASTM D7647	>2500	▲ 17258	▲ 10773	363
Particles >14µm	ASTM D7647	>320	▲ 431	195	7
Oil Cleanliness	ISO 4406 (c)	>20/18/15	▲ 23/21/16	▲ 23/21/15	19/16/10

Customer Id: IBPEMP01  
 Sample No.: USP0003924  
 Lab Number: 06026515  
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Doug Bogart +1 (800)237-1369 x4016  
[dougb@wearcheckusa.com](mailto:dougb@wearcheckusa.com)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component.

## HISTORICAL DIAGNOSIS

### 15 Mar 2023 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



### 19 Apr 2022 Diag: Doug Bogart

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



### 19 Nov 2021 Diag: Doug Bogart

ISO



Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of silt (particulates < 6 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


view report





# OIL ANALYSIS REPORT

Sample Rating Trend

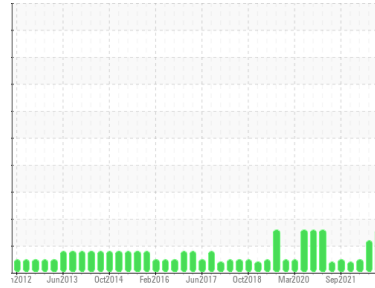

ISO



Machine Id  
**VILTER TYSEMP B-17 VILTER (S/N 55BC03MB)**

Component  
**Refrigeration Compressor**  
Fluid  
**USPI 1009-68 SC (--- GAL)**

## DIAGNOSIS

### Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of particulates present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>USP0003924</b>	USP244220	USP232505
Sample Date	Client Info		<b>30 Nov 2023</b>	15 Mar 2023	19 Apr 2022
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>ABNORMAL</b>	ABNORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >8	<b>0</b>	2	<1
Chromium	ppm	ASTM D5185m >2	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	<b>0</b>	0	0
Titanium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Silver	ppm	ASTM D5185m >2	<b>0</b>	0	<1
Aluminum	ppm	ASTM D5185m >3	<b>0</b>	0	0
Lead	ppm	ASTM D5185m >2	<b>0</b>	0	<1
Copper	ppm	ASTM D5185m >8	<b>0</b>	0	0
Tin	ppm	ASTM D5185m >4	<b>0</b>	0	0
Antimony	ppm	ASTM D5185m	<b>---</b>	---	---
Vanadium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	<b>0</b>	0	0
Barium	ppm	ASTM D5185m	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m	<b>0</b>	0	0
Calcium	ppm	ASTM D5185m	<b>0</b>	0	0
Phosphorus	ppm	ASTM D5185m	<b>0</b>	0	0
Zinc	ppm	ASTM D5185m	<b>0</b>	0	0
Sulfur	ppm	ASTM D5185m 50	<b>0</b>	9	0

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<b>&lt;1</b>	<1	0
Sodium	ppm	ASTM D5185m	<b>&lt;1</b>	0	0
Potassium	ppm	ASTM D5185m >20	<b>0</b>	0	0
Water	%	ASTM D6304 >0.01	<b>0.005</b>	0.007	0.004
ppm Water	ppm	ASTM D6304 >100	<b>53</b>	70.3	44.9






## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>▲ 49447</b>	▲ 59027	2893
Particles >6µm	ASTM D7647	>2500	<b>▲ 17258</b>	▲ 10773	363
Particles >14µm	ASTM D7647	>320	<b>▲ 431</b>	195	7
Particles >21µm	ASTM D7647	>80	<b>36</b>	24	2
Particles >38µm	ASTM D7647	>20	<b>0</b>	0	0
Particles >71µm	ASTM D7647	>4	<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/15	<b>▲ 23/21/16</b>	▲ 23/21/15	19/16/10

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974 0.005	<b>0.015</b>	0.014	0.013


# OIL ANALYSIS REPORT

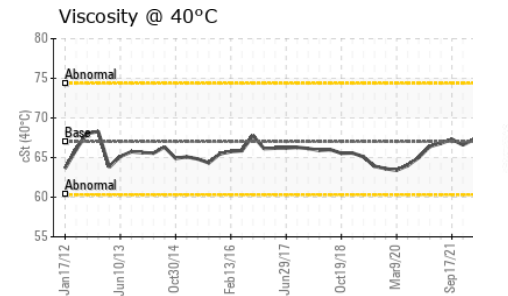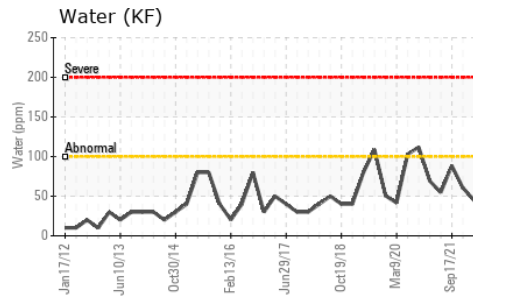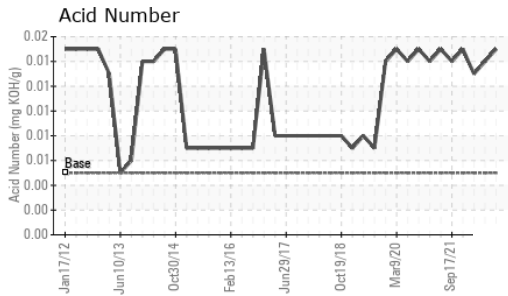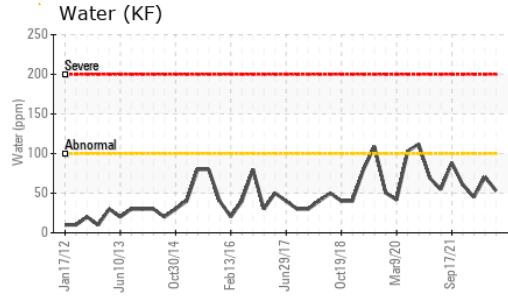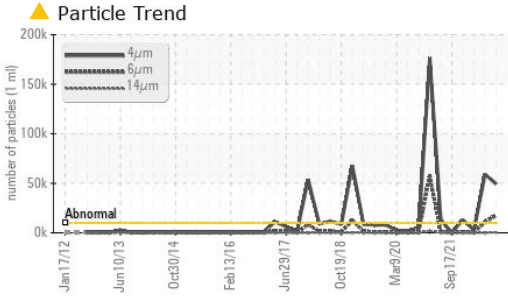






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.01	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445 67	64.6	67.5	67.3

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

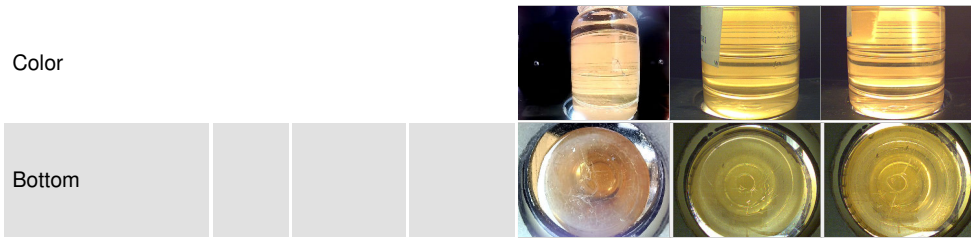

## GRAPHS

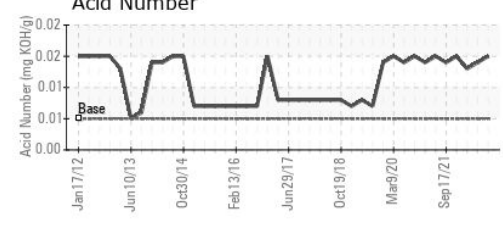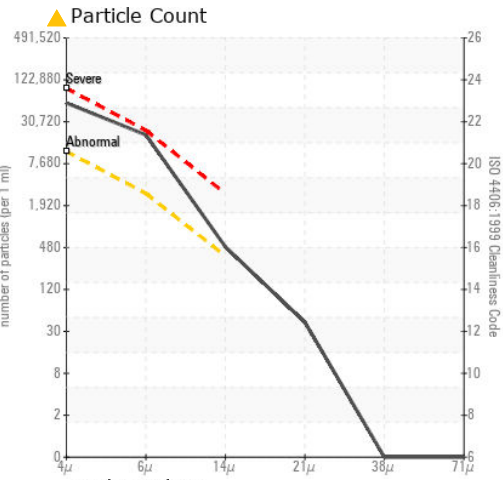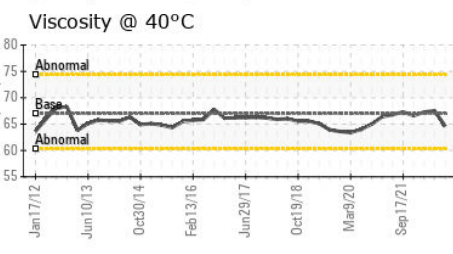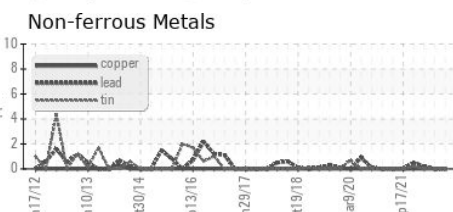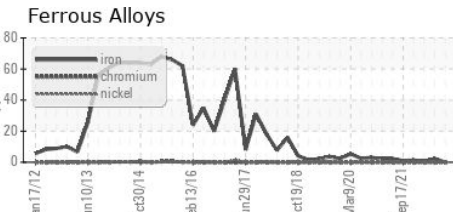

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : USP0003924  
**Lab Number** : 06026515  
**Unique Number** : 10776306  
**Test Package** : IND 2

**TYSON-Emporia-USP**  
 2101 West Sixth  
 Emporia, KS  
 US 66801  
 Contact: SERVICE MANAGER

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: (620)343-3640  
 F: (620)340-1253