



PROBLEM SUMMARY

SYN FLUSH 3707V 200805280262 - APACHE

Component Compressor

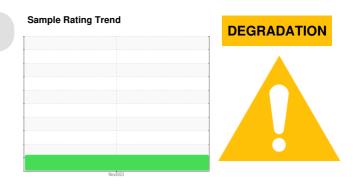

COMPONENT CONDITION SUMMARY

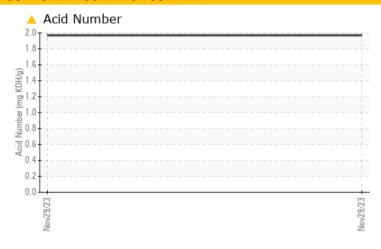

RECOMMENDATION

We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS							
Sample Status				ATTENTION			
Acid Number (AN)	mg KOH/g	ASTM D8045		1.97			

Customer Id: UCZORMCF Sample No.: UCZ06026631 Lab Number: 06026631 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	We recommend that you drain the oil from the component if this has not already been done.		
Resample			?	We recommend an early resample to monitor this condition.		

HISTORICAL DIAGNOSIS

Report Id: UCZORMCF [WUSCAR] 06026631 (Generated: 12/08/2023 17:17:14) Rev: 1

Contact/Location: CURT DELACY - UCZORMCF




OIL ANALYSIS REPORT

SYN FLUSH Machine Id 3707V 200805280262 - APACHE

Component

Compressor

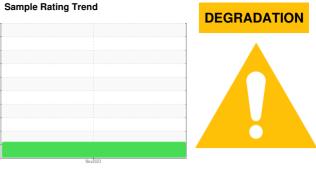

DIAGNOSIS

Recommendation

We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The AN level is at the top-end of the recommended limit.


SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCZ06026631		
Sample Date		Client Info		29 Nov 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	15		
Chromium	ppm	ASTM D5185m	>5	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>15	0		
Lead	ppm	ASTM D5185m	>65	0		
Copper	ppm	ASTM D5185m	>65	2		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		4		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		1		
Phosphorus	ppm	ASTM D5185m		4		
Zinc	ppm	ASTM D5185m		3		
Sulfur	ppm	ASTM D5185m		113		
CONTAMINANTS	,	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>35	0		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		<u> </u>		




OIL ANALYSIS REPORT

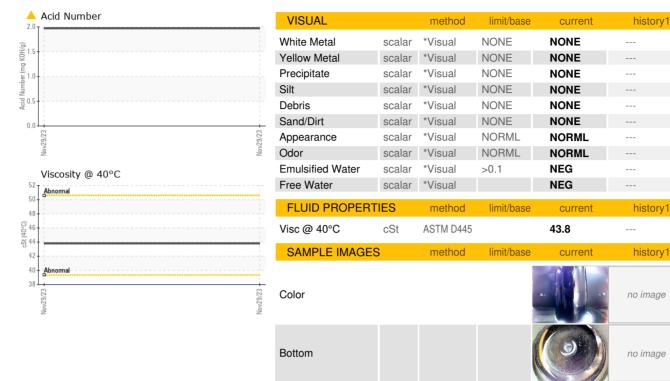

GRAPHS Ferrous Alloys

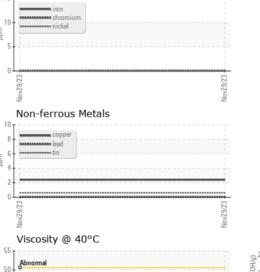

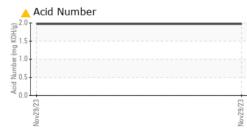





Certificate L2367

Laboratory Sample No.

Lab Number Unique Number Test Package : IND 2

: UCZ06026631 : 06026631 : 10776422

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

: 06 Dec 2023 : 08 Dec 2023 Diagnosed : Jonathan Hester Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

MCFARLAND, WI US 53558 Contact: CURT DELACY curt.delacy@zorn-air.com T: (608)838-7040

4803 TRIANGLE ST

ZORN COMP & EQUIPMENT CO (MCF)

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact/Location: CURT DELACY - UCZORMCF

F: (608)838-7636

history2

history2

no image

no image