


# **OIL ANALYSIS REPORT**

CS-46 [PLC2275196] KAESER 1585 - CAL BIO

Component

Compressor

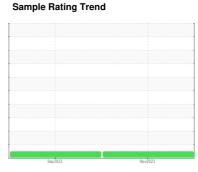



## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the


## **Fluid Condition**


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06027910	UCH05679331	
Sample Date		Client Info		21 Nov 2023	28 Sep 2022	
Machine Age	hrs	Client Info		11851	3994	
Oil Age	hrs	Client Info		3000	0	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG	NEG	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m		0	<1	
Silver	ppm	ASTM D5185m	>2	0	<1	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	0	
Copper	ppm	ASTM D5185m	>50	6	5	
Tin	ppm	ASTM D5185m	>10	0	0	
Vanadium	ppm	ASTM D5185m		0	<1	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	1.5	0	0	
Barium	ppm	ASTM D5185m	0	0	0	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m	0.3	<1	1	
Magnesium	ppm	ASTM D5185m	0	0	32	
Calcium	ppm	ASTM D5185m	0	0	0	
Phosphorus	ppm	ASTM D5185m	406	121	8	
Zinc	ppm	ASTM D5185m	0	0	1	
Sulfur	ppm	ASTM D5185m	1283	4761	19911	
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	4	<1	
Sodium	ppm	ASTM D5185m		2	8	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.463	0.12	0.33	



# **OIL ANALYSIS REPORT**

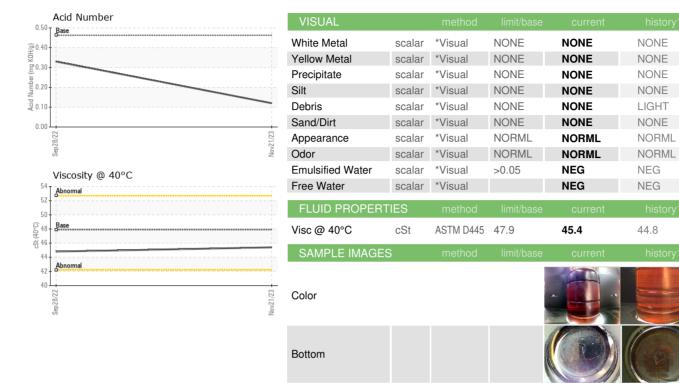

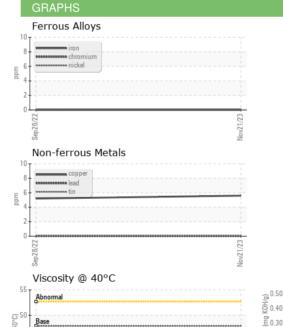





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06027910 : 06027910 : 10777701

₹ 45

40

Received Diagnosed

: 07 Dec 2023 Diagnostician

: 09 Dec 2023 : Don Baldridge

SACRAMENTO, CA US 95816 Contact: BARRY FRKOVICH

barryfrkovich@ciscoair.com T: (916)444-2525

**CISCO AIR SYSTEMS** 

F: x:

214 27TH ST

no image

no image

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Acid Number

은 0.20 0.10 Acid No.00