

[1799400]

PROBLEM SUMMARY

SOHP USED OIL - ISO 68 AND CAMCO

Refrigeration Compressor

{not provided} (--- GAL)

Sample Rating Trend **VIS DEBRIS**

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Debris	scalar	*Visual	NONE	▲ MODER			

Customer Id: LAMPAR **Sample No.:** WC0628489 Lab Number: 06029468 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

Area [1799400] **SOHP USED OIL - ISO 68 AND CAMCO**

Refrigeration Compressor

{not provided} (--- GAL)

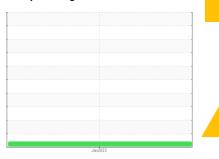

Sample Rating Trend



DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Jan2023		
SAMPLE INFORMA	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0628489		
Sample Date		Client Info		04 Jan 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>8	<1		
Chromium	ppm	ASTM D5185m	>2	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>3	<1		
Lead	ppm	ASTM D5185m	>2	0		
Copper	ppm	ASTM D5185m	>8	0		
Tin	ppm	ASTM D5185m	>4	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		80		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		447		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
Water	%	ASTM D6304	>0.01	0.002		
ppm Water	ppm	ASTM D6304	>100	22		
FLUID DEGRADAT	TON	method	limit/base	current	history1	history2


0.086

Acid Number (AN)

mg KOH/g ASTM D974



OIL ANALYSIS REPORT

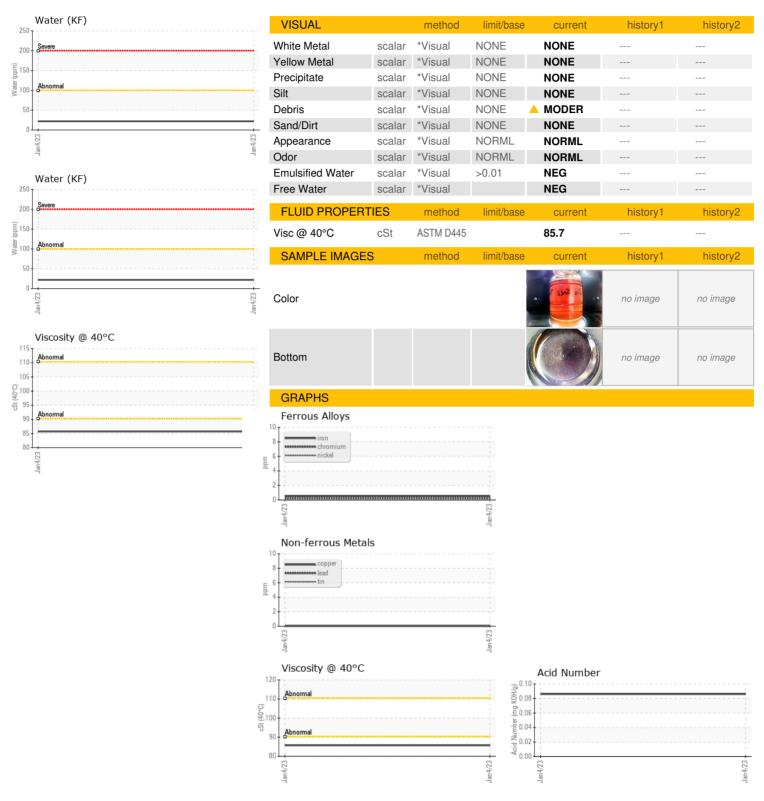





Certificate L2367

Report Id: LAMPAR [WUSCAR] 06029468 (Generated: 12/13/2023 13:25:29) Rev: 1

Laboratory Sample No. Lab Number **Unique Number**

: 06029468 : 10779259 Test Package : IND 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : WC0628489 Received

: 08 Dec 2023 Diagnosed Diagnostician

: 13 Dec 2023 : Jonathan Hester

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: MICHAEL GRUIS michael.gruis@lambweston.com T: (218)732-2188

LAMB WESTON/RDO

PARK RAPIDS, MN

F: (218)732-2175

PO BOX 552

US 56470

Contact/Location: MICHAEL GRUIS - LAMPAR