


OIL ANALYSIS REPORT

CFG-546 [SR3074973] Machine Id QUINCY UTY302386 - SAN FRANCISCO COFFEE CO

Component

Compressor

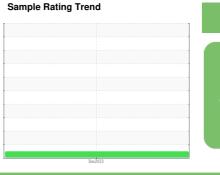



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06061291		
Sample Date		Client Info		24 Dec 2023		
Machine Age	hrs	Client Info		34473		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m	0	0		
Magnesium	ppm	ASTM D5185m	1.2	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	295	34		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	253	0		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
	14017	10T11 D00:-				


Acid Number (AN) mg KOH/g ASTM D8045 0.252

1.12



OIL ANALYSIS REPORT

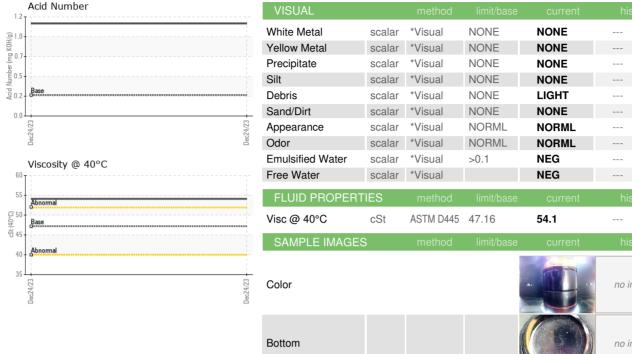

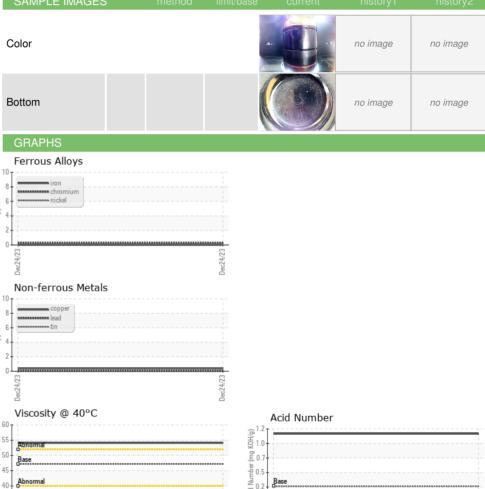





Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: 06061291 : 10832673 Test Package : IND 2

35

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UCH06061291 : 16 Jan 2024 Recieved Diagnosed : 17 Jan 2024

Diagnostician

: Jonathan Hester

Dec24/23

CISCO AIR SYSTEMS 214 27TH ST SACRAMENTO, CA US 95816

Contact: BARRY FRKOVICH barryfrkovich@ciscoair.com

T: (916)444-2525 F: x:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)