



PROBLEM SUMMARY

Sample Rating Trend


ISO



Machine Id
1.1
Component
Hydraulic System
Fluid
{not provided} (--- GAL)

COMPONENT CONDITION SUMMARY

▲ Particle Trend

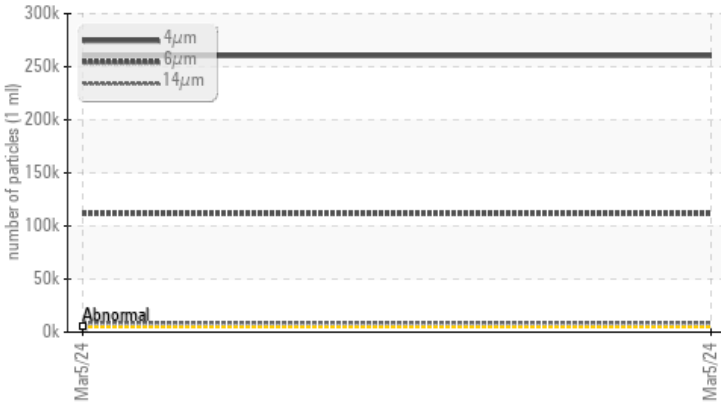

RECOMMENDATION

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

PROBLEMATIC TEST RESULTS

Sample Status			SEVERE	---	---
Particles >4µm	ASTM D7647	>5000	▲ 260310	---	---
Particles >6µm	ASTM D7647	>1300	▲ 111618	---	---
Particles >14µm	ASTM D7647	>160	▲ 8692	---	---
Particles >21µm	ASTM D7647	>40	▲ 2013	---	---
Particles >38µm	ASTM D7647	>10	▲ 48	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 25/24/20	---	---

Customer Id: ACTHIC
Sample No.: WC0911760
Lab Number: 06122294
Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
Wes Davis +1 905-569-8600 x223
wesd@wearcheck.ca

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.
Resample	---	---	?	Resample in 30-45 days to monitor this situation.
Alert	---	---	?	Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment.
Information Required	---	---	?	Please specify the brand, type, and viscosity of the oil on your next sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.
Check Breathers	---	---	?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.
Check Dirt Access	---	---	?	We advise that you check all areas where contaminants can enter the system.
Filter Fluid	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Machine Id
1.1
Component
Hydraulic System
Fluid
{not provided} (--- GAL)

DIAGNOSIS

▲ Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of particulates (2 to 100 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0911760	---	---
Sample Date	Client Info		05 Mar 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			SEVERE	---	---

CONTAMINATION	method	limit/base	current	history1	history2
Water	WC Method	>0.05	NEG	---	---

WEAR METALS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >20	<1	---	---
Chromium	ppm	ASTM D5185m >20	0	---	---
Nickel	ppm	ASTM D5185m >20	0	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m	0	---	---
Aluminum	ppm	ASTM D5185m >20	<1	---	---
Lead	ppm	ASTM D5185m >20	<1	---	---
Copper	ppm	ASTM D5185m >20	16	---	---
Tin	ppm	ASTM D5185m >20	<1	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	---	---
Barium	ppm	ASTM D5185m	0	---	---
Molybdenum	ppm	ASTM D5185m	18	---	---
Manganese	ppm	ASTM D5185m	0	---	---
Magnesium	ppm	ASTM D5185m	0	---	---
Calcium	ppm	ASTM D5185m	50	---	---
Phosphorus	ppm	ASTM D5185m	440	---	---
Zinc	ppm	ASTM D5185m	574	---	---
Sulfur	ppm	ASTM D5185m	6022	---	---





CONTAMINANTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >15	<1	---	---
Sodium	ppm	ASTM D5185m	0	---	---
Potassium	ppm	ASTM D5185m >20	0	---	---

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	▲ 260310	---	---
Particles >6µm	ASTM D7647	>1300	▲ 111618	---	---
Particles >14µm	ASTM D7647	>160	▲ 8692	---	---
Particles >21µm	ASTM D7647	>40	▲ 2013	---	---
Particles >38µm	ASTM D7647	>10	▲ 48	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 25/24/20	---	---

FLUID DEGRADATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.37	---	---



OIL ANALYSIS REPORT

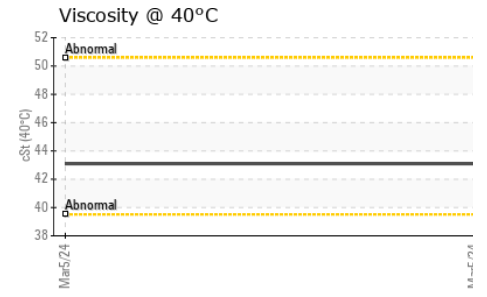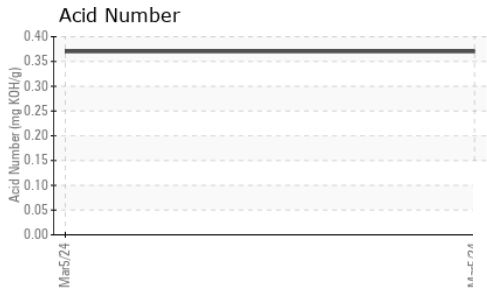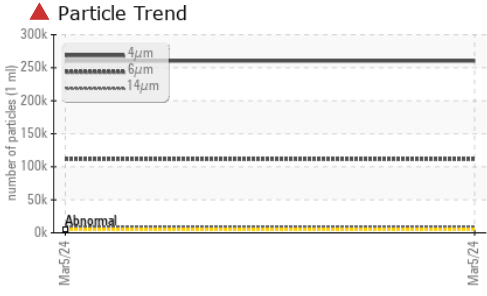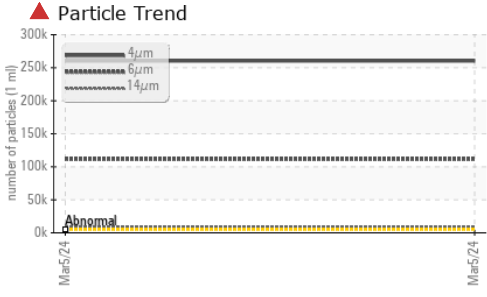






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	---
Yellow Metal	scalar	*Visual	NONE	NONE	---
Precipitate	scalar	*Visual	NONE	NONE	---
Silt	scalar	*Visual	NONE	LIGHT	---
Debris	scalar	*Visual	NONE	NONE	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---
Appearance	scalar	*Visual	NORML	NORML	---
Odor	scalar	*Visual	NORML	NORML	---
Emulsified Water	scalar	*Visual	>0.05	NEG	---
Free Water	scalar	*Visual		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	43.1	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color		no image	no image
Bottom		no image	no image

GRAPHS

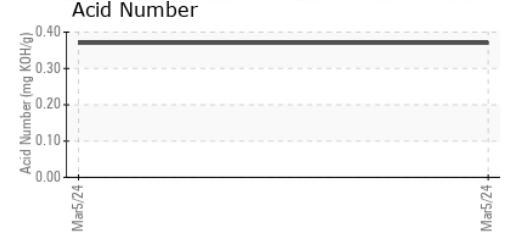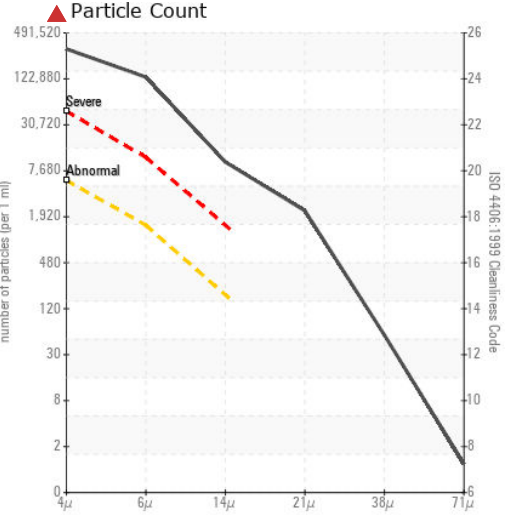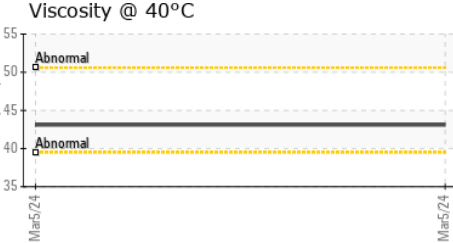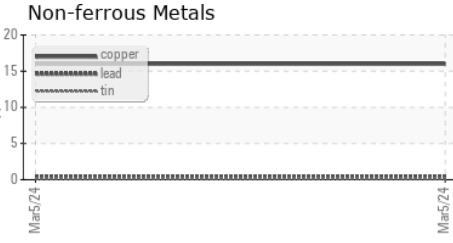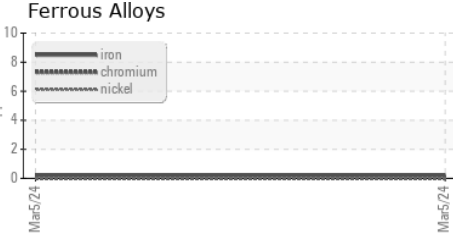

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0911760
Lab Number : 06122294
Unique Number : 10936445
Test Package : IND 2

Received : 19 Mar 2024
Tested : 20 Mar 2024
Diagnosed : 20 Mar 2024 - Wes Davis

ACTION INDUSTRIAL SUPPLY - HICKORY
 545 20TH STREET SE
 HICKORY, NC
 US 28602
 Contact: JODIE LAFONE
 jodie@actionindsupply.com
 T: (704)878-9991
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)