


# **OIL ANALYSIS REPORT**

**QUINSYN** [419584]

QUINCY BU1302080058 - WELDON ASPHALT

Component

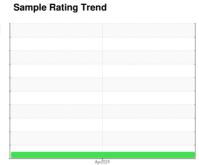



## DIAGNOSIS

### Recommendation

We suspect abnormal contamination may be due to sampling method. The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

All component wear rates are normal.

## Contamination

Moderate concentration of visible dirt/debris present in the oil.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Apr2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06148792		
Sample Date		Client Info		09 Apr 2024		
Machine Age	hrs	Client Info		110530		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	6		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	0		
Tin	ppm	ASTM D5185m	>15	0		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		<1		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		9		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.1	0.013		
ppm Water	ppm	ASTM D6304	>1000	130		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


0.36

Acid Number (AN)

mg KOH/g ASTM D8045 .10



# **OIL ANALYSIS REPORT**

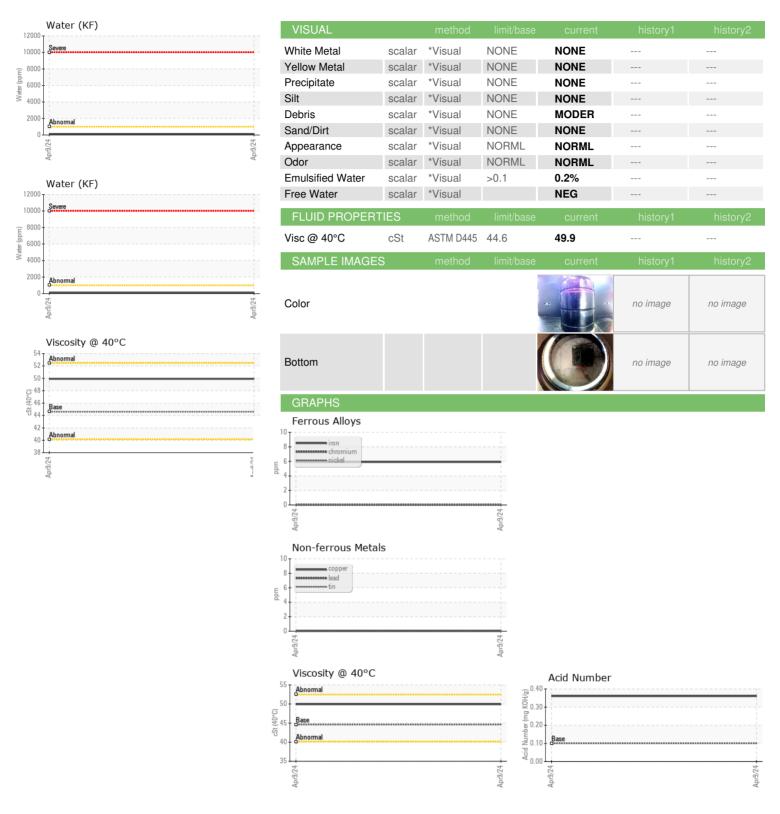





Certificate 12367

Laboratory Sample No.

: UCH06148792 Lab Number : 06148792

Unique Number : 10978870 Test Package : IND 2 ( Additional Tests: KF )

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 15 Apr 2024 **Tested** 

: 18 Apr 2024 Diagnosed

: 18 Apr 2024 - Jonathan Hester

US 07072 Contact: ELVIN DIAZ ediaz@airmaticcompressor.com;canastasio@wearcheckusa.com

Contact/Location: ELVIN DIAZ - UCAIRCAR

**AIRMATIC COMPRESSOR SYSTEMS** 

700 WASHINGTON AVE

CARLSTADT, NJ

T: (800)864-7621 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (201)342-6241