


# **PROBLEM SUMMARY**

Sample Rating Trend

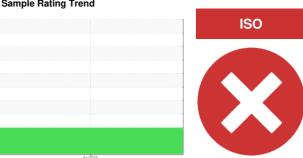


Machine Id

# **KUBOTA KX040-4 29662**

Hydraulic System

**QWIKLIFT HTB (--- GAL)** 

## **COMPONENT CONDITION SUMMARY**

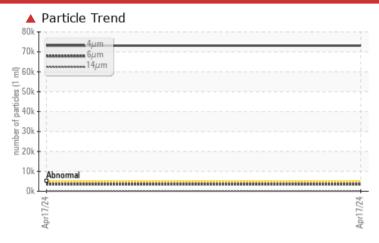

### RECOMMENDATION

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS									
Sample Status			SEVERE						
Particles >4µm	ASTM D7647	>5000	<b>A</b> 73141						
Particles >6µm	ASTM D7647	>1300	<b>4</b> 3458						
Oil Cleanliness	ISO 4406 (c)	>19/17/14	<b>23/19/14</b>						

Customer Id: LEAGRA Sample No.: Y2K0001870 Lab Number: 06157693 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS								
Action	Status	Date	Done By	Description				
Change Filter			?	We recommend you service the filters on this component.				
Resample			?	Resample in 30-45 days to monitor this situation.				
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.				
Check Breathers			?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.				
Check Seals			?	Check seals and/or filters for points of contaminant entry.				

# HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

## \_\_

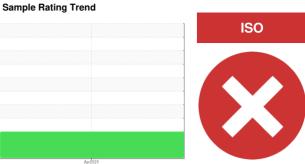

Machine Id

# KUBOTA KX040-4 29662

Hydraulic System

Fluid

**QWIKLIFT HTB (--- GAL)** 

## DIAGNOSIS

### Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend you service the filters on this component. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

## Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil. The water content is negligible.


#### **Fluid Condition**

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

				Apr2024	<del>.</del>	
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		Y2K0001870		
Sample Date		Client Info		17 Apr 2024		
Machine Age	hrs	Client Info		1498		
Oil Age	hrs	Client Info		1498		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	14		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>75	5		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		43		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		21		
Calcium	ppm	ASTM D5185m		1423		
Phosphorus	ppm	ASTM D5185m		588		
Zinc	ppm	ASTM D5185m		758		
Sulfur	ppm	ASTM D5185m		5617		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	5		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.1	0.019		
ppm Water	ppm	ASTM D6304	>1000	200		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<b>A</b> 73141		
Particles >6µm		ASTM D7647	>1300	<b>△</b> 3458		
Particles >14µm		ASTM D7647	>160	124		
Particles >21µm		ASTM D7647	>40	28		
Particles >38µm		ASTM D7647	>10	0		
Particles >71μm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	<b>23/19/14</b>		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.52		



## **OIL ANALYSIS REPORT**

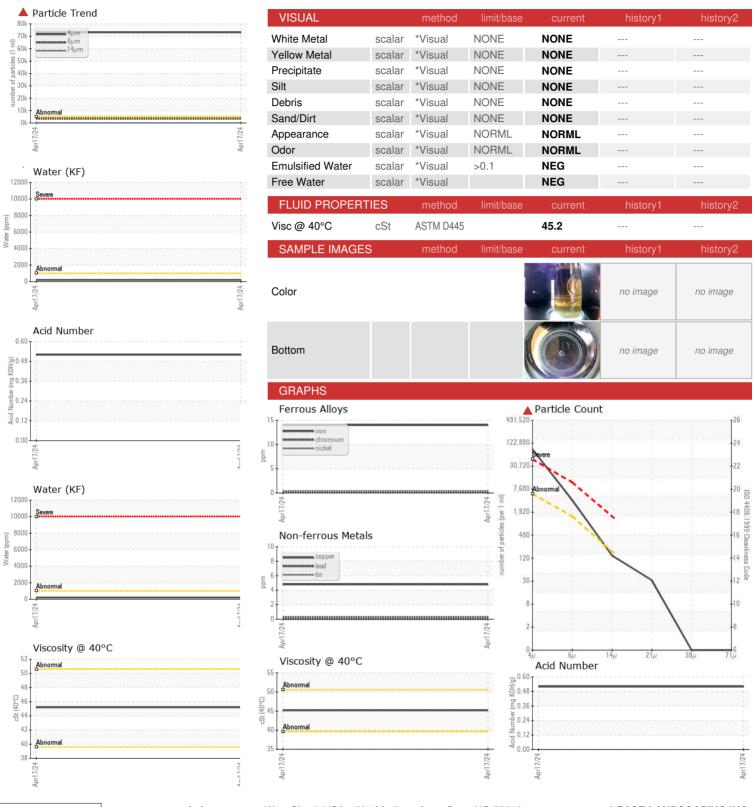





Certificate 12367

Laboratory Sample No. Lab Number : 06157693 Unique Number : 10993116 Test Package : PLANT

: Y2K0001870

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 23 Apr 2024 Tested : 24 Apr 2024

Diagnosed : 24 Apr 2024 - Wes Davis **LEASE LANDSCAPING INC** 32057 S PIT RD

GRAND RAPIDS, MN US 55744 Contact: PAUL BLENKER

To discuss this sample report, contact Customer Service at 1-800-237-1369.

 $^st$  - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) T: (320)249-5157 F: