


OIL ANALYSIS REPORT

Acid Number (AN)

mg KOH/g ASTM D8045 0.252

N/A [OPC2698382] **GARDNER DENVER D220176 - DONSUEMOR INC**

Component

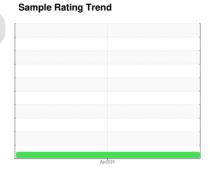



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UCH06177304		
Sample Date		Client Info		09 Apr 2024		
Machine Age	hrs	Client Info		15406		
Oil Age	hrs	Client Info		6909		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	0	2		
Molybdenum	ppm	ASTM D5185m	0	<1		
Manganese	ppm	ASTM D5185m	0	0		
Magnesium	ppm	ASTM D5185m	1.2	0		
Calcium	ppm	ASTM D5185m	0	3		
Phosphorus	ppm	ASTM D5185m	295	156		
Zinc	ppm	ASTM D5185m	0	47		
Sulfur	ppm	ASTM D5185m	253	422		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2

0.21



OIL ANALYSIS REPORT

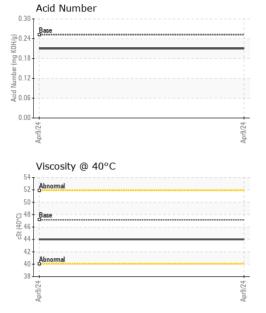





Color		no image	no image
Bottom		no image	no image
GRAPHS			

Ferrous Alloys



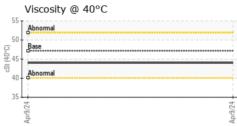

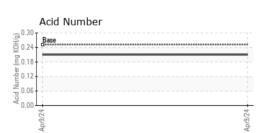





Laboratory Sample No.

Lab Number : 06177304 Unique Number : 11023357

: UCH06177304

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 13 May 2024

Tested : 14 May 2024 Diagnosed

: 15 May 2024 - Don Baldridge

Test Package : IND 2 Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

CISCO AIR SYSTEMS

2373 LINCOLN AVE HAYWARD, CA US 94545 Contact: JOHN FINCH jfinch@ciscoair.com T: (916)414-0331

Contact/Location: JOHN FINCH - UCCISHAY

F: x: