




PROBLEM SUMMARY

Machine Id WEST INJECTOR Component Hydraulic System Fluid MOBIL DTE FM 32 (--- GAL)

COMPONENT CONDITION SUMMARY

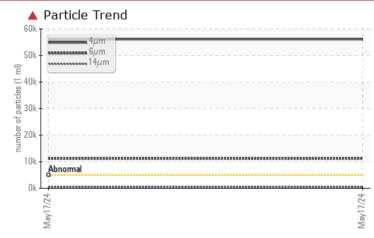

RECOMMENDATION

We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

PROBLEMATIC TEST RESULTS

Sample Status			SEVERE	
Particles >4µm	ASTM D7647	>5000	56124	
Particles >6µm	ASTM D7647	>1300	11163	
Particles >14µm	ASTM D7647	>160	<u> </u>	
Particles >21µm	ASTM D7647	>40	<mark>/</mark> 90	
Oil Cleanliness	ISO 4406 (c)	>19/17/14	2 3/21/16	

Customer Id: DANBROMN Sample No.: WC0880574 Lab Number: 06196630 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Filter			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.			
Resample			?	Resample in 30-45 days to monitor this situation.			
Information Required			?	NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.			
Check Breathers			?	The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather.			
Check Dirt Access			?	We advise that you check all areas where contaminants can enter the system.			
Filter Fluid			?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

ISO

Machine Id

WEST INJECTOR Component Hydraulic System Fluid MOBIL DTE FM 32 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check all areas where contaminants can enter the system. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample in 30-45 days to monitor this situation. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates (2 to 100 microns in size) present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0880574		
Sample Date		Client Info		17 May 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	3		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	0		
Lead	ppm	ASTM D5185m	>20	0		
Copper	ppm	ASTM D5185m	>20	1		
Tin	ppm	ASTM D5185m	>20	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m		<1		
Calcium	ppm	ASTM D5185m		<1		
Phosphorus	ppm	ASTM D5185m		546		
Zinc	ppm	ASTM D5185m		4		
Sulfur	ppm	ASTM D5185m		601		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	<1		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	0		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	56124		
Particles >6µm		ASTM D7647	>1300	11163		
Particles >14µm		ASTM D7647	>160	<u> </u>		
Particles >21µm		ASTM D7647	>40	<mark>/</mark> 90		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/21/16		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.40		

Contact/Location: Service Manager - DANBROMN Page 3 of 4



OIL ANALYSIS REPORT

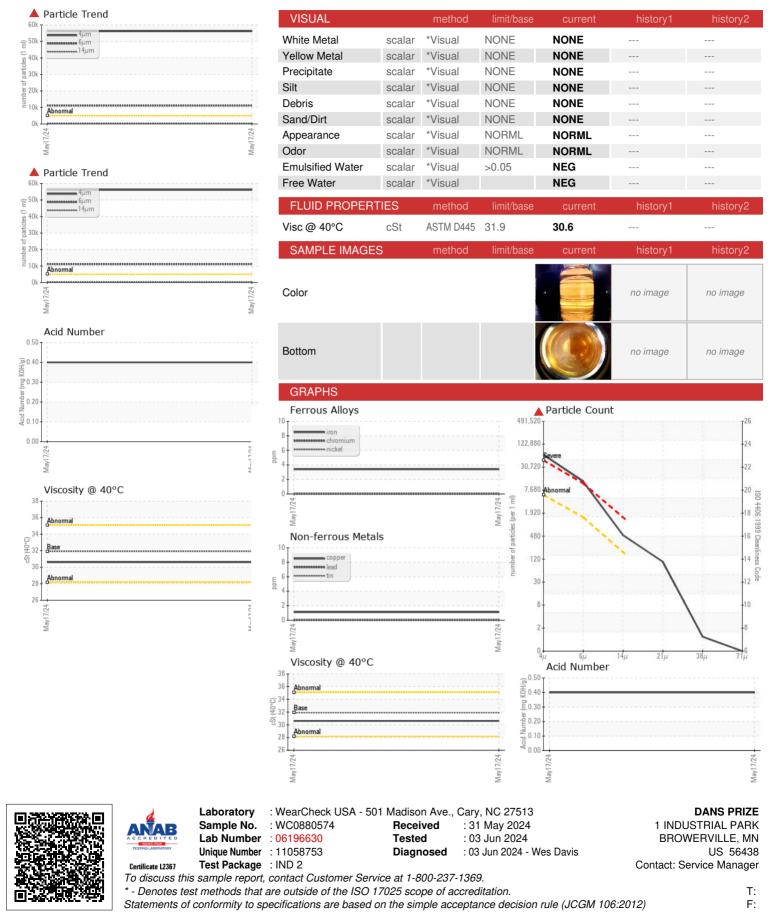

Report Id: DANBROMN [WUSCAR] 06196630 (Generated: 06/04/2024 07:21:46) Rev: 1

Contact/Location: Service Manager - DANBROMN