


OIL ANALYSIS REPORT

D100 [291020] **6036126-LDV - RYAN METAL**

Compressor

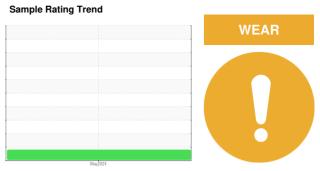

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

The iron level is abnormal. All other component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		UFD0002179		
Sample Date		Client Info		29 May 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
CONTAMINATION	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	85		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m		0		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	13		
Lead	ppm	ASTM D5185m	>25	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>15	4		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		1		
Magnesium	ppm	ASTM D5185m		0		
Calcium	ppm	ASTM D5185m		0		
Phosphorus	ppm	ASTM D5185m		540		
Zinc	ppm	ASTM D5185m		0		
Sulfur	ppm	ASTM D5185m		550		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3		
Sodium	ppm	ASTM D5185m		1		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.14		



OIL ANALYSIS REPORT

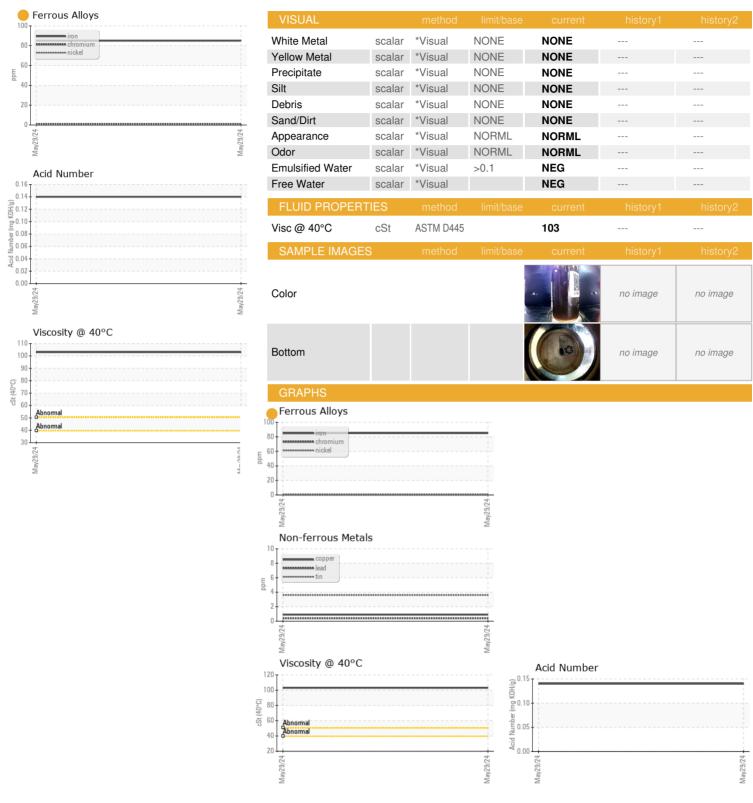





Certificate 12367

Laboratory Sample No. Unique Number : 11072284

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : UFD0002179 Lab Number : 06204823

Test Package : IND 2

Received : 10 Jun 2024 **Tested** : 12 Jun 2024

Diagnosed : 12 Jun 2024 - Don Baldridge

US 60143 Contact: ED DIENER ed.diener@fluidairedynamics.com

Contact/Location: ED DIENER - UCFLUSCH

FLUID-AIRE DYNAMICS

225 SPRING LAKE DR

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: UCFLUSCH [WUSCAR] 06204823 (Generated: 06/12/2024 17:58:14) Rev: 1

T: (847)678-8388

ITASCA, IL