

PROBLEM SUMMARY

Area

FG32


Machine Id

SULLIVAN PALATEK 19LE000689 - COMP 1 - TAYLOR FARMS SCHILLINGS

Component

Compressor



Sample Rating Trend

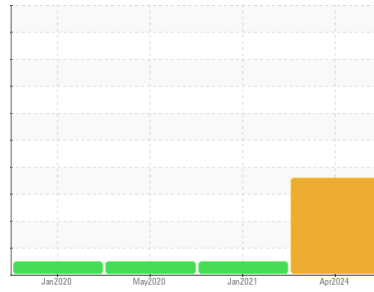

DEGRADATION



COMPONENT CONDITION SUMMARY

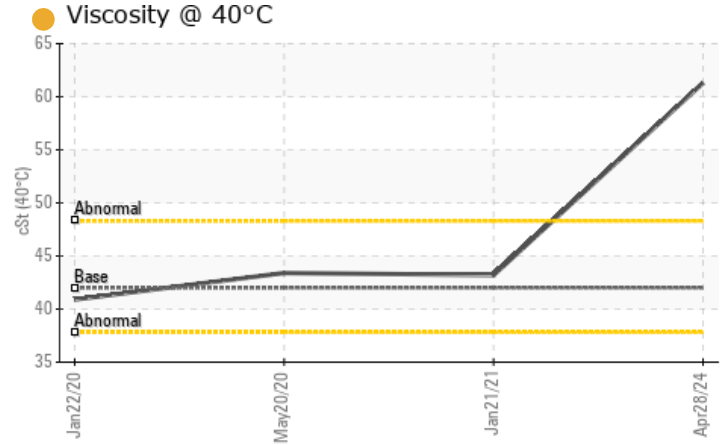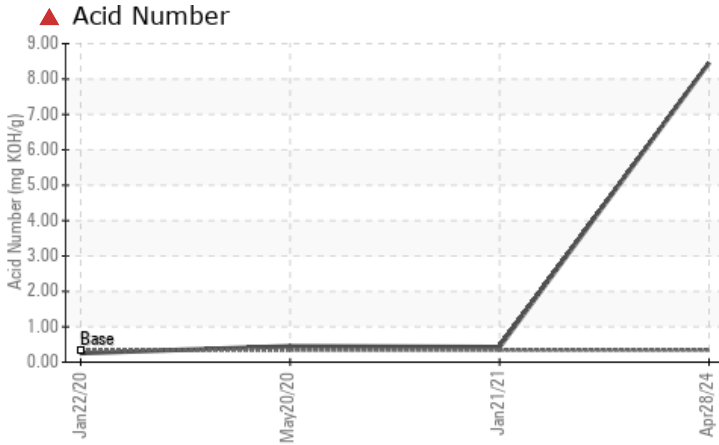

RECOMMENDATION

We advise that you check for a possible overheat condition. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS

Sample Status		SEVERE	NORMAL	NORMAL
Acid Number (AN)	mg KOH/g ASTM D8045	▲ 8.46	0.427	0.451

Customer Id: UCCOMSTO
 Sample No.: UCS06211815
 Lab Number: 06211815
 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Don Baldrige +1
don.b505@comcast.net

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Fluid	---	---	?	We recommend that you drain the oil from the component if this has not already been done.
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check For Overheating	---	---	?	We advise that you check for a possible overheat condition.

HISTORICAL DIAGNOSIS

NORMAL



21 Jan 2021 Diag: Jonathan Hester

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



NORMAL



20 May 2020 Diag: Jonathan Hester

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



NORMAL



22 Jan 2020 Diag: Don Baldrige

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



Area


FG32

Machine Id

SULLIVAN PALATEK 19LE000689 - COMP 1 - TAYLOR FARMS SCHILLINGS

Component

Compressor

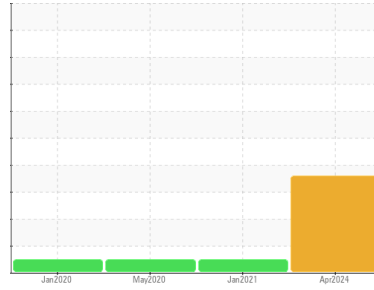

DIAGNOSIS

▲ Recommendation

We advise that you check for a possible overheat condition. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

▲ Fluid Condition

The AN level is above the recommended limit. The oil viscosity is higher than normal. TAN level indicates possible presence of varnish. The oil is no longer serviceable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		UCS06211815	UCS05194204	UCS05194231
Sample Date	Client Info		28 Apr 2024	21 Jan 2021	20 May 2020
Machine Age	hrs	Client Info	30571	10307	4409
Oil Age	hrs	Client Info	0	1000	0
Oil Changed	Client Info		Not Changed	Not Changed	Not Changed
Sample Status			SEVERE	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	0	<1	<1
Chromium	ppm	ASTM D5185m >10	0	0	0
Nickel	ppm	ASTM D5185m	0	0	0
Titanium	ppm	ASTM D5185m	<1	0	0
Silver	ppm	ASTM D5185m	0	0	<1
Aluminum	ppm	ASTM D5185m >25	0	0	0
Lead	ppm	ASTM D5185m >25	0	<1	<1
Copper	ppm	ASTM D5185m >50	12	4	4
Tin	ppm	ASTM D5185m >15	0	<1	<1
Antimony	ppm	ASTM D5185m	---	0	0
Vanadium	ppm	ASTM D5185m	<1	0	0
Cadmium	ppm	ASTM D5185m	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 1	0	0	0
Barium	ppm	ASTM D5185m 0.3	2	0	0
Molybdenum	ppm	ASTM D5185m 0	0	0	0
Manganese	ppm	ASTM D5185m 0	<1	<1	<1
Magnesium	ppm	ASTM D5185m 0	0	0	<1
Calcium	ppm	ASTM D5185m 0.5	<1	0	0
Phosphorus	ppm	ASTM D5185m 536	101	404	384
Zinc	ppm	ASTM D5185m 0.2	6	1	13
Sulfur	ppm	ASTM D5185m 649	162	378	347


CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<1	0	0
Sodium	ppm	ASTM D5185m	6	<1	3
Potassium	ppm	ASTM D5185m >20	<1	0	<1

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.337	▲ 8.46	0.427	0.451


OIL ANALYSIS REPORT

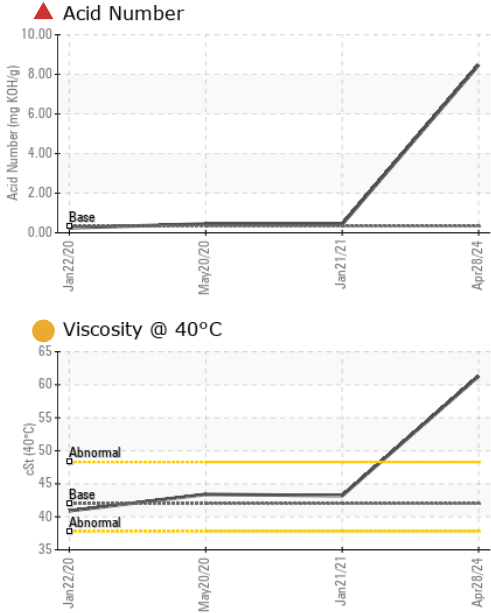





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	LIGHT	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D445	42.0	● 61.3	43.2	43.4

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

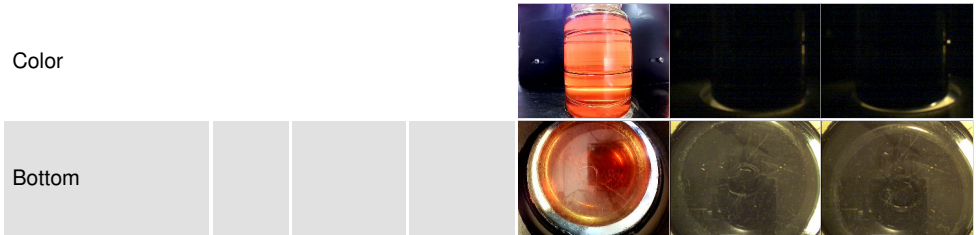

GRAPHS

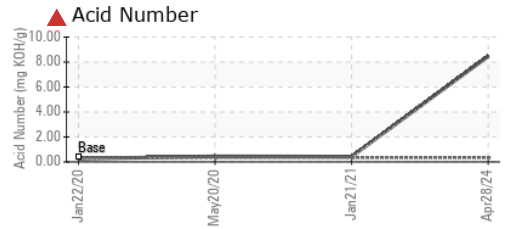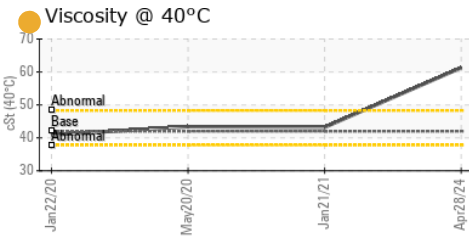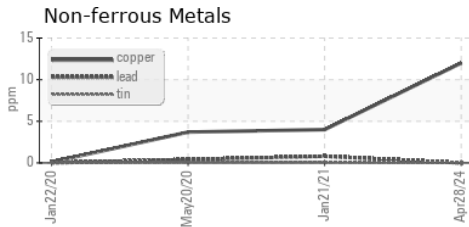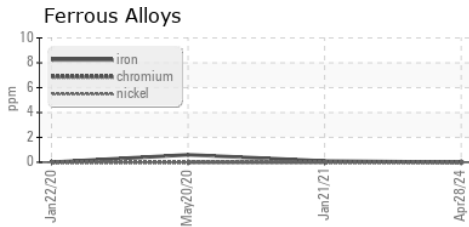

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : UCS06211815 **Received** : 17 Jun 2024
Lab Number : 06211815 **Tested** : 18 Jun 2024
Unique Number : 11084679 **Diagnosed** : 19 Jun 2024 - Don Baldrige
Test Package : IND 2

COMPLETE ENGINEERED SOLUTIONS - CES
 4772 FRONTIER WAY UNIT 400
 STOCKTON, CA 95215
 Contact: CHRISTO GINGRAS
 christo@complete-es.net
 T: (800)701-3196
 F: (209)753-4211

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)