

PROBLEM SUMMARY


Machine Id KAESER 1174237 (S/N 1011)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

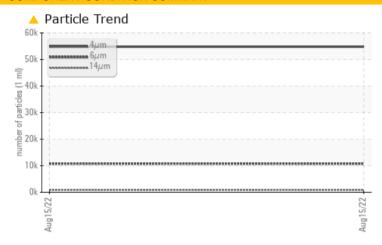

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST I	RESULTS			
Sample Status			ABNORMAL	
Particles >6µm	ASTM D7647	>1300	10788	
Particles >14μm	ASTM D7647	>80	A 867	
Particles >21µm	ASTM D7647	>20	^ 258	
Particles >38μm	ASTM D7647	>4	<u> </u>	
Particles >71μm	ASTM D7647	>3	<u>^</u> 2	
Oil Cleanliness	ISO 4406 (c)	>/17/13	23/21/17	

Customer Id: ALLREN Sample No.: KCP50583 Lab Number: 05623108 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS					
Action	Status	Date	Done By	Description	
Change Fluid			?	Oil and filter change at the time of sampling has been noted.	
Change Filter			?	Oil and filter change at the time of sampling has been noted.	

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



ISO

KAESER 1174237 (S/N 1011)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug 2022		
SAMPLE INFORM	ΙΔΤΙΩΝ	method	limit/base	current	history 1	history 2
		metriod	IIIIIIIIIIIII		· ·	Thistory 2
Sample Number				KCP50583		
Sample Date	lawa			15 Aug 2022		
Machine Age	hrs			38755		
Oil Age	hrs			4380		
Oil Changed				Changed ABNORMAL		
Sample Status				ADNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	7		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	22		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	56		
Calcium	ppm	ASTM D5185m	0	1		
Phosphorus	ppm	ASTM D5185m	0	2		
Zinc	ppm	ASTM D5185m	0	10		
Sulfur	ppm	ASTM D5185m	23500	19126		
CONTAMINANTS		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m	720	12		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	0.016		
ppm Water	ppm	ASTM D6304	>500	168.9		
FLUID CLEANLIN		method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		54804		
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >14µm		ASTM D7647	>80	<u>▲</u> 867		
Particles >21µm		ASTM D7647	>20	<u> </u>		
Particles >38µm		ASTM D7647	>4	<u> </u>		
Particles >71µm		ASTM D7647	>3	<u> </u>		
Oil Cleanliness		ISO 4406 (c)	>/17/13	<u></u>		
FLUID DEGRADA	TION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.38		
AGIO NUMBER (AIN)	my NOTI/9	49 LINI D0049	1.0	0.50		



OIL ANALYSIS REPORT

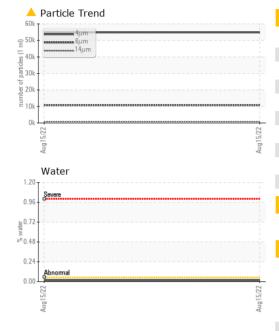

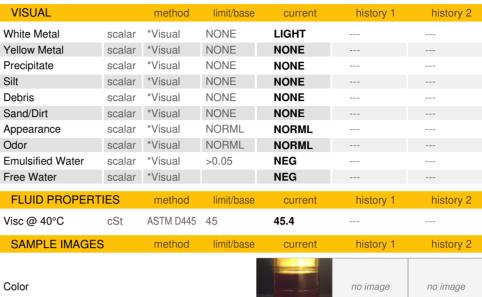

GRAPHS		
Ferrous Alloys	Particle Count	
iron chromium	122,880	
anananananan (IICXE)	30,720	
-	7,680	
Aug 15/22	Aug 15,222 number of particles (per 1 ml) 120 120 120 120 120 120 120 120 120 120	
Non-ferrous Metals	A A A A A A A A A A A A A A A A A A A	
copper	120 -	
secondona (I)	30-	
	8 Sebrewernal	
Aug 15/22	Aug 15/22	
Viscosity @ 40°C	4μ 6μ 14μ	21μ 38μ 7
	Acid Number	
Severe Abnormal	AH 0.96	
Base	€ 0.72	
Abnormal Severe	1.20 1.20	
Aug15/22 -	Aug15/22 +	
Αug	Aug	



Certificate L2367

Laboratory Sample No. Lab Number Unique Number

: KCP50583 : 05623108 : 10102615

Bottom

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received Diagnosed

: 22 Aug 2022 : 23 Aug 2022 Diagnostician : Jonathan Hester

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ALL AMERICAN AUTO BODY

2245 HARVARD WAY RENO, NV USA 89502

Contact: Service Manager

T: F:

no image

no image