

PROBLEM SUMMARY

Sample Rating Trend

ISO

Machine Id


KAESER BSD 50 1822854 (S/N 1057)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

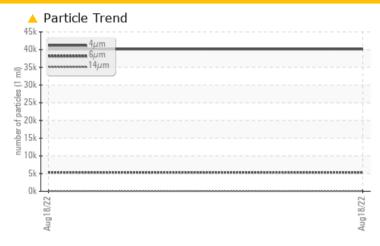

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status			ABNORMAL					
Particles >6µm	ASTM D7647	>1300	△ 5324					
Oil Cleanliness	ISO 4406 (c)	>/17/13	23/20/13					

Customer Id: MSSCHANC Sample No.: KCP28746 Lab Number: 05627489 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	Oil and filter change at the time of sampling has been noted.			
Change Filter			?	Oil and filter change at the time of sampling has been noted.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

ISO

KAESER BSD 50 1822854 (S/N 1057)

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP28746		
Sample Date				18 Aug 2022		
Machine Age	hrs			60590		
Oil Age	hrs			0		
Oil Changed	1113			Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base			
				current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	3		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		<1		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	24		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	57		
Calcium	ppm	ASTM D5185m	0	1		
Phosphorus	ppm	ASTM D5185m	0	99		
Zinc	ppm	ASTM D5185m	0	9		
Sulfur	ppm	ASTM D5185m	23500	15358		
CONTAMINANTS	;	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	1		
Sodium	ppm	ASTM D5185m		17		
Potassium	ppm	ASTM D5185m	>20	2		
Water	%	ASTM D6304	>0.05	0.032		
ppm Water	ppm	ASTM D6304	>500	329.7		
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		40134		
Particles >6µm		ASTM D7647	>1300	5324		
Particles >14µm		ASTM D7647	>80	77		
Particles >21μm		ASTM D7647	>20	8		
Particles >38µm		ASTM D7647	>4	0		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	23/20/13		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)				0.31		


Acid Number (AN)


mg KOH/g ASTM D8045 1.0

0.31



OIL ANALYSIS REPORT

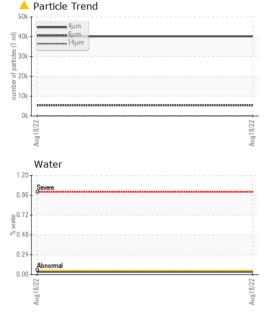

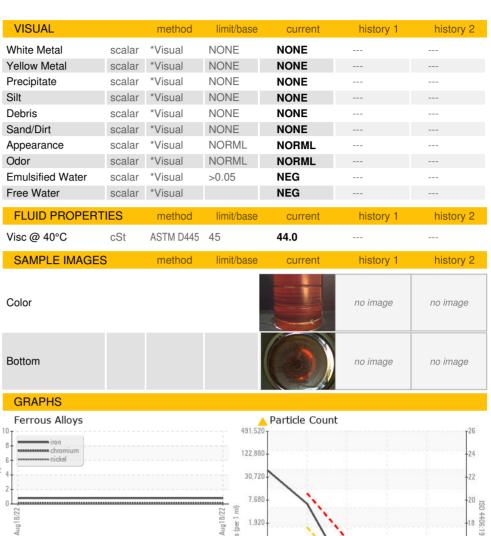

480 120

(B) 1.20 0.96 € 0.72

은 0.48

0.24 0.00 Acid Number





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 10112010

ද්දු 45

40

: KCP28746 : 05627489

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Non-ferrous Metals

Viscosity @ 40°C

Received Diagnosed

Diagnostician : Don Baldridge

: 25 Aug 2022 : 28 Aug 2022

Test Package : IND 2 (Additional Tests: KF, PrtCount) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MSS SOLUTIONS 11524 WILMAR BLVD

CHARLOTTE, NC USA 28273

Contact: Service Manager

T:

F: