

PROBLEM SUMMARY

Sample Rating Trend

ISO


5102313 (S/N 1233)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- LTR)

COMPONENT CONDITION SUMMARY

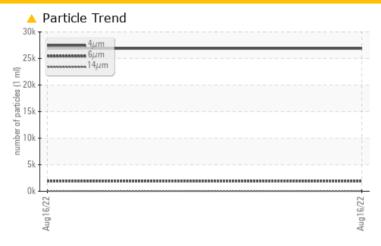

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC T	EST RESULTS			
Sample Status			ATTENTION	
Particles >6µm	ASTM D7647	>1300	1904	
Oil Cleanliness	ISO 4406 (c)	>/17/13	22/18/13	

Customer Id: RICCARNJ Sample No.: KCP50525 Lab Number: 05628932 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Doug Bogart +1 (800)237-1369 x4016 dougb@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

5102313 (S/N 1233)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- LTR)

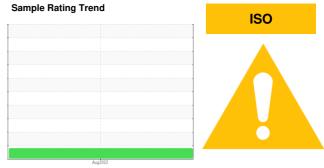

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP50525		
Sample Date				16 Aug 2022		
Machine Age	hrs			9221		
Oil Age	hrs			0		
Oil Changed				Changed		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	4		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	4		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	<1		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	12		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	2		
Zinc	ppm	ASTM D5185m	0	29		
Sulfur	ppm	ASTM D5185m	23500	19706		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	7		
Sodium	ppm	ASTM D5185m		2		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304		0.014		
ppm Water	ppm	ASTM D6304	>500	147.8		
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		26881		
Particles >6µm		ASTM D7647	>1300	1904		
Particles >14µm		ASTM D7647	>80	55		
Particles >21µm		ASTM D7647	>20	12		
Particles >38µm		ASTM D7647	>4	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	22/18/13		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.44		



OIL ANALYSIS REPORT

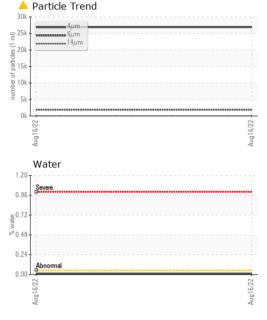

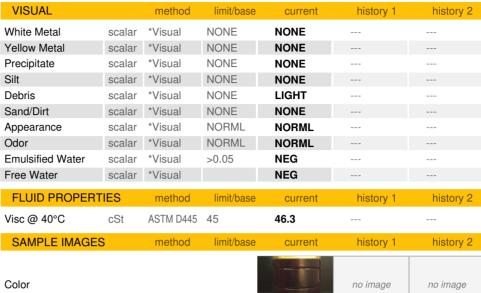

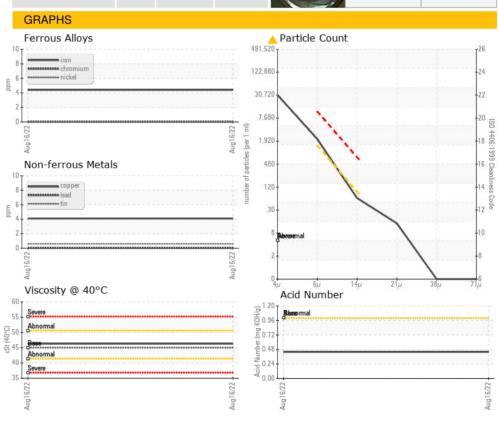





Laboratory Sample No. **Unique Number**

Lab Number

: KCP50525 : 05628932 : 10113453

Bottom

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 30 Aug 2022 Diagnostician : Doug Bogart

: 29 Aug 2022

no image

no image

Contact: Service Manager

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F:

Contact/Location: Service Manager - RICCARNJ

RICE HYDRO INC

CARSON CITY, NJ

USA 89706

3500 ARROWHEAD DR