

PROBLEM SUMMARY

Sample Rating Trend




KAESER AIRCENTER SM 7.5 6756192 (S/N 1051)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

COMPONENT CONDITION SUMMARY

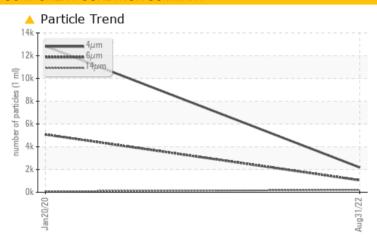

RECOMMENDATION

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS							
Sample Status			ABNORMAL	ABNORMAL			
Particles >14μm	ASTM D7647	>80	^ 202	80			
Particles >21μm	ASTM D7647	>20	5 0	18			
Oil Cleanliness	ISO 4406 (c)	>/17/13	18/17/15	A 20/13			

Customer Id: VINALL Sample No.: KC103117 Lab Number: 05636518 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED	ACTIONS			
Action	Status	Date	Done By	Description
Change Fluid			?	Oil and filter change at the time of sampling has been noted.
Change Filter			?	Oil and filter change at the time of sampling has been noted.

HISTORICAL DIAGNOSIS

20 Jan 2020 Diag: Jonathan Hester






Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a high amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

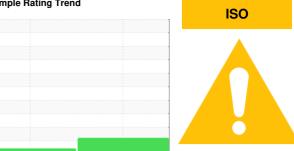

KAESER AIRCENTER SM 7.5 6756192 (S/N 1051)

Compressor

KAESER SIGMA (OEM) S-460 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is a high amount of particulates present in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Jan 2020	Aug ² 022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KC103117	KC75845	
Sample Date				31 Aug 2022	20 Jan 2020	
Machine Age	hrs			12689	1412	
Oil Age	hrs			5283	1412	
Oil Changed				Changed	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	0	1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	0	
Aluminum	ppm	ASTM D5185m	>10	0	0	
Lead	ppm	ASTM D5185m	>10	0	2	
Copper	ppm	ASTM D5185m	>50	1	3	
Tin	ppm	ASTM D5185m	>10	0	0	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m		0	<1	
Barium	ppm	ASTM D5185m	90	0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m	90	58	47	
Calcium	ppm	ASTM D5185m	2	0	3	
Phosphorus	ppm	ASTM D5185m		<1	1	
Zinc	ppm	ASTM D5185m		5	34	
CONTAMINANTS	}	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	1	1	
Sodium	ppm	ASTM D5185m		18	22	
Potassium	ppm	ASTM D5185m	>20	0	4	
Water	%	ASTM D6304	>0.05	0.027	0.014	
ppm Water	ppm	ASTM D6304	>500	278.4	144.7	
FLUID CLEANLIN	IESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		2181	12845	
Particles >6µm		ASTM D7647	>1300	1057	<u>▲</u> 5078	
Particles >14μm		ASTM D7647	>80	<u>^</u> 202	80	
Particles >21µm		ASTM D7647	>20	^ 50	18	
Particles >38μm		ASTM D7647	>4	2	1	
Particles >71μm		ASTM D7647	>3	0	0	
Oil Cleanliness		ISO 4406 (c)	>/17/13	18/17/15	2 0/13	
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.4	0.40	0.276	


Contact/Location: ? ? - VINALL



OIL ANALYSIS REPORT

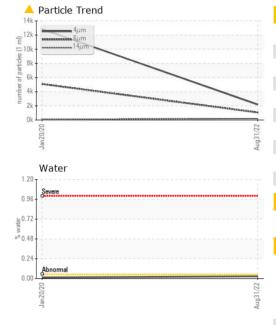



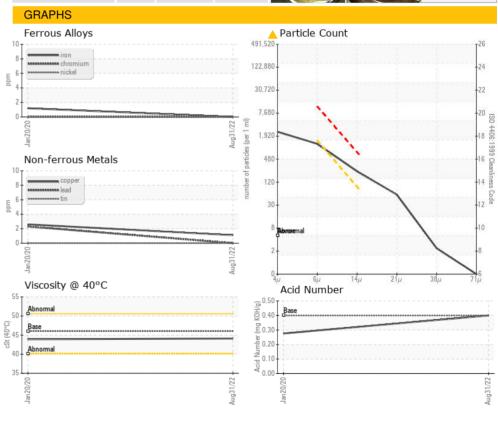



Certificate L2367

Laboratory Sample No. Lab Number Test Package : IND 2

Unique Number

: KC103117 . 05636518 : 10126048

Bottom

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 08 Sep 2022 : 09 Sep 2022 : Don Baldridge Diagnostician

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

VINART BODY SHOP 3115 BERGER ST ALLENTOWN, PA

USA 18103

no image

Contact:

T: F: