

PROBLEM SUMMARY

Sample Rating Trend

WATER




8006363 (S/N 1482)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

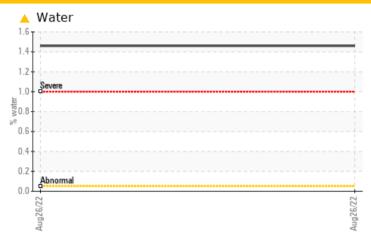

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. There is too much water present in this sample to perform a particle count. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC TEST RESULTS							
Sample Status				ABNORMAL			
Water	%	ASTM D6304	>0.05	<u>1.46</u>			
ppm Water	ppm	ASTM D6304	>500	14600			
Free Water	scalar	*Visual		△ 1.0			

Customer Id: LPMDEP Sample No.: KCP48306 Lab Number: 05638103 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend



8006363 (S/N 1482)

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. There is too much water present in this sample to perform a particle count. We recommend an early resample in 500 hours to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high concentration of water present in the oil. Free water present.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP48306		
Sample Date				26 Aug 2022		
Machine Age	hrs			3181		
Oil Age	hrs			3000		
Oil Changed				Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	<1		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	<1		
Copper	ppm	ASTM D5185m	>50	3		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	<1		
Barium	ppm	ASTM D5185m	90	0		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	100	0		
Calcium	ppm	ASTM D5185m	0	0		
Phosphorus	ppm	ASTM D5185m	0	4		
Zinc	ppm	ASTM D5185m	0	0		
Sulfur	ppm	ASTM D5185m	23500	18179		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	0		
Water	%	ASTM D6304	>0.05	1.46		
ppm Water	ppm	ASTM D6304	>500	14600		
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2


0.36

Acid Number (AN)

mg KOH/g ASTM D8045 1.0



OIL ANALYSIS REPORT

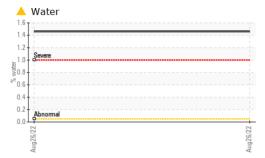






Bottom no image no image	Color	no image	no image
	Bottom	no image	no image

GRAPHS



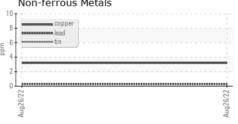

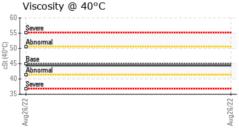

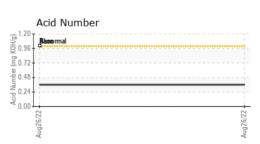





Laboratory Sample No. Lab Number Unique Number

: KCP48306 : 05638103 : 10127633

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received Diagnosed

: 09 Sep 2022 : 13 Sep 2022 Diagnostician : Don Baldridge

Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

LP MACHINE LLC 1296 CAMBER CT STE 108

DE PERE, WI USA 54115

Contact: Service Manager

T:

F: