

PROBLEM SUMMARY

Sample Rating Trend

WATER

KAESER 7992707

Component


Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)





COMPONENT CONDITION SUMMARY

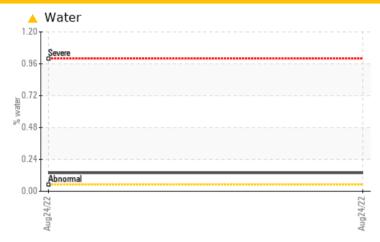

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. We recommend an early resample in 500 hours to monitor this condition.

PROBLEMATIC 1	EST RE	SULTS			
Sample Status				ABNORMAL	
Water	%	ASTM D6304	>0.05	△ 0.138	
ppm Water	ppm	ASTM D6304	>500	1387.0	

Customer Id: AMAJACFL Sample No.: KCP33336 Lab Number: 05639084 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT



KAESER 7992707

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. We recommend an early resample in 500 hours to monitor this condition.

All component wear rates are normal.

Contamination

There is a light concentration of water present in the oil. The amount and size of particulates present in the system are acceptable.


Fluid Condition

The AN level is acceptable for this fluid.

				Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP33336		
Sample Date				24 Aug 2022		
Machine Age	hrs			356		
Oil Age	hrs			356		
Oil Changed				Changed		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	<1		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>3	0		
Titanium	ppm	ASTM D5185m	>3	0		
Silver	ppm	ASTM D5185m	>2	0		
Aluminum	ppm	ASTM D5185m	>10	2		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>50	2		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0		
Barium	ppm	ASTM D5185m	90	18		
Molybdenum	ppm	ASTM D5185m	0	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	100	69		
Calcium	ppm	ASTM D5185m	0	4		
Phosphorus	ppm	ASTM D5185m	0	4		
Zinc	ppm	ASTM D5185m	0	3		
Sulfur	ppm	ASTM D5185m	23500	17329		
CONTAMINANTS		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1		
Sodium	ppm	ASTM D5185m		9		
Potassium	ppm	ASTM D5185m	>20	34		
Water	%	ASTM D6304	>0.05	△ 0.138		
ppm Water	ppm	ASTM D6304	>500	▲ 1387.0		
FLUID CLEANLIN	ESS	method	limit/base	current	history 1	history 2
Particles >4µm		ASTM D7647		690		
Particles >6µm		ASTM D7647	>1300	78		
Particles >14µm		ASTM D7647	>80	5		
Particles >21µm		ASTM D7647		1		
Particles >38µm		ASTM D7647	>4	0		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>/17/13	17/13/10		
·	TION	ISO 4406 (c)	>/17/13 limit/base	17/13/10 current	history 1	history 2



OIL ANALYSIS REPORT

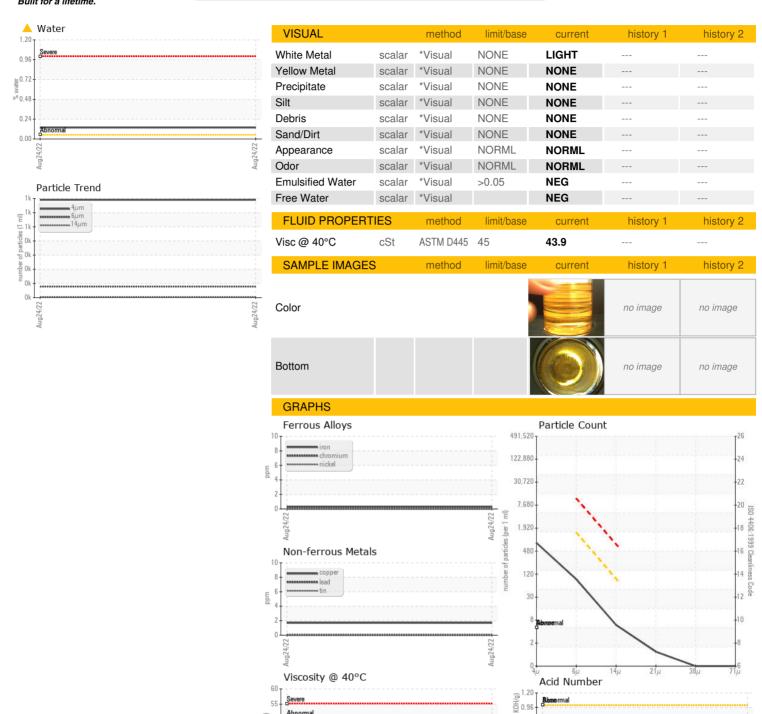





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 05639084 : 10128614

ද්දු 45

40

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : KCP33336 Received Diagnosed

: 14 Sep 2022 Diagnostician : Don Baldridge Test Package : IND 2 (Additional Tests: KF, PrtCount)

: 12 Sep 2022

€ 0.72

은 0.48

0.24 0.00

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

AMAZON.COM SERVICES JAX 7

10501 COLD STORAGE RD JACKSONVILLE, FL

USA 32218

Contact: Service Manager

T:

F: