

PROBLEM SUMMARY

Sample Rating Trend

VIS DEBRIS



KAESER 4760040

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status ABNORMAL ABNORMAL Debris scalar *Visual NONE ▲ MODER ▲ MODER ---

Customer Id: AMATRAOAK4 Sample No.: KCP49831 Lab Number: 05643069 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS Action Date Done By Description **Status** Change Fluid ? Oil and filter change at the time of sampling has been noted. Change Filter ? Oil and filter change at the time of sampling has been noted. We were unable to perform a particle count due to a high concentration of ? Alert particles present in this sample.

HISTORICAL DIAGNOSIS

12 Oct 2021 Diag: Doug Bogart

VIS DEBRIS




Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend

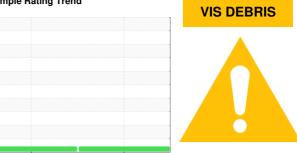

Annalation at Ital

KAESER 4760040

Component

Compressor

KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

Moderate concentration of visible dirt/debris present in the oil.


Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			0et2021	Aug2022		
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number				KCP49831	KCP36552	
Sample Date				18 Aug 2022	12 Oct 2021	
Machine Age	hrs			0	32396	
Oil Age	hrs			0	0	
Oil Changed				Changed	Changed	
Sample Status				ABNORMAL	ABNORMAL	
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185m	>50	0	<1	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m	>3	0	0	
Titanium	ppm	ASTM D5185m	>3	0	0	
Silver	ppm	ASTM D5185m	>2	0	<1	
Aluminum	ppm	ASTM D5185m	>10	<1	<1	
Lead	ppm	ASTM D5185m	>10	0	0	
Copper	ppm	ASTM D5185m	>50	3	9	
Tin	ppm	ASTM D5185m	>10	0	<1	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185m	0	0	<1	
Barium	ppm	ASTM D5185m	90	0	13	
Molybdenum	ppm	ASTM D5185m	0	0	0	
Manganese	ppm	ASTM D5185m		0	<1	
Magnesium	ppm	ASTM D5185m	100	63	42	
Calcium	ppm	ASTM D5185m	0	<1	0	
Phosphorus	ppm	ASTM D5185m	0	3	6	
Zinc	ppm	ASTM D5185m	0	28	4	
Sulfur	ppm	ASTM D5185m	23500	17890	18938	
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185m	>25	<1	2	
Sodium	ppm	ASTM D5185m		38	26	
Potassium	ppm	ASTM D5185m	>20	0	6	
Water	%	ASTM D6304	>0.05	0.036	0.016	
ppm Water	ppm	ASTM D6304	>500	365.3	168.9	
FLUID DEGRADA	ATION	method	limit/base	current	history 1	history 2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	0.34	0.387	




OIL ANALYSIS REPORT

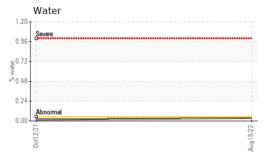


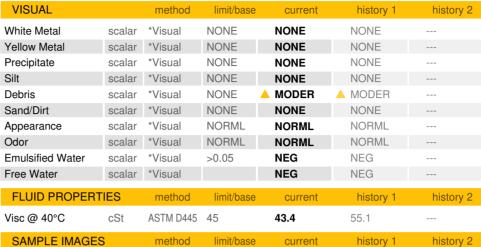



Color no image **Bottom** no image

GRAPHS

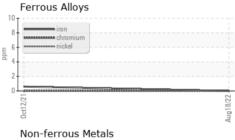

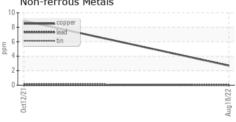

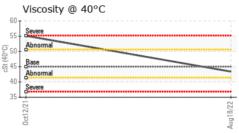

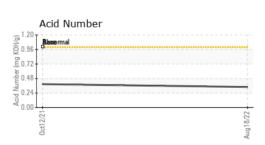





Laboratory Sample No. Lab Number **Unique Number**

: KCP49831 : 05643069 : 10137608

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

Diagnosed Diagnostician : Don Baldridge

: 15 Sep 2022 : 19 Sep 2022 1555 N CHRISMAN RD TRACY, CA USA 95304

AMAZON OAK 4

Contact: Service Manager

Test Package : IND 2 (Additional Tests: KF, PrtCount) Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: