OIL ANALYSIS REPORT

Sample Rating Trend

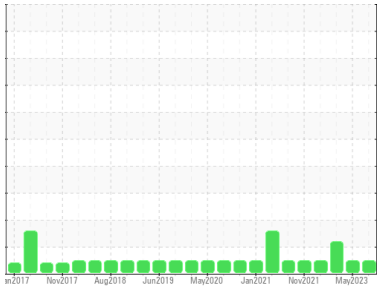

NORMAL

Area
Materials Handling/SW Pedestal Crane
Machine Id
WPD471201 CRANE PEDESTAL SOUTH WEST
Component
Hydraulic System
Fluid
MOBIL DTE 10 EXCEL 46 (--- GAL)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear
All component wear rates are normal.

Contamination
The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**PC13900049**	PP	PP13755937
Sample Date		Client Info		**27 Jun 2023**	25 May 2023	07 Jul 2022
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**NORMAL**	NORMAL	ATTENTION

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	**3**	3	2
Chromium	ppm	ASTM D5185(m)	>10	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>10	**0**	0	0
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)		**0**	0	0
Aluminum	ppm	ASTM D5185(m)	>10	**<1**	<1	<1
Lead	ppm	ASTM D5185(m)	>20	**1**	<1	<1
Copper	ppm	ASTM D5185(m)	>20	**<1**	<1	<1
Tin	ppm	ASTM D5185(m)	>10	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		**<1**	<1	8
Barium	ppm	ASTM D5185(m)		**0**	0	0
Molybdenum	ppm	ASTM D5185(m)		**0**	0	0
Manganese	ppm	ASTM D5185(m)		**0**	0	0
Magnesium	ppm	ASTM D5185(m)		**<1**	0	<1
Calcium	ppm	ASTM D5185(m)		**110**	119	107
Phosphorus	ppm	ASTM D5185(m)		**457**	471	440
Zinc	ppm	ASTM D5185(m)		**63**	60	53
Sulfur	ppm	ASTM D5185(m)		**1406**	1465	2854
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	**<1**	0	<1
Sodium	ppm	ASTM D5185(m)		**2**	2	2
Potassium	ppm	ASTM D5185(m)	>20	**<1**	<1	1

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	**1214**	156	▲ 6315
Particles >6µm		ASTM D7647	>1300	**226**	39	▲ 1328
Particles >14µm		ASTM D7647	>160	**18**	5	96
Particles >21µm		ASTM D7647	>40	**7**	2	19
Particles >38µm		ASTM D7647	>10	**1**	0	0
Particles >71µm		ASTM D7647	>3	**0**	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	**17/15/11**	14/12/10	▲ 20/18/14

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		**0.13**	0.14	0.20

OIL ANALYSIS REPORT

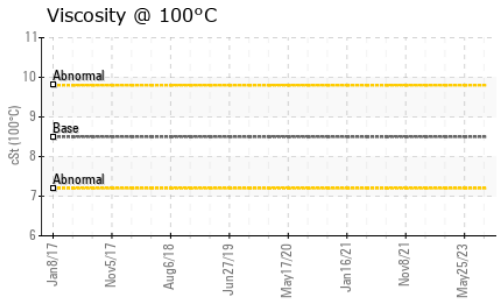

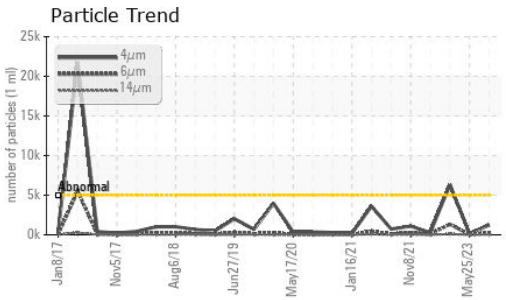

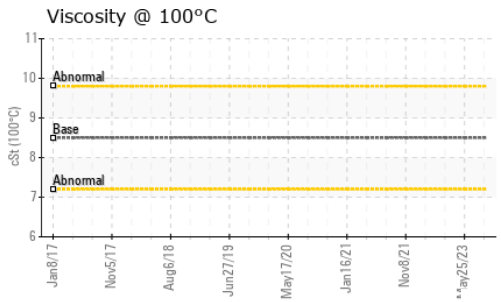

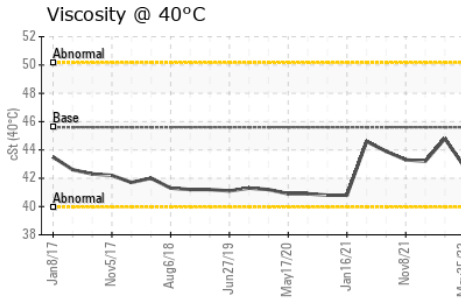

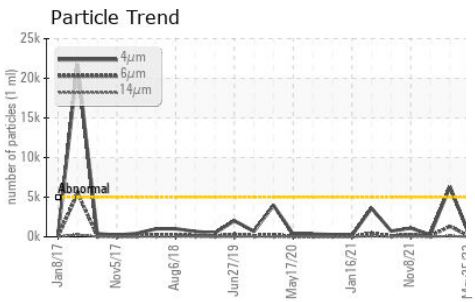

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Precipitate	scalar	Visual*	NONE	**NONE**	NONE	NONE
Silt	scalar	Visual*	NONE	**VLITE**	NONE	NONE
Debris	scalar	Visual*	NONE	**VLITE**	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Appearance	scalar	Visual*	NORML	**NORML**	NORML	NORML
Odor	scalar	Visual*	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	45.6	**42.4**	42.8	44.8
Visc @ 100°C	cSt	ASTM D7279(m)	8.5	**7.8**	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	164	**156**	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			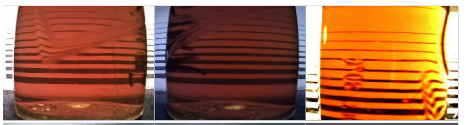		
Bottom					

GRAPHS

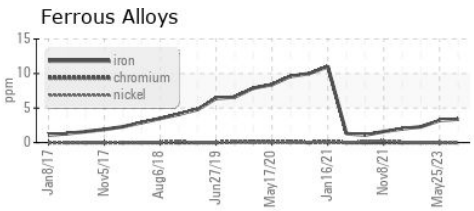

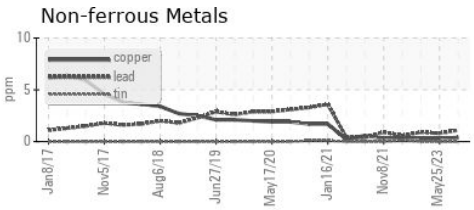

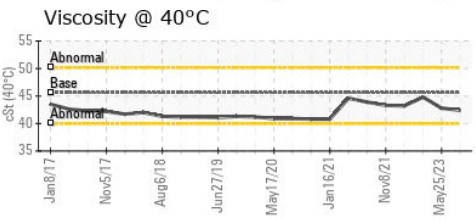

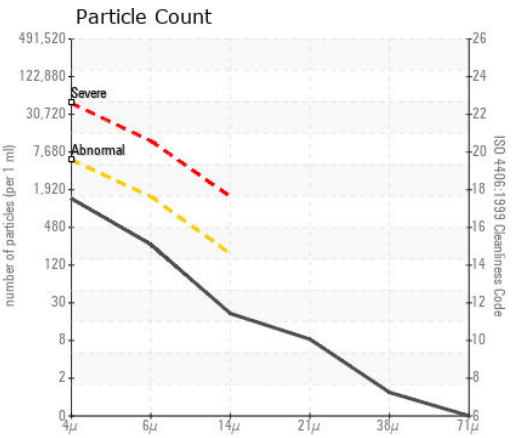

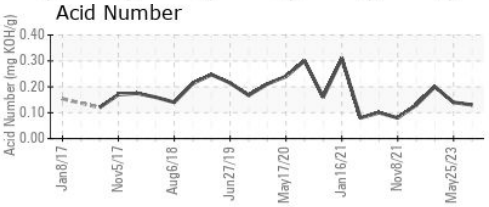

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC13900049 **Received** : 02 Aug 2023
Lab Number : 02573731 **Diagnosed** : 03 Aug 2023
Unique Number : 5618782 **Diagnostician** : Kevin Marson
Test Package : MAR 2 (Additional Tests: KV100, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

ExxonMobil Canada East Ltd.
Hebron-Materials and Repair Coordin, Suite 1000, 100 New Gow
St. John`s, NL
CA A1C 6K3
Contact: Liam Maher
liam.m.maher@exxonmobil.com
T: (709)273-3729
F: