# OIL ANALYSIS REPORT

Sample Rating Trend

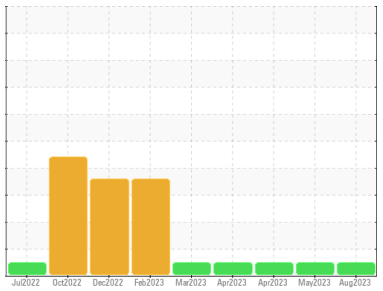


NORMAL

Machine Id
**SJB712**
Component
**Diesel Engine**
Fluid
**PETRO CANADA DURON SHP 10W30 (--- QTS)**

## DIAGNOSIS

**Recommendation**
Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

**Wear**
All component wear rates are normal.

**Contamination**
There is no indication of any contamination in the oil.

**Fluid Condition**
The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **PCA0100904** | PCA0097730 | PCA0097746 |
| Sample Date | | Client Info | | **02 Aug 2023** | 22 May 2023 | 26 Apr 2023 |
| Machine Age | mls | Client Info | | **163014** | 155292 | 148790 |
| Oil Age | mls | Client Info | | **4757** | 6502 | 3749 |
| Oil Changed | | Client Info | | **Changed** | Changed | Changed |
| Sample Status | | | | **NORMAL** | NORMAL | NORMAL |

| CONTAMINATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Fuel | | WC Method | >5 | **<1.0** | <1.0 | <1.0 |
| Glycol | | WC Method | | **NEG** | NEG | NEG |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >100 | **24** | 19 | 12 |
| Chromium | ppm | ASTM D5185m | >20 | **<1** | <1 | <1 |
| Nickel | ppm | ASTM D5185m | >4 | **0** | 0 | 0 |
| Titanium | ppm | ASTM D5185m | | **<1** | <1 | <1 |
| Silver | ppm | ASTM D5185m | >3 | **0** | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >20 | **4** | 1 | 1 |
| Lead | ppm | ASTM D5185m | >40 | **2** | <1 | 0 |
| Copper | ppm | ASTM D5185m | >330 | **2** | <1 | 2 |
| Tin | ppm | ASTM D5185m | >15 | **<1** | <1 | 0 |
| Vanadium | ppm | ASTM D5185m | | **<1** | 0 | 0 |
| Cadmium | ppm | ASTM D5185m | | **0** | 0 | 0 |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | 2 | **4** | 6 | 11 |
| Barium | ppm | ASTM D5185m | 0 | **<1** | 11 | 0 |
| Molybdenum | ppm | ASTM D5185m | 50 | **66** | 71 | 62 |
| Manganese | ppm | ASTM D5185m | 0 | **1** | <1 | <1 |
| Magnesium | ppm | ASTM D5185m | 950 | **913** | 1013 | 912 |
| Calcium | ppm | ASTM D5185m | 1050 | **1240** | 1226 | 1135 |
| Phosphorus | ppm | ASTM D5185m | 995 | **1051** | 1130 | 1037 |
| Zinc | ppm | ASTM D5185m | 1180 | **1294** | 1387 | 1275 |
| Sulfur | ppm | ASTM D5185m | 2600 | **3634** | 3902 | 3716 |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >25 | **4** | 4 | 4 |
| Sodium | ppm | ASTM D5185m | | **31** | 22 | 20 |
| Potassium | ppm | ASTM D5185m | >20 | **11** | 6 | 7 |

| INFRA-RED | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Soot % | % | *ASTM D7844 | >3 | **2.2** | 2.2 | 1.4 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | **10.8** | 10.7 | 7.7 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | **23.1** | 23.8 | 19.1 |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | **16.3** | 16.8 | 14.0 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | | **9.6** | 10.9 | 8.8 |

# OIL ANALYSIS REPORT

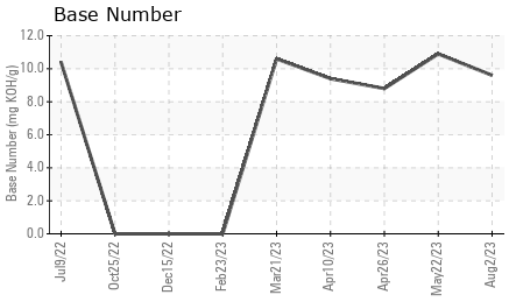


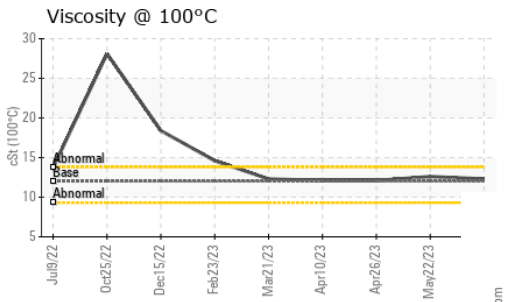


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Silt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Debris | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Appearance | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Odor | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | **NEG** | NEG | NEG |
| Free Water | scalar | *Visual | | **NEG** | NEG | NEG |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 100°C | cSt | ASTM D445 | 12.00 | **12.3** | 12.6 | 12.1 |

## GRAPHS

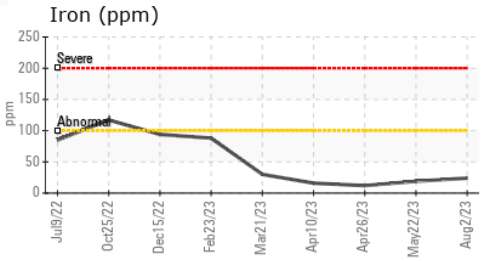


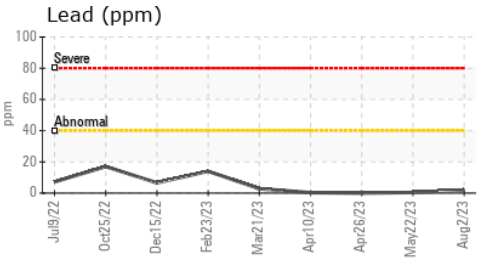


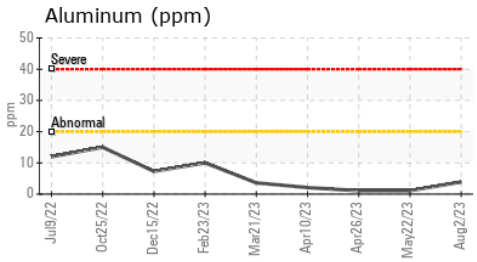


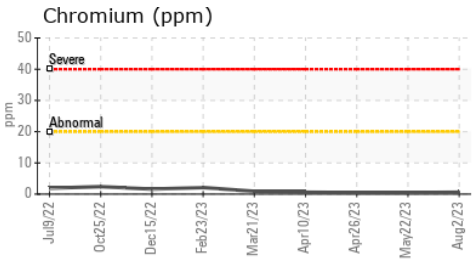


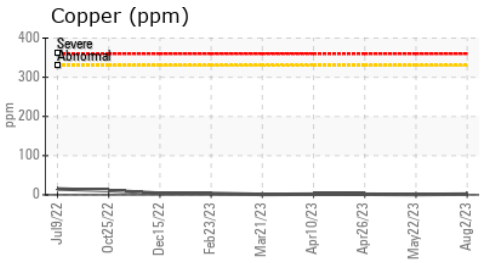


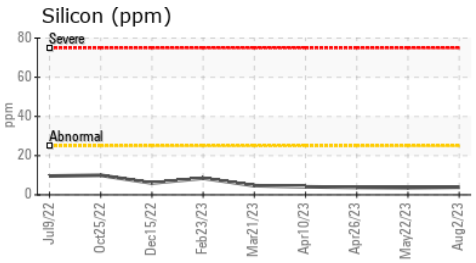


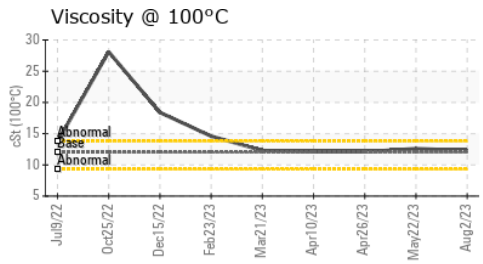


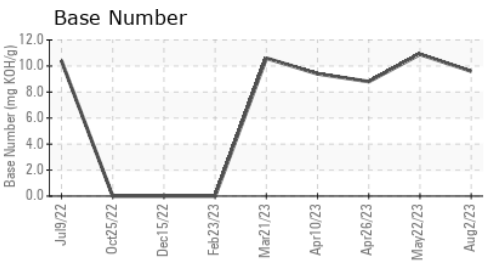


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : PCA0100904 **Received** : 14 Aug 2023
**Lab Number** : 05923031 **Diagnosed** : 14 Aug 2023
**Unique Number** : 10602978 **Diagnostician** : Wes Davis
**Test Package** : MOB 1 ( Additional Tests: TBN )

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*

**MILLER TRUCK LEASING #114**
63 REPAUPO STATION ROAD
LOGAN TOWNSHIP, NJ
US 08085
Contact: ED DAVIS
edavis@millertransgroup.com
T: (856)214-3521
F: (856)214-3663