# PROBLEM SUMMARY

Machine Id
**723031-303001**
Component
**Diesel Engine**
Fluid
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

**Sample Rating Trend**




**FUEL**

## COMPONENT CONDITION SUMMARY




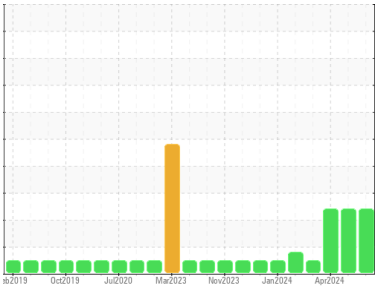


## RECOMMENDATION

We advise that you check the fuel injection system. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

## PROBLEMATIC TEST RESULTS
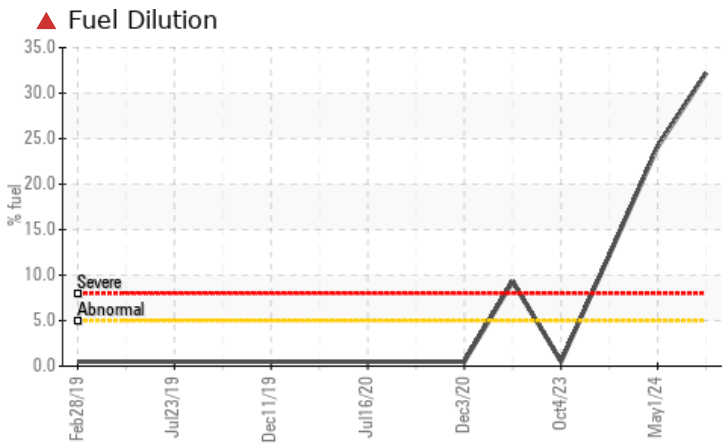
| Sample Status | | | | **SEVERE** | SEVERE | SEVERE |
|---|---|---|---|---|---|---|
| Fuel | % | ASTM D3524 | >5 | ▲ **32.2** | ▲ 24.1 | ▲ 12.2 |
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | ▲ **8.6** | ▲ 9.1 | ▲ 11.3 |

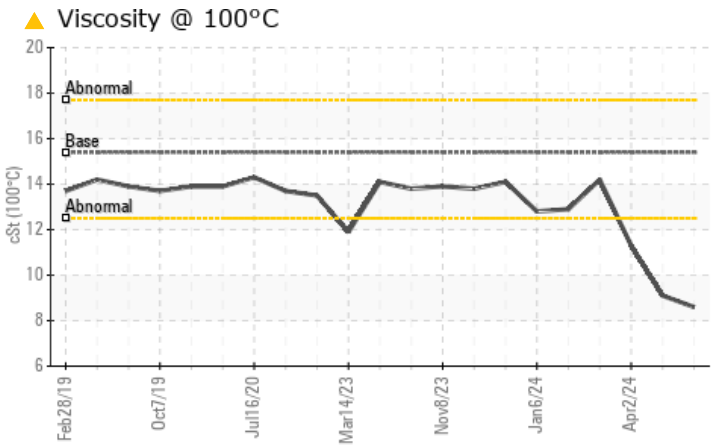**Customer Id:** GFL837
**Sample No.:** GFL0118825
**Lab Number:** 06178534
**Test Package:** FLEET

*To manage this report scan the QR code*

*To discuss the diagnosis or test data:*
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

*To change component or sample information:*
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

## RECOMMENDED ACTIONS

| Action | Status | Date | Done By | Description |
|---|---|---|---|---|
| Change Fluid | --- | --- | ? | Oil and filter change at the time of sampling has been noted. |
| Change Filter | --- | --- | ? | Oil and filter change at the time of sampling has been noted. |
| Resample | --- | --- | ? | We recommend an early resample to monitor this condition. |
| Check Fuel/injector System | --- | --- | ? | We advise that you check the fuel injection system. |

## HISTORICAL DIAGNOSIS

FUEL

**01 May 2024 Diag: Don Baldridge**
We advise that you check the fuel injection system. We recommend that you drain the oil and perform a filter service on this component if not already done. We recommend an early resample to monitor this condition.All component wear rates are normal. There is a very high amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

view report

FUEL

**02 Apr 2024 Diag: Wes Davis**
We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.All component wear rates are normal. There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

view report

NORMAL

**05 Mar 2024 Diag: Wes Davis**
Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report

# OIL ANALYSIS REPORT

Machine Id
**723031-303001**
Component
**Diesel Engine**
Fluid
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

Sample Rating Trend




**FUEL**

## DIAGNOSIS

**Recommendation**
We advise that you check the fuel injection system. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

**Wear**
All component wear rates are normal.

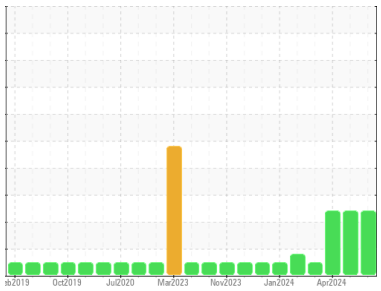**Contamination**
There is a high amount of fuel present in the oil.

**Fluid Condition**
Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **GFL0118825** | GFL0118848 | GFL0114192 |
| Sample Date | | Client Info | | **09 May 2024** | 01 May 2024 | 02 Apr 2024 |
| Machine Age | hrs | Client Info | | **20791** | 20755 | 25599 |
| Oil Age | hrs | Client Info | | **25859** | 25859 | 5408 |
| Oil Changed | | Client Info | | **Changed** | Not Changd | Not Changd |
| Sample Status | | | | **SEVERE** | SEVERE | SEVERE |

| CONTAMINATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Water | | WC Method | >0.2 | **NEG** | NEG | NEG |
| Glycol | | WC Method | | **NEG** | NEG | NEG |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >80 | **68** | 63 | 33 |
| Chromium | ppm | ASTM D5185m | >5 | **3** | 3 | 1 |
| Nickel | ppm | ASTM D5185m | >2 | **<1** | 0 | 0 |
| Titanium | ppm | ASTM D5185m | | **<1** | 0 | 0 |
| Silver | ppm | ASTM D5185m | >3 | **0** | 0 | 0 |
| Aluminum | ppm | ASTM D5185m | >30 | **9** | 8 | 5 |
| Lead | ppm | ASTM D5185m | >30 | **<1** | <1 | 0 |
| Copper | ppm | ASTM D5185m | >150 | **3** | 2 | <1 |
| Tin | ppm | ASTM D5185m | >5 | **2** | <1 | <1 |
| Vanadium | ppm | ASTM D5185m | | **<1** | 0 | 0 |
| Cadmium | ppm | ASTM D5185m | | **<1** | 0 | 0 |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | 0 | **1** | 0 | 3 |
| Barium | ppm | ASTM D5185m | 0 | **0** | 0 | 0 |
| Molybdenum | ppm | ASTM D5185m | 60 | **49** | 52 | 57 |
| Manganese | ppm | ASTM D5185m | 0 | **<1** | 1 | <1 |
| Magnesium | ppm | ASTM D5185m | 1010 | **733** | 868 | 926 |
| Calcium | ppm | ASTM D5185m | 1070 | **880** | 1022 | 1051 |
| Phosphorus | ppm | ASTM D5185m | 1150 | **811** | 912 | 1043 |
| Zinc | ppm | ASTM D5185m | 1270 | **1000** | 1119 | 1216 |
| Sulfur | ppm | ASTM D5185m | 2060 | **2074** | 2635 | 3217 |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >20 | **17** | 23 | 17 |
| Sodium | ppm | ASTM D5185m | | **16** | 14 | 6 |
| Potassium | ppm | ASTM D5185m | >20 | **3** | <1 | 2 |
| Fuel | % | ASTM D3524 | >5 | ▲ **32.2** | ▲ 24.1 | ▲ 12.2 |

| INFRA-RED | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Soot % | % | *ASTM D7844 | >3 | **1.9** | 1.7 | 0.9 |
| Nitration | Abs/cm | *ASTM D7624 | >20 | **16.6** | 15.2 | 9.6 |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | **29.4** | 27.7 | 20.6 |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | **35.0** | 32.4 | 17.6 |
| Base Number (BN) | mg KOH/g | ASTM D2896 | 9.8 | **5.6** | 5.9 | 8.7 |

# OIL ANALYSIS REPORT

Fuel Dilution




FT-IR (Direct Trend)




FT-IR (Direct Trend)

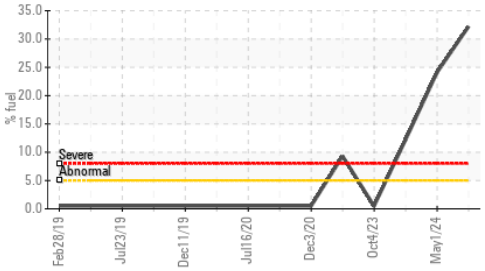


Base Number

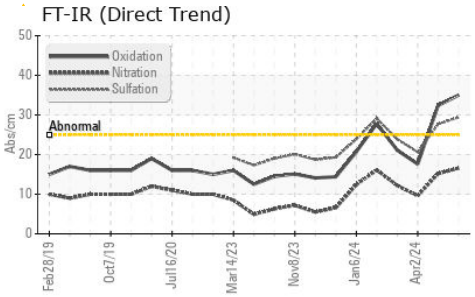


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Precipitate | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Silt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Debris | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | NONE | NONE |
| Appearance | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Odor | scalar | *Visual | NORML | **NORML** | NORML | NORML |
| Emulsified Water | scalar | *Visual | >0.2 | **NEG** | NEG | NEG |
| Free Water | scalar | *Visual | | **NEG** | NEG | NEG |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 100°C | cSt | ASTM D445 | 15.4 | ▲ **8.6** | ▲ 9.1 | ▲ 11.3 |
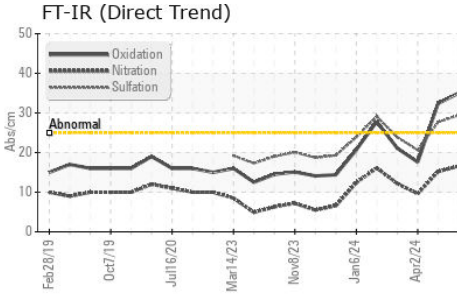
## GRAPHS

Ferrous Alloys

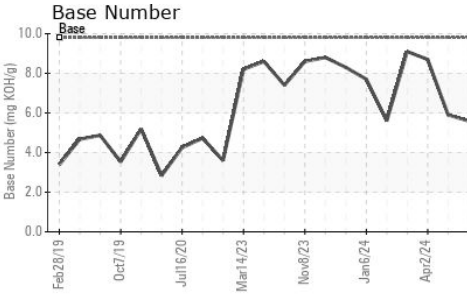


Non-ferrous Metals




Viscosity @ 100°C

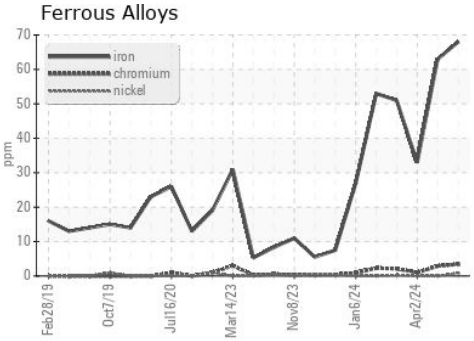


Base Number

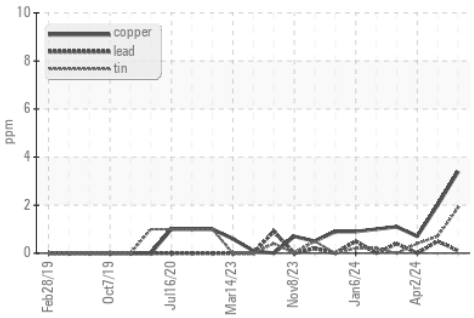


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : GFL0118825
**Lab Number** : 06178534
**Unique Number** : 11029860
**Test Package** : FLEET ( Additional Tests: PercentFuel )

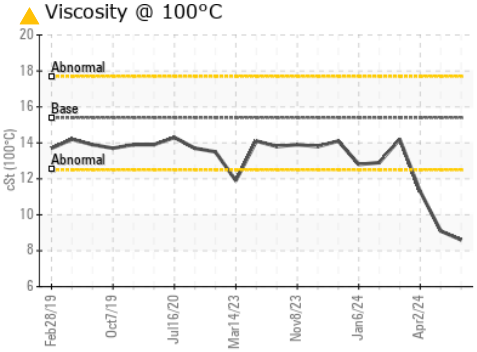**Received** : 14 May 2024
**Tested** : 17 May 2024
**Diagnosed** : 17 May 2024 - Jonathan Hester

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*

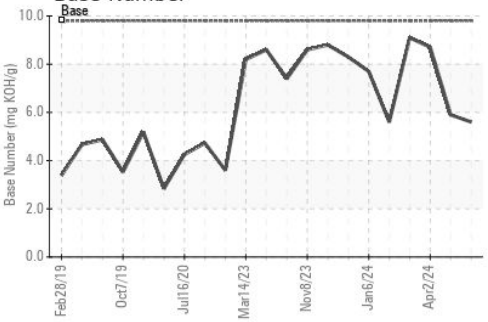**GFL Environmental - 837 - Harrison TS**
22820 S State Route 291
Harrisonville, MO
US 64701
Contact: SARA PATRICK
spatrick@gflenv.com
T:
F:

Report Id: GFL837 [WUSCAR] 06178534 (Generated: 05/17/2024 12:52:11) Rev: 1

Submitted By: JEREMY BROWN