OIL ANALYSIS REPORT

Sample Rating Trend

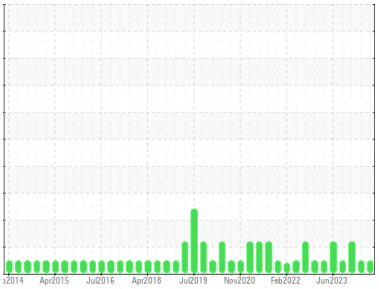

NORMAL

Area
SAB2
Machine Id
SAB2 G26
Component
Thrust Bearing
Fluid
ESSO TERESSO ISO 46 (5000 LTR)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear
Component wear rates appear to be normal (unconfirmed).

Contamination
The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Particle Filter (Magn: 100 x)

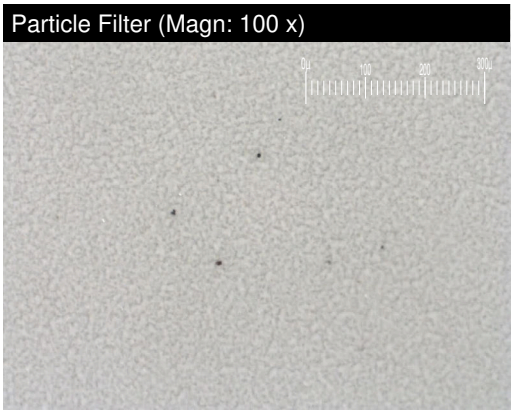

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0890879**	WC0801630	WC0858111
Sample Date		Client Info		**27 Mar 2024**	07 Jan 2024	25 Oct 2023
Machine Age	hrs	Client Info		**0**	0	0
Oil Age	hrs	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**NORMAL**	NORMAL	ABNORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Water		WC Method	>2	**NEG**	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>85	**<1**	<1	<1
Chromium	ppm	ASTM D5185(m)	>20	**0**	0	0
Nickel	ppm	ASTM D5185(m)	>20	**0**	<1	0
Titanium	ppm	ASTM D5185(m)		**0**	0	0
Silver	ppm	ASTM D5185(m)		**0**	0	<1
Aluminum	ppm	ASTM D5185(m)	>40	**0**	<1	0
Lead	ppm	ASTM D5185(m)	>60	**0**	<1	<1
Copper	ppm	ASTM D5185(m)	>7	**0**	<1	<1
Tin	ppm	ASTM D5185(m)	>40	**0**	0	0
Antimony	ppm	ASTM D5185(m)		**0**	0	0
Vanadium	ppm	ASTM D5185(m)		**0**	0	0
Beryllium	ppm	ASTM D5185(m)		**0**	0	0
Cadmium	ppm	ASTM D5185(m)		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	**0**	0	<1
Barium	ppm	ASTM D5185(m)		**0**	0	<1
Molybdenum	ppm	ASTM D5185(m)	0	**0**	0	0
Manganese	ppm	ASTM D5185(m)		**0**	0	0
Magnesium	ppm	ASTM D5185(m)	0	**0**	0	0
Calcium	ppm	ASTM D5185(m)	0	**0**	0	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	**<1**	0	<1
Zinc	ppm	ASTM D5185(m)	0	**<1**	<1	<1
Sulfur	ppm	ASTM D5185(m)		**1519**	1595	1527
Lithium	ppm	ASTM D5185(m)		**<1**	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	**0**	<1	<1
Sodium	ppm	ASTM D5185(m)		**0**	0	0
Potassium	ppm	ASTM D5185(m)	>20	**<1**	<1	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	**358**	561	440
Particles >6µm		ASTM D7647	>1300	**116**	157	120
Particles >14µm		ASTM D7647	>160	**17**	15	7
Particles >21µm		ASTM D7647	>40	**5**	6	2
Particles >38µm		ASTM D7647	>10	**1**	1	1
Particles >71µm		ASTM D7647	>3	**0**	1	0
Oil Cleanliness		ISO 4406 (c)	>20/17/14	**16/14/11**	16/14/11	16/14/10

OIL ANALYSIS REPORT

Particle Count

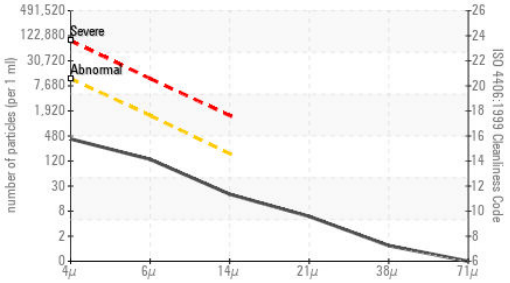

Acid Number

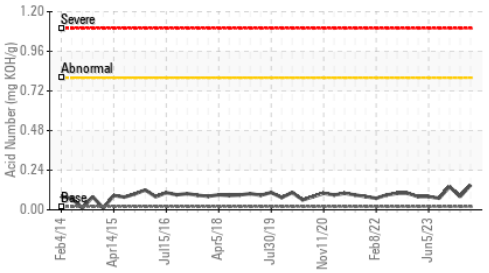

Viscosity @ 40°C

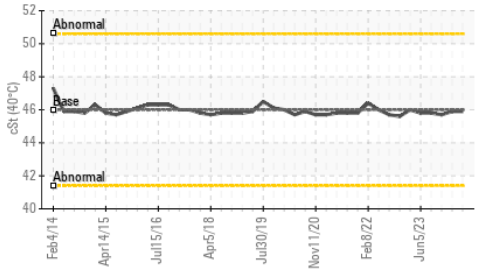

Particle Trend

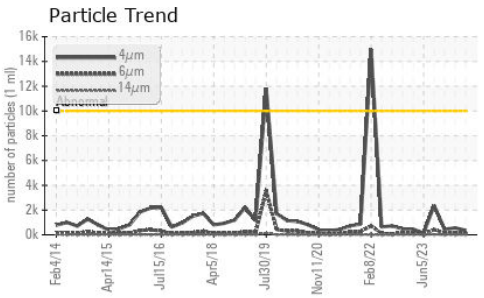

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	**0.15**	0.08	0.14

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	**NONE**	NONE	▲ VLITE
Yellow Metal	scalar	Visual*	NONE	**NONE**	NONE	NONE
Precipitate	scalar	Visual*	NONE	**NONE**	NONE	NONE
Silt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Debris	scalar	Visual*	NONE	**NONE**	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	**NONE**	NONE	NONE
Appearance	scalar	Visual*	NORML	**NORML**	NORML	NORML
Odor	scalar	Visual*	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	Visual*	>2	**NEG**	NEG	NEG
Free Water	scalar	Visual*		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	**45.9**	45.9	45.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					
PrtFilter					

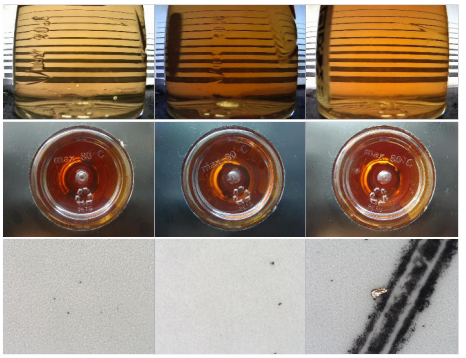

ISO 17025:2017 Accredited Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0890879 **Received** : 28 Mar 2024
Lab Number : 02625285 **Tested** : 01 Apr 2024
Unique Number : 5750404 **Diagnosed** : 01 Apr 2024 - Kevin Marson
Test Package : IND 2 (Additional Tests: BottomAnalysis, FilterPatch, PrtFilter, TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
Validity of results and interpretation are based on the sample and information as supplied.

Ontario Power Generation
NIAGARA PLANT GROUP,, 14000 NIAGARA PKWY
NIAGARA ON THE LAKE, ON
CA L0S 1J0
Contact: Alex Courtemanche
alex.courtemanche@opg.com
T: (905)357-0322
F: (905)357-6558