PROBLEM SUMMARY

Sample Rating Trend

ISO

Area
37372 (TRACE PO 36471)
Machine Id
JP8TS0001-08142023C
Component
Hydraulic System
Fluid
JP8 MIL-DTL-83133 (--- GAL)

COMPONENT CONDITION SUMMARY

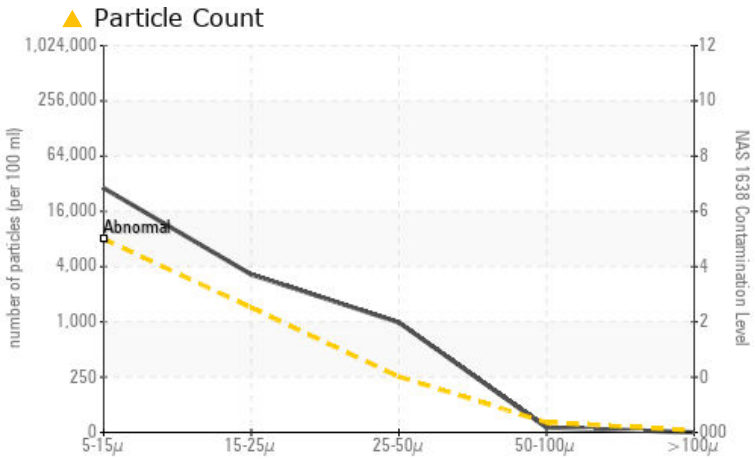

RECOMMENDATION

We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

PROBLEMATIC TEST RESULTS

Sample Status				**ABNORMAL**	---	---
Particles 5-15µm	count	*NAS 1638	>8000	▲ **28657**	---	---
Particles 15-25µm	count	*NAS 1638	>1425	▲ **3284**	---	---
Particles 25-50µm	count	*NAS 1638	>253	▲ **987**	---	---

Customer Id: RIDHAM
Sample No.: WC05926947
Lab Number: 05926947
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Doug Bogart +1 (800)237-1369 x4016
dougb@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.
Filter Fluid	---	---	?	We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

HISTORICAL DIAGNOSIS

OIL ANALYSIS REPORT

Sample Rating Trend

ISO

Area
37372 (TRACE PO 36471)
Machine Id
JP8TS0001-08142023C
Component
Hydraulic System
Fluid
JP8 MIL-DTL-83133 (--- GAL)

DIAGNOSIS

Recommendation
We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid.

Wear
All component wear rates are normal.

Contamination
There is a high amount of particulates present in the oil. The system cleanliness is above the acceptable limit for the target SAE AS4059 (replaces NAS 1638) cleanliness code.

Fluid Condition
The AN level is acceptable for this fluid.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC05926947**	---	---
Sample Date		Client Info		**15 Aug 2023**	---	---
Machine Age	hrs	Client Info		**0**	---	---
Oil Age	hrs	Client Info		**0**	---	---
Oil Changed		Client Info		**N/A**	---	---
Sample Status				**ABNORMAL**	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	**0**	---	---
Chromium	ppm	ASTM D5185m	>20	**0**	---	---
Nickel	ppm	ASTM D5185m	>20	**0**	---	---
Titanium	ppm	ASTM D5185m		**0**	---	---
Silver	ppm	ASTM D5185m		**0**	---	---
Aluminum	ppm	ASTM D5185m	>20	**0**	---	---
Lead	ppm	ASTM D5185m	>20	**0**	---	---
Copper	ppm	ASTM D5185m	>20	**0**	---	---
Tin	ppm	ASTM D5185m	>20	**0**	---	---
Vanadium	ppm	ASTM D5185m		**0**	---	---
Cadmium	ppm	ASTM D5185m		**0**	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	---	---
Barium	ppm	ASTM D5185m		**2**	---	---
Molybdenum	ppm	ASTM D5185m		**0**	---	---
Manganese	ppm	ASTM D5185m		**0**	---	---
Magnesium	ppm	ASTM D5185m		**0**	---	---
Calcium	ppm	ASTM D5185m		**0**	---	---
Phosphorus	ppm	ASTM D5185m		**1**	---	---
Zinc	ppm	ASTM D5185m		**0**	---	---
Sulfur	ppm	ASTM D5185m		**0**	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	**<1**	---	---
Sodium	ppm	ASTM D5185m		**0**	---	---
Potassium	ppm	ASTM D5185m	>20	**<1**	---	---
Water	%	ASTM D6304	>0.05	**0.004**	---	---
ppm Water	ppm	ASTM D6304	>500	**41.4**	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles 5-15µm	count	*NAS 1638	>8000	▲ **28657**	---	---
Particles 15-25µm	count	*NAS 1638	>1425	▲ **3284**	---	---
Particles 25-50µm	count	*NAS 1638	>253	▲ **987**	---	---
Particles 50-100µm	count	*NAS 1638	>45	**22**	---	---
Particles >100µm	count	*NAS 1638	>8	**0**	---	---
NAS 1638	Class	*NAS 1638	>5	**7**	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.045**	---	---

OIL ANALYSIS REPORT

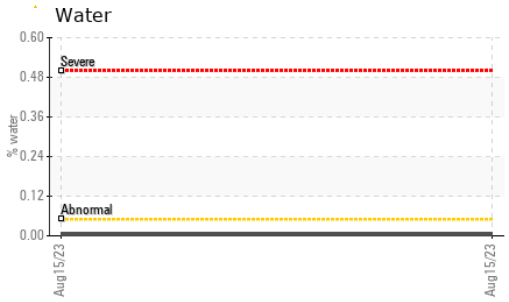

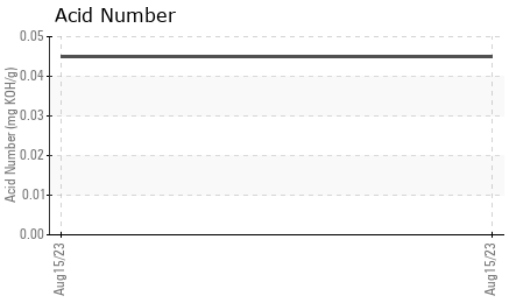

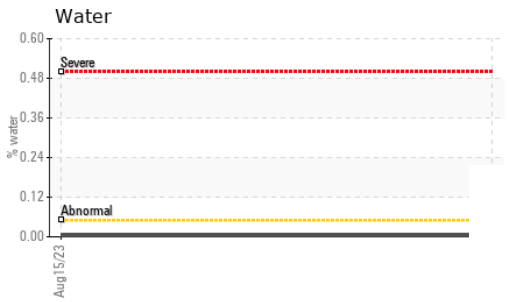

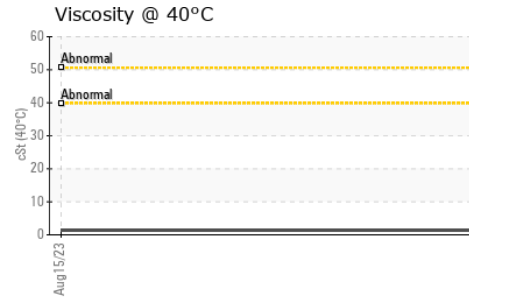

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	---	---
Yellow Metal	scalar	*Visual	NONE	**NONE**	---	---
Precipitate	scalar	*Visual	NONE	**NONE**	---	---
Silt	scalar	*Visual	NONE	**NONE**	---	---
Debris	scalar	*Visual	NONE	**NONE**	---	---
Sand/Dirt	scalar	*Visual	NONE	**NONE**	---	---
Appearance	scalar	*Visual	NORML	**NORML**	---	---
Odor	scalar	*Visual	NORML	**NORML**	---	---
Emulsified Water	scalar	*Visual	>0.05	**NEG**	---	---
Free Water	scalar	*Visual		**NEG**	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445		**1.4**	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				*no image*	*no image*
Bottom				*no image*	*no image*

GRAPHS

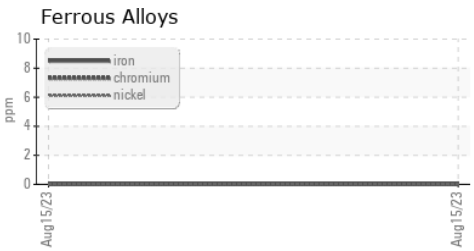

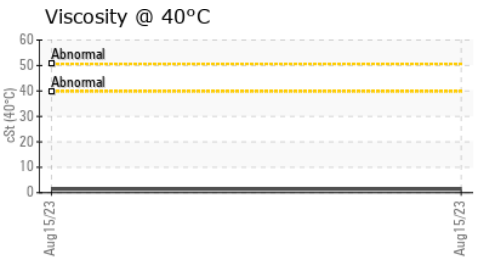

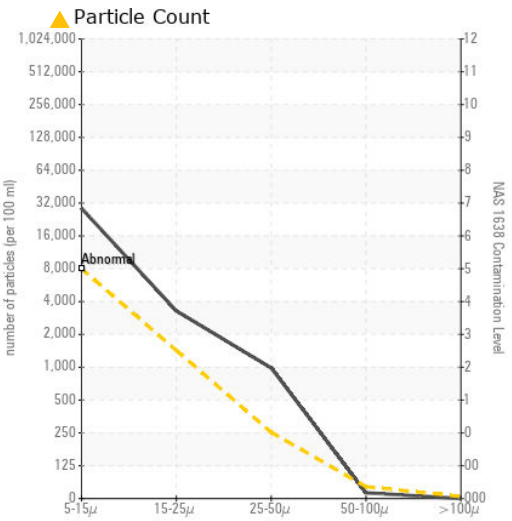

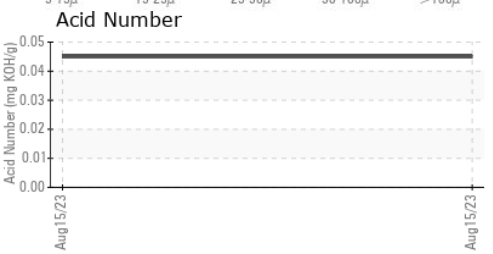

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC05926947 **Received** : 16 Aug 2023
Lab Number : 05926947 **Diagnosed** : 22 Aug 2023
Unique Number : 10606894 **Diagnostician** : Doug Bogart
Test Package : IND 2 (Additional Tests: KF, PrtCountNAS)

Certificate L2367

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

RIDGE ENGINEERING
3987 HAMPSTEAD-MEXICO RD
HAMPSTEAD, MD
US 21074
Contact: BETHANY HUGHES*
bethany@ridgeeng.com
T:
F: