PROBLEM SUMMARY

Area
RP-101
Machine Id
B23353 - PRESS 3
Component
Gearbox
Fluid
MOBIL SHC 636 (--- QTS)

Sample Rating Trend

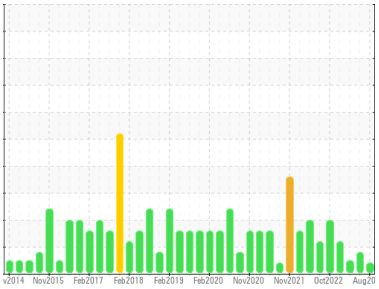

VIS DEBRIS

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				**ABNORMAL**	ATTENTION	NORMAL
Debris	scalar	*Visual	NONE	▲ **MODER**	NONE	VLITE

Customer Id: HORAUS
Sample No.: WC0826161
Lab Number: 05927207
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

07 May 2023 Diag: Wes Davis

ISO

We recommend you service the filters on this component. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is a light amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

02 Feb 2023 Diag: Wes Davis

NORMAL

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

08 Nov 2022 Diag: Don Baldridge

VISUAL METAL

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to metal particles present in this sample.Moderate concentration of visible metal present. All component wear rates are normal. No other contaminants were detected in the oil. The AN level is acceptable for this fluid.

view report

OIL ANALYSIS REPORT

Area
RP-101
Machine Id
B23353 - PRESS 3
Component
Gearbox
Fluid
MOBIL SHC 636 (--- QTS)

Sample Rating Trend

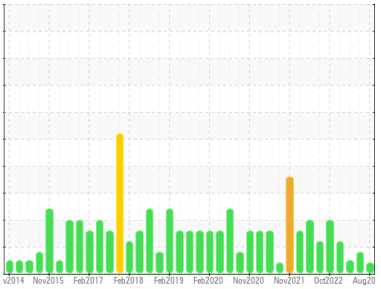

VIS DEBRIS

DIAGNOSIS

Recommendation
We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear
All component wear rates are normal.

Contamination
Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**WC0826161**	WC0791945	WC0765479
Sample Date		Client Info		**06 Aug 2023**	07 May 2023	02 Feb 2023
Machine Age	wks	Client Info		**0**	0	0
Oil Age	wks	Client Info		**0**	0	0
Oil Changed		Client Info		**N/A**	N/A	N/A
Sample Status				**ABNORMAL**	ATTENTION	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	**3**	3	3
Chromium	ppm	ASTM D5185m	>15	**0**	0	0
Nickel	ppm	ASTM D5185m	>15	**0**	0	0
Titanium	ppm	ASTM D5185m		**<1**	0	0
Silver	ppm	ASTM D5185m		**0**	0	0
Aluminum	ppm	ASTM D5185m	>25	**<1**	0	<1
Lead	ppm	ASTM D5185m	>100	**<1**	0	0
Copper	ppm	ASTM D5185m	>200	**<1**	0	0
Tin	ppm	ASTM D5185m	>25	**0**	0	0
Vanadium	ppm	ASTM D5185m		**<1**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	0	0
Barium	ppm	ASTM D5185m		**0**	2	0
Molybdenum	ppm	ASTM D5185m		**0**	0	0
Manganese	ppm	ASTM D5185m		**<1**	0	0
Magnesium	ppm	ASTM D5185m		**3**	0	0
Calcium	ppm	ASTM D5185m		**0**	0	1
Phosphorus	ppm	ASTM D5185m		**382**	412	341
Zinc	ppm	ASTM D5185m		**0**	<1	1
Sulfur	ppm	ASTM D5185m		**272**	117	94

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	**14**	16	15
Sodium	ppm	ASTM D5185m		**4**	0	2
Potassium	ppm	ASTM D5185m	>20	**3**	<1	0
Water	%	ASTM D6304	>0.2	**0.055**	---	---
ppm Water	ppm	ASTM D6304	>2000	**550**	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	**---**	▲ 10839	5014
Particles >6µm		ASTM D7647	>2500	**---**	2346	1855
Particles >14µm		ASTM D7647	>320	**---**	143	261
Particles >21µm		ASTM D7647	>80	**---**	34	80
Particles >38µm		ASTM D7647	>20	**---**	1	5
Particles >71µm		ASTM D7647	>4	**---**	0	0
Oil Cleanliness		ISO 4406 (c)	>20/18/15	**---**	▲ 21/18/14	20/18/15

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.39**	0.39	0.34

OIL ANALYSIS REPORT

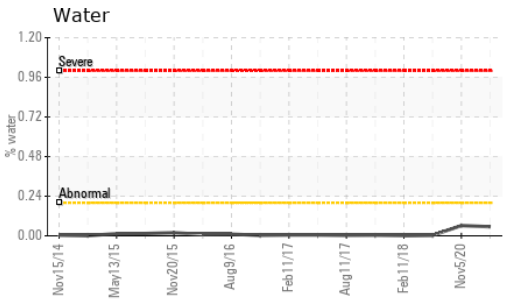

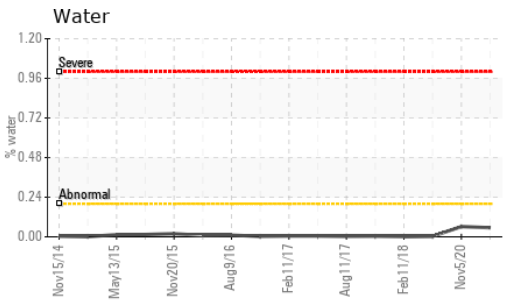

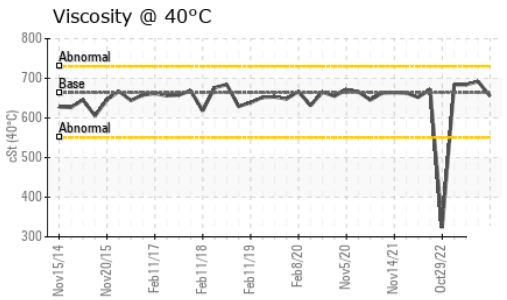

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	▲ **MODER**	NONE	VLITE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	**0.2%**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	663.8	**655**	692	684

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			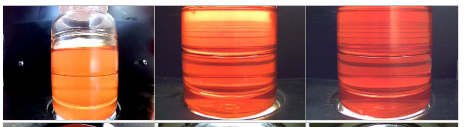		
Bottom			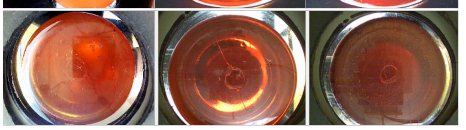		

GRAPHS

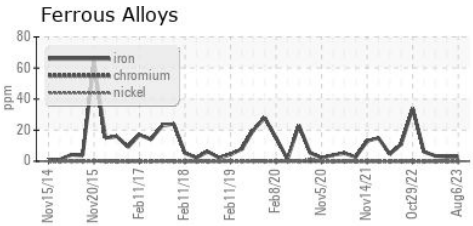

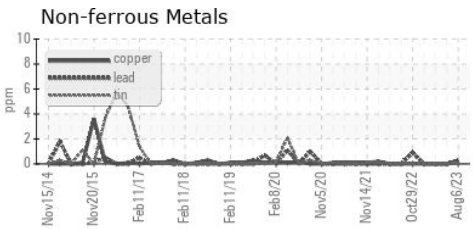

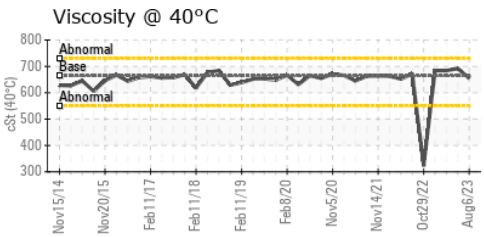

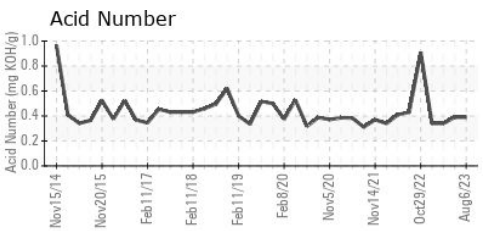

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : WC0826161 **Received** : 17 Aug 2023
Lab Number : 05927207 **Diagnosed** : 22 Aug 2023
Unique Number : 10607154 **Diagnostician** : Jonathan Hester
Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

HORMEL FOODS - AUSTIN
1101 NORTH MAIN ST
AUSTIN, MN
US 55912
Contact: RYAN LOWE
rslowe@hormel.com
T: (507)437-5674
F: (507)437-9805