# OIL ANALYSIS REPORT

Sample Rating Trend


**DEGRADATION**

Area
## TANNER LEANDER
Machine Id
## 17-046S14-8 PRE
Component
**Hydraulic System**
Fluid
**NOT GIVEN (--- QTS)**

## DIAGNOSIS

**Recommendation**

We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

**Wear**

All component wear rates are normal.

**Contamination**

There is no indication of any contamination in the oil. The amount and size of particulates present in the system are acceptable.

**Fluid Condition**

The AN level is at the top-end of the recommended limit.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **WC0837663** | --- | --- |
| Sample Date | | Client Info | | **12 Oct 2023** | --- | --- |
| Machine Age | hrs | Client Info | | **0** | --- | --- |
| Oil Age | hrs | Client Info | | **0** | --- | --- |
| Oil Changed | | Client Info | | **N/A** | --- | --- |
| Sample Status | | | | **ABNORMAL** | --- | --- |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >20 | **0** | --- | --- |
| Chromium | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Nickel | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Titanium | ppm | ASTM D5185m | | **0** | --- | --- |
| Silver | ppm | ASTM D5185m | | **0** | --- | --- |
| Aluminum | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Lead | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Copper | ppm | ASTM D5185m | >75 | **0** | --- | --- |
| Tin | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Vanadium | ppm | ASTM D5185m | | **0** | --- | --- |
| Cadmium | ppm | ASTM D5185m | | **0** | --- | --- |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | | **289** | --- | --- |
| Barium | ppm | ASTM D5185m | | **0** | --- | --- |
| Molybdenum | ppm | ASTM D5185m | | **0** | --- | --- |
| Manganese | ppm | ASTM D5185m | | **<1** | --- | --- |
| Magnesium | ppm | ASTM D5185m | | **0** | --- | --- |
| Calcium | ppm | ASTM D5185m | | **44** | --- | --- |
| Phosphorus | ppm | ASTM D5185m | | **1132** | --- | --- |
| Zinc | ppm | ASTM D5185m | | **0** | --- | --- |
| Sulfur | ppm | ASTM D5185m | | **7009** | --- | --- |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >20 | **<1** | --- | --- |
| Sodium | ppm | ASTM D5185m | | **1** | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | **<1** | --- | --- |
| Water | % | ASTM D6304 | >0.1 | **0.096** | --- | --- |
| ppm Water | ppm | ASTM D6304 | >1000 | **963.9** | --- | --- |

| FLUID CLEANLINESS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Particles >4µm | | ASTM D7647 | >5000 | **328** | --- | --- |
| Particles >6µm | | ASTM D7647 | >1300 | **67** | --- | --- |
| Particles >14µm | | ASTM D7647 | >160 | **5** | --- | --- |
| Particles >21µm | | ASTM D7647 | >40 | **2** | --- | --- |
| Particles >38µm | | ASTM D7647 | >10 | **0** | --- | --- |
| Particles >71µm | | ASTM D7647 | >3 | **0** | --- | --- |
| Oil Cleanliness | | ISO 4406 (c) | >19/17/14 | **16/13/10** | --- | --- |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Acid Number (AN) | mg KOH/g | ASTM D8045 | | **4.46** | --- | --- |

# OIL ANALYSIS REPORT

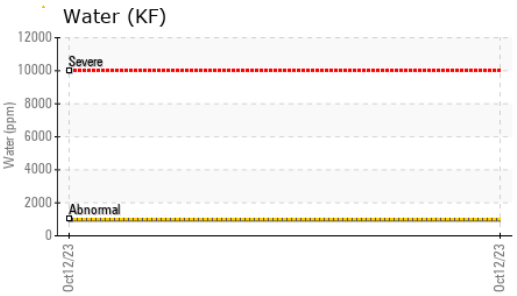


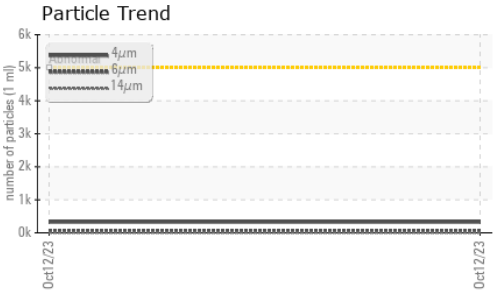


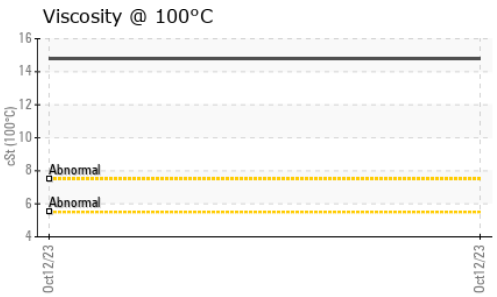


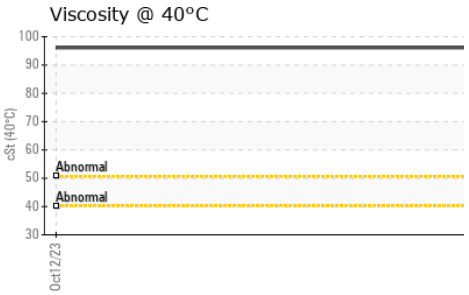


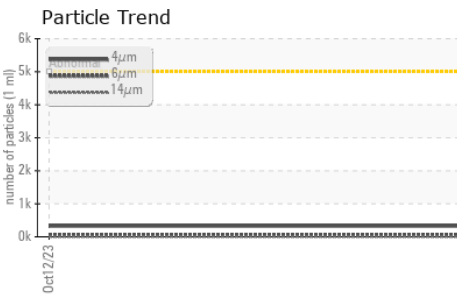


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | --- | --- |
| Precipitate | scalar | *Visual | NONE | **NONE** | --- | --- |
| Silt | scalar | *Visual | NONE | **NONE** | --- | --- |
| Debris | scalar | *Visual | NONE | **NONE** | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | --- | --- |
| Appearance | scalar | *Visual | NORML | **NORML** | --- | --- |
| Odor | scalar | *Visual | NORML | **NORML** | --- | --- |
| Emulsified Water | scalar | *Visual | >0.1 | **NEG** | --- | --- |
| Free Water | scalar | *Visual | | **NEG** | --- | --- |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 40°C | cSt | ASTM D445 | | **96.1** | --- | --- |
| Visc @ 100°C | cSt | ASTM D445 | | **14.8** | --- | --- |
| Viscosity Index (VI) | Scale | ASTM D2270 | | **160** | --- | --- |

| SAMPLE IMAGES | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|
| Color | | |  | *no image* | *no image* |
| Bottom | | |  | *no image* | *no image* |

## GRAPHS


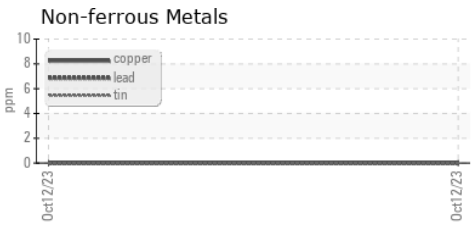


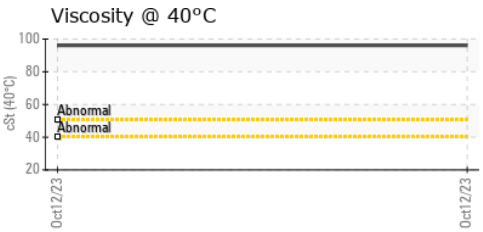


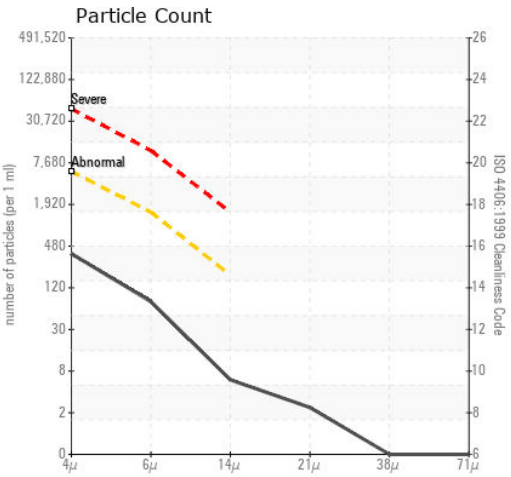


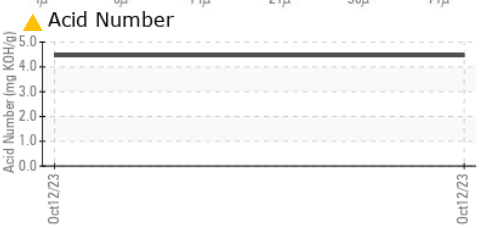


Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : WC0837663 **Received** : 13 Oct 2023
**Lab Number** : 05978897 **Diagnosed** : 17 Oct 2023
**Unique Number** : 10696192 **Diagnostician** : Jonathan Hester
**Test Package** : MOB 2 ( Additional Tests: KF, KV100, VI )

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*

**BASF - TARRYTOWN**
500 WHITE PLAINS RD
TARRYTOWN, NY
US 10591
Contact: TANNER LEANDER
leander.tanner@basf.com
T:
F: (914)785-2166