PROBLEM SUMMARY

Sample Rating Trend

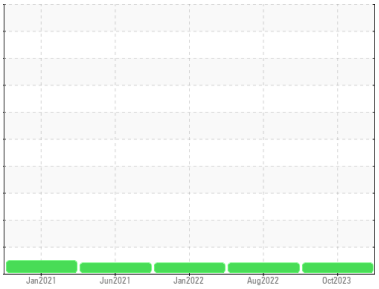

VIS DEBRIS

Machine Id
5804111 (S/N 1130)
Component
Compressor
Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS

Sample Status				**ABNORMAL**	ABNORMAL	ABNORMAL
Debris	scalar	*Visual	NONE	▲ **MODER**	▲ MODER	▲ MODER

Customer Id: FPECIR
Sample No.: KCPA007726
Lab Number: 05998461
Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data:
Don Baldridge +1
don.b505@comcast.net

To change component or sample information:
Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Alert	---	---	?	We were unable to perform a particle count due to a high concentration of particles present in this sample.

HISTORICAL DIAGNOSIS

01 Aug 2022 Diag: Jonathan Hester

VIS DEBRIS

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

---

25 Jan 2022 Diag: Don Baldridge

VIS DEBRIS

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

---

28 Jun 2021 Diag: Angela Borella

VIS DEBRIS

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

KAESER COMPRESSORS
Built for a lifetime.

OIL ANALYSIS REPORT

Sample Rating Trend

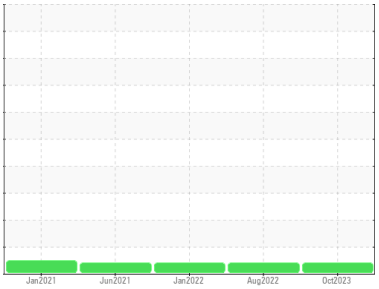

VIS DEBRIS

Machine Id
5804111 (S/N 1130)
Component
Compressor
Fluid
KAESER SIGMA (OEM) M-460 (--- GAL)

DIAGNOSIS

Recommendation
No corrective action is recommended at this time. The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear
All component wear rates are normal.

Contamination
Moderate concentration of visible dirt/debris present in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**KCPA007726**	KCP49694	KCP35135
Sample Date		Client Info		**12 Oct 2023**	01 Aug 2022	25 Jan 2022
Machine Age	hrs	Client Info		**28547**	21216	18368
Oil Age	hrs	Client Info		**0**	2848	1827
Oil Changed		Client Info		**N/A**	Not Changd	Changed
Sample Status				**ABNORMAL**	ABNORMAL	ABNORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	**0**	<1	<1
Chromium	ppm	ASTM D5185m	>10	**0**	0	0
Nickel	ppm	ASTM D5185m	>3	**0**	0	0
Titanium	ppm	ASTM D5185m	>3	**0**	0	0
Silver	ppm	ASTM D5185m	>2	**0**	<1	0
Aluminum	ppm	ASTM D5185m	>10	**0**	2	<1
Lead	ppm	ASTM D5185m	>10	**0**	<1	0
Copper	ppm	ASTM D5185m	>50	**10**	9	10
Tin	ppm	ASTM D5185m	>10	**0**	<1	<1
Antimony	ppm	ASTM D5185m		**---**	---	0
Vanadium	ppm	ASTM D5185m		**0**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	**0**	0	0
Barium	ppm	ASTM D5185m	90	**0**	0	0
Molybdenum	ppm	ASTM D5185m	0	**0**	0	0
Manganese	ppm	ASTM D5185m		**0**	0	0
Magnesium	ppm	ASTM D5185m	100	**0**	11	6
Calcium	ppm	ASTM D5185m	0	**0**	0	0
Phosphorus	ppm	ASTM D5185m	0	**0**	0	3
Zinc	ppm	ASTM D5185m	0	**0**	6	8
Sulfur	ppm	ASTM D5185m	23500	**14424**	16718	16247

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	**0**	0	<1
Sodium	ppm	ASTM D5185m		**<1**	2	5
Potassium	ppm	ASTM D5185m	>20	**0**	2	0
Water	%	ASTM D6304	>0.05	**0.008**	0.013	0.003
ppm Water	ppm	ASTM D6304	>500	**88.0**	133.6	34.3

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	1.0	**0.36**	0.31	0.35

OIL ANALYSIS REPORT

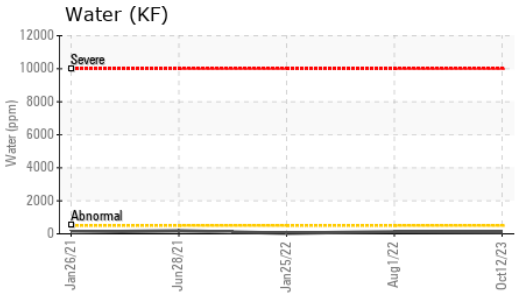

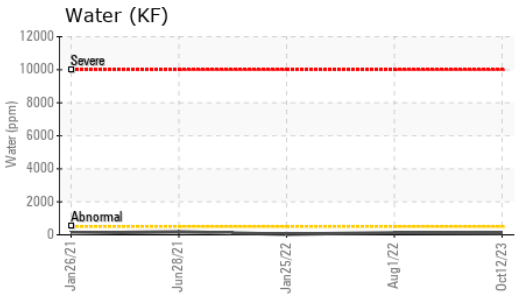

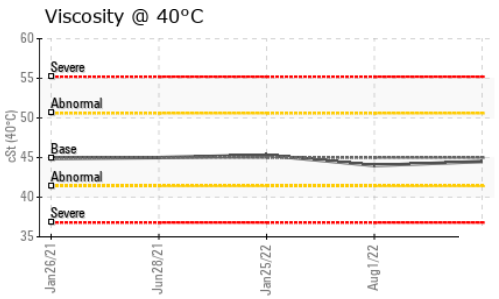

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	▲ **MODER**	▲ MODER	▲ MODER
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>0.05	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	45	**44.5**	44.0	45.3

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color			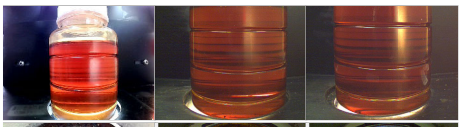		
Bottom			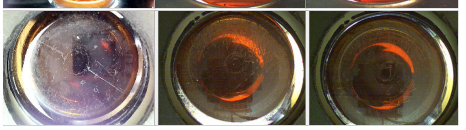		

GRAPHS

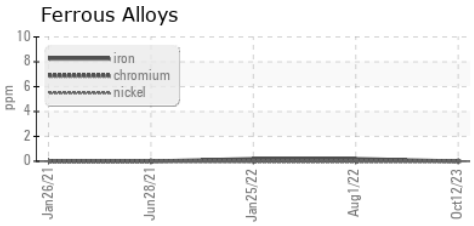

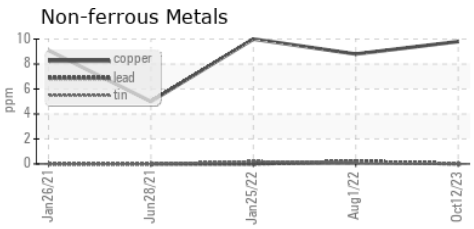

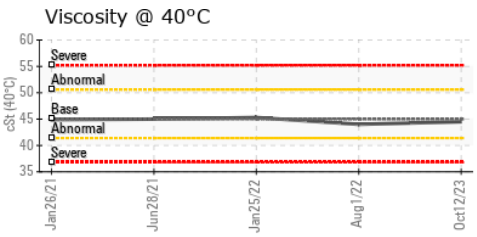

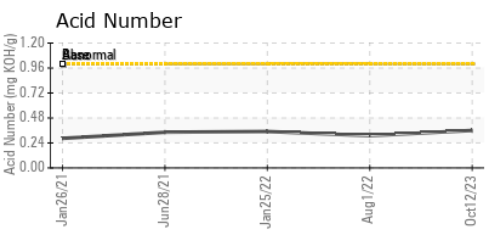

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : KCPA007726 **Received** : 03 Nov 2023
Lab Number : 05998461 **Diagnosed** : 07 Nov 2023
Unique Number : 10726821 **Diagnostician** : Don Baldridge
Test Package : IND 2 (Additional Tests: KF, PrtCount)

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

FPE/GE INDUSTRIES
30672 ORR RD
CIRCLEVILLE, OH
US 43113
Contact: Service Manager

T:
F: