OIL ANALYSIS REPORT

Sample Rating Trend

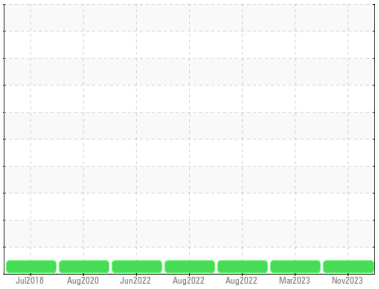

NORMAL

Machine Id
E05431M E05431M
Component
Front Rear Pump
Fluid
ROYAL PURPLE SYNFILM 32 (--- QTS)

DIAGNOSIS

Recommendation
Resample at the next service interval to monitor.

Wear
All component wear rates are normal.

Contamination
There is no indication of any contamination in the oil.

Fluid Condition
The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number		Client Info		**RP0031814**	RP0022157	RP0022153
Sample Date		Client Info		**10 Nov 2023**	03 Mar 2023	31 Aug 2022
Machine Age	hrs	Client Info		**25210**	24028	21068
Oil Age	hrs	Client Info		**0**	24028	0
Oil Changed		Client Info		**Not Changd**	N/A	Not Changd
Sample Status				**NORMAL**	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	**0**	4	4
Chromium	ppm	ASTM D5185m	>5	**0**	0	0
Nickel	ppm	ASTM D5185m	>5	**0**	0	0
Titanium	ppm	ASTM D5185m	>3	**<1**	0	0
Silver	ppm	ASTM D5185m	>3	**0**	<1	0
Aluminum	ppm	ASTM D5185m	>7	**0**	<1	<1
Lead	ppm	ASTM D5185m	>12	**<1**	2	3
Copper	ppm	ASTM D5185m	>30	**2**	2	2
Tin	ppm	ASTM D5185m	>9	**0**	<1	<1
Vanadium	ppm	ASTM D5185m		**<1**	0	0
Cadmium	ppm	ASTM D5185m		**0**	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		**0**	0	0
Barium	ppm	ASTM D5185m		**0**	0	2
Molybdenum	ppm	ASTM D5185m		**0**	0	0
Manganese	ppm	ASTM D5185m		**0**	<1	<1
Magnesium	ppm	ASTM D5185m	90	**0**	57	57
Calcium	ppm	ASTM D5185m		**0**	2	2
Phosphorus	ppm	ASTM D5185m		**0**	7	9
Zinc	ppm	ASTM D5185m		**0**	8	9

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>60	**1**	2	1
Sodium	ppm	ASTM D5185m		**1**	<1	0
Potassium	ppm	ASTM D5185m	>20	**0**	<1	1
Water	%	ASTM D6304	>.1	**0.015**	0.018	0.019
ppm Water	ppm	ASTM D6304	>1000	**156.3**	181.1	193.3

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		**0.31**	0.35	0.46

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	**NONE**	NONE	NONE
Precipitate	scalar	*Visual	NONE	**NONE**	NONE	NONE
Silt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Debris	scalar	*Visual	NONE	**NONE**	VLITE	NONE
Sand/Dirt	scalar	*Visual	NONE	**NONE**	NONE	NONE
Appearance	scalar	*Visual	NORML	**NORML**	NORML	NORML
Odor	scalar	*Visual	NORML	**NORML**	NORML	NORML
Emulsified Water	scalar	*Visual	>.1	**NEG**	NEG	NEG
Free Water	scalar	*Visual		**NEG**	NEG	NEG

OIL ANALYSIS REPORT

Water (KF)

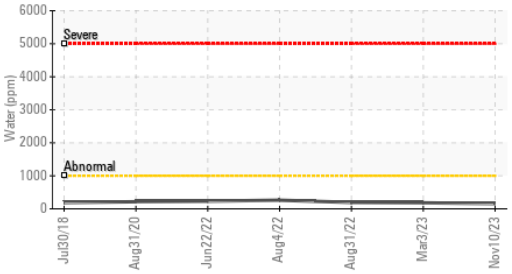

Water (KF)

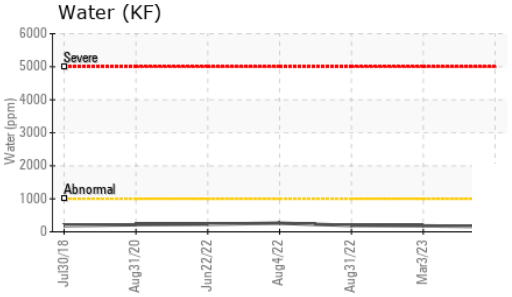

Viscosity @ 40°C

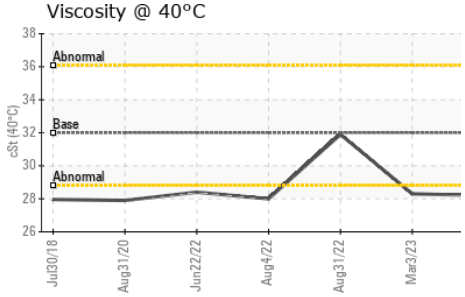

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	32	**28.2**	28.3	31.9

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

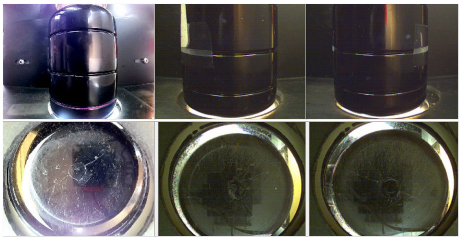

GRAPHS

Ferrous Alloys

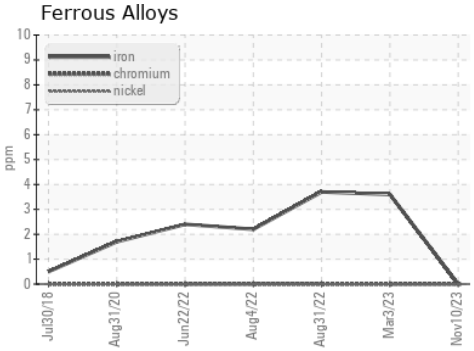

Non-ferrous Metals

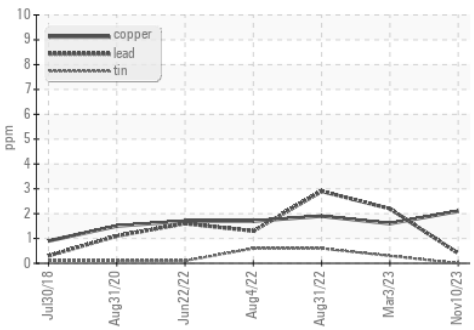

Viscosity @ 40°C

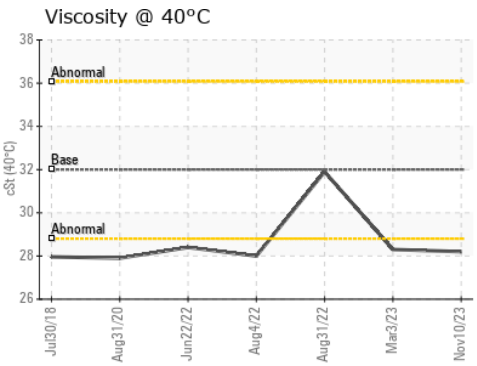

Acid Number

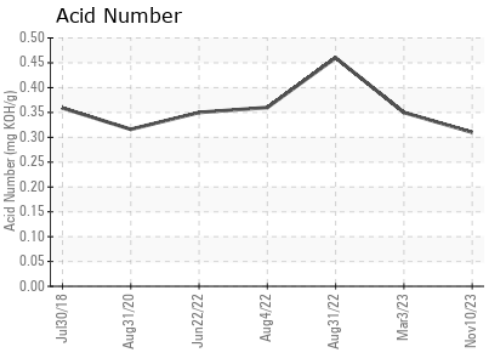

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : RP0031814
Lab Number : 06007769
Unique Number : 10741531
Test Package : IND 2

Received : 14 Nov 2023
Diagnosed : 04 Dec 2023
Diagnostician : Doug Bogart

To discuss this sample report, contact Customer Service at 1-800-237-1369.
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ENERGY TRANSFER - EPPS
745 HWY 134
EPPS, LA
US 71237
Contact: LOUIS FREELAND
louis.freeland@energytransfer.com
T:
F: