KAESER COMPRESSORS
Built for a lifetime.

# OIL ANALYSIS REPORT

Sample Rating Trend

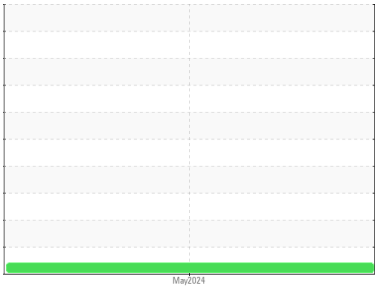


VISCOSITY

Machine Id
## KAESER 8097866
Component
**Compressor**
Fluid
**KAESER SIGMA (OEM) M-460 (--- GAL)**

## DIAGNOSIS

**Recommendation**
Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor.

**Wear**
All component wear rates are normal.

**Contamination**
The amount and size of particulates present in the system are acceptable.

**Fluid Condition**
The oil viscosity is higher than normal. The AN level is acceptable for this fluid.

| SAMPLE INFORMATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Sample Number | | Client Info | | **KCPA017875** | --- | --- |
| Sample Date | | Client Info | | **29 May 2024** | --- | --- |
| Machine Age | hrs | Client Info | | **17817** | --- | --- |
| Oil Age | hrs | Client Info | | **0** | --- | --- |
| Oil Changed | | Client Info | | **Changed** | --- | --- |
| Sample Status | | | | **ABNORMAL** | --- | --- |

| WEAR METALS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Iron | ppm | ASTM D5185m | >50 | **0** | --- | --- |
| Chromium | ppm | ASTM D5185m | >10 | **<1** | --- | --- |
| Nickel | ppm | ASTM D5185m | >3 | **0** | --- | --- |
| Titanium | ppm | ASTM D5185m | >3 | **<1** | --- | --- |
| Silver | ppm | ASTM D5185m | >2 | **0** | --- | --- |
| Aluminum | ppm | ASTM D5185m | >10 | **2** | --- | --- |
| Lead | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Copper | ppm | ASTM D5185m | >50 | **6** | --- | --- |
| Tin | ppm | ASTM D5185m | >10 | **0** | --- | --- |
| Vanadium | ppm | ASTM D5185m | | **0** | --- | --- |
| Cadmium | ppm | ASTM D5185m | | **0** | --- | --- |

| ADDITIVES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Boron | ppm | ASTM D5185m | 0 | **0** | --- | --- |
| Barium | ppm | ASTM D5185m | 90 | **0** | --- | --- |
| Molybdenum | ppm | ASTM D5185m | 0 | **0** | --- | --- |
| Manganese | ppm | ASTM D5185m | | **0** | --- | --- |
| Magnesium | ppm | ASTM D5185m | 100 | **2** | --- | --- |
| Calcium | ppm | ASTM D5185m | 0 | **0** | --- | --- |
| Phosphorus | ppm | ASTM D5185m | 0 | **5** | --- | --- |
| Zinc | ppm | ASTM D5185m | 0 | **0** | --- | --- |
| Sulfur | ppm | ASTM D5185m | 23500 | **14593** | --- | --- |

| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Silicon | ppm | ASTM D5185m | >25 | **<1** | --- | --- |
| Sodium | ppm | ASTM D5185m | | **0** | --- | --- |
| Potassium | ppm | ASTM D5185m | >20 | **1** | --- | --- |
| Water | % | ASTM D6304 | >0.05 | **0.007** | --- | --- |
| ppm Water | ppm | ASTM D6304 | >500 | **77** | --- | --- |

| FLUID CLEANLINESS | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Particles >4µm | | ASTM D7647 | | **698** | --- | --- |
| Particles >6µm | | ASTM D7647 | >1300 | **201** | --- | --- |
| Particles >14µm | | ASTM D7647 | >80 | **12** | --- | --- |
| Particles >21µm | | ASTM D7647 | >20 | **2** | --- | --- |
| Particles >38µm | | ASTM D7647 | >4 | **0** | --- | --- |
| Particles >71µm | | ASTM D7647 | >3 | **0** | --- | --- |
| Oil Cleanliness | | ISO 4406 (c) | >--/17/13 | **17/15/11** | --- | --- |

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Acid Number (AN) | mg KOH/g | ASTM D8045 | 1.0 | **0.48** | --- | --- |

KAESER COMPRESSORS
Built for a lifetime.

# OIL ANALYSIS REPORT

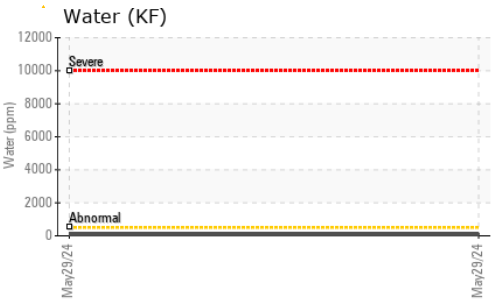


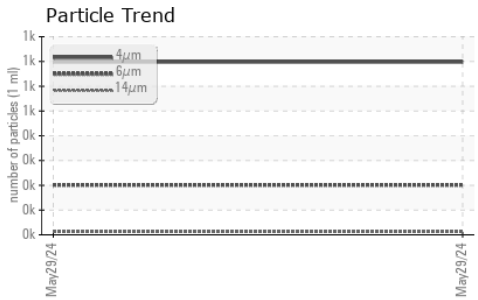


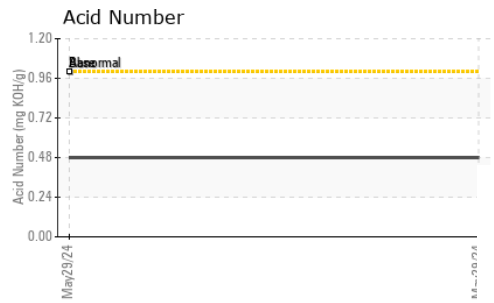


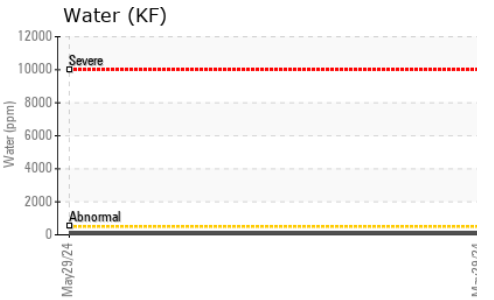


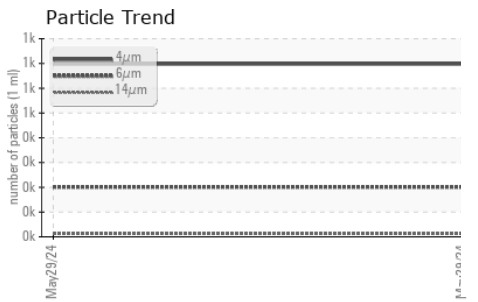


| VISUAL | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| White Metal | scalar | *Visual | NONE | **NONE** | --- | --- |
| Yellow Metal | scalar | *Visual | NONE | **NONE** | --- | --- |
| Precipitate | scalar | *Visual | NONE | **NONE** | --- | --- |
| Silt | scalar | *Visual | NONE | **NONE** | --- | --- |
| Debris | scalar | *Visual | NONE | **NONE** | --- | --- |
| Sand/Dirt | scalar | *Visual | NONE | **NONE** | --- | --- |
| Appearance | scalar | *Visual | NORML | **NORML** | --- | --- |
| Odor | scalar | *Visual | NORML | **NORML** | --- | --- |
| Emulsified Water | scalar | *Visual | >0.05 | **NEG** | --- | --- |
| Free Water | scalar | *Visual | | **NEG** | --- | --- |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|---|
| Visc @ 40°C | cSt | ASTM D445 | 45 | ▲ **53.46** | --- | --- |

| SAMPLE IMAGES | method | limit/base | current | history1 | history2 |
|---|---|---|---|---|---|
| Color | | |  | *no image* | *no image* |
| Bottom | | |  | *no image* | *no image* |

## GRAPHS

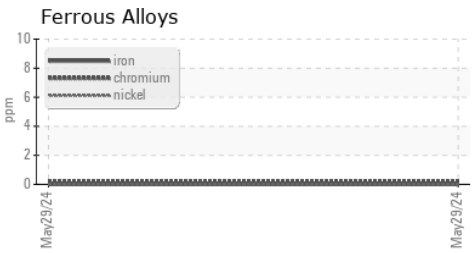


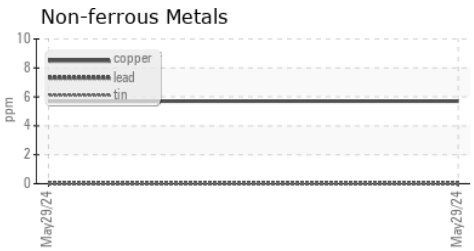


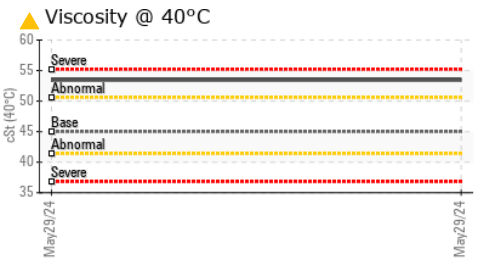


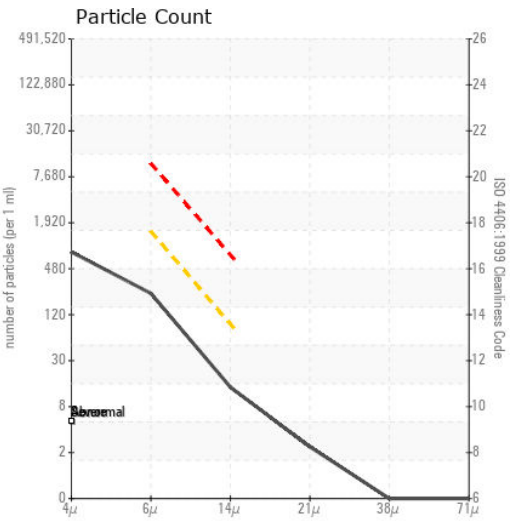


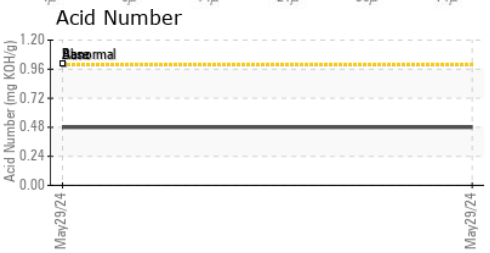


**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513
**Sample No.** : KCPA017875 **Received** : 07 Jun 2024
**Lab Number** : 06203416 **Tested** : 13 Jun 2024
**Unique Number** : 11070877 **Diagnosed** : 13 Jun 2024 - Angela Borella
**Test Package** : IND 2 ( Additional Tests: KF, PrtCount )

Certificate L2367

*To discuss this sample report, contact Customer Service at 1-800-237-1369.*
** - Denotes test methods that are outside of the ISO 17025 scope of accreditation.*
*Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)*

**NOLATO GW INC**
901 PAULSUN ST
SAN ANTONIO, TX
US 78219
Contact: RAMIRO GONZALEZ
ramiro.gonzalez@nolato.com
T:
F: